Supplemental Draft Environmental Impact Statement and Updated Draft Section 4(f) Evaluation

APPENDIX H

NATIONAL PARK SERVICE TREE INVENTORY REPORT



National Park Service Tree Inventory Report

August 25, 2021

U.S. Department of Transportation
Federal Highway Administration

and

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

1 INTRODUCTION

The Federal Highway Administration (FHWA), as the Lead Federal Agency, and the Maryland Department of Transportation State Highway Administration (MDOT SHA), as the Local Project Sponsor, are preparing an Environmental Impact Statement (EIS) in accordance with the National Environmental Policy Act (NEPA) for the I-495 & I-270 Managed Lanes Study (MLS). The purpose of the MLS is to develop a travel demand management solution that addresses congestion and improves trip reliability on I-495 and I-270 within the Study limits and enhances existing and planned multi-modal mobility and connectivity. Efforts have been made throughout the planning process to avoid and minimize impacts to forests to the greatest extent practicable, while still achieving the goals of the MLS. Despite these efforts, impacts to forests are unavoidable due to the extensive forest cover adjacent to the existing roadway.

This report includes tree data for the four National Park Service (NPS) park units within the MLS Draft EIS (DEIS) project limits: the Chesapeake and Ohio (C&O) Canal National Historical Park, Clara Barton Parkway, George Washington Memorial Parkway (GWMP), and National Capital Parks East, which includes Suitland Parkway, Greenbelt Park, and Baltimore-Washington Parkway. A new Preferred Alternative (PA) was announced in May 2021 reducing the limit of disturbance (LOD) to the Alternative 9 - Phase 1 South limits, which extend along I-495 from just south of GWMP to MD-187 and along I-270 including the east and west spurs from I-495 to I-370. The new PA would impact three NPS park units: C&O Canal National Historical Park, Clara Barton Parkway, and GWMP (**Attachment A, Overview Map**). This tree inventory was conducted to document the location, species, size, and condition of trees located within the MLS DEIS LODs on NPS land and does not report PA tree impacts. Impacts for the PA will be included in the SDEIS and impacts to NPS property by the PA have been provided to NPS.

2 METHODS

SURVEY LIMITS

The tree survey area included NPS property within the extent of the I-495 & I-270 Managed Lanes Study (MLS) DEIS Build Alternatives LOD plus a 50-foot buffer, to ensure that all critical roots zones within the LOD would be included. NPS Tree Survey Limits are depicted in **Attachment A** (**NPS Tree Survey Limits – Overview**). This area includes NPS properties located in C&O Canal National Historical Park (**Map 1**), Clara Barton Parkway (**Map 1**), George Washington Memorial Parkway (**Map 2**), and National Capital Parks-East, which includes Baltimore-Washington (BW) Parkway and Greenbelt Park (**Map 3**) and Suitland Parkway (**Map 4**).

TREE INVENTORY

Following the guidance in the *Forest Inventory and Analysis National Core Field Guide, Volume I: Field Data Collection Procedures for Phase 2 Plots, Version 9.0, October 2019*, an inventory of all trees and standing dead trees ≥ 5 inches diameter at breast height (4.5 feet, Diameter at Breast Height (DBH) was completed within the survey limits, including the identification of all significant trees (trees ≥ 24 inches DBH < 30 inches) and specimen trees (≥ 30 inches DBH or 75% of the size of the state champion), if applicable. Tree species, DBH, and condition was recorded for each of the inventoried trees. If a tree had more than one

stem that split below breast height, this was noted in the comments, and the diameter of each stem was recorded. The condition of each tree was assessed by an ocular estimation of growth form, visible signs of decay, live crown ratio, and indications of disease or insect infestation. This condition was recorded on a scale from Excellent to Standing Dead using the following Tree Condition Assessment Guidelines:

- ***Excellent*** – healthy tree with exceptional growth form; no visible defects; well-formed crown; few minor dead branches acceptable; this tree condition is rare.
- ***Good*** – healthy tree; very minor defects/decay acceptable with callous forming/complete; well-formed crown; minor lean and/or few minor/major dead branches acceptable; vines may be growing along trunk but not present within crown.
- ***Fair*** – health questionable/stress evident; structurally sound tree; defects present that do not affect structural integrity; moderate lean; minor/major dead branches may be present; crown not broken out but not necessarily well formed or even; vines may be growing along trunk and within crown.
  Ex. Fair tree could be experiencing insect damage or exhibit a growth form that makes it very susceptible to wind damage in an open setting.
- ***Poor*** – significant health problems; may be structurally unsound; may be dead or dying; may contain significant decay; may have broken or missing top/crown; may have heavy lean; vines may be significantly affecting tree health.
- ***Standing Dead*** – any tree inventoried that was standing upright and determined to be dead by the field team.

The survey took place from mid-August 2020 to the first week of January 2021. Each inventoried tree was marked with chalk and numbered consecutively (notated as the tree ID). Data obtained from the field inventory was collected with an iPad and trees were located using GPS.

Additional trees located south of GWMP from a previous survey conducted by the Virginia Department of Transportation (VDOT) in 2019 were added to the tree inventory mapping. These trees were not resurveyed in this effort, but are shown in different symbology on the Tree Plan for GWMP (**Attachment B**, **GWMP**, Sheets 10-11, 13). Mapping and data from this survey were included in an earlier report provided to NPS by VDOT in February 2020.

TREE INVENTORY CALCULATIONS

Following the collection of tree data, a table was created including: the tree ID, common and scientific names, DBH, number of stems, structural critical root zone (SCRZ), critical root zone (CRZ), tree condition, and tree condition notes (**Attachment B**). SCRZs and CRZs were calculated with the following formulas:

$$SCRZ = DBH * 0.5$$

$$CRZ = DBH * 1.5$$

The DBH column contains the DBHs of all inventoried trees, whether alive or dead. A second table containing the total number of live trees and the sum of the total live DBHs for tree stems greater than five inches in DBH was created (**Table 1**). To calculate the total sum of the DBH values, all live stems greater

than or equal to five inches in DBH were totaled. Standing dead trees, dead stems and stems that were less than five inches DBH were not included in the total.

3 RESULTS

A total of 22,598 trees were inventoried across the entire study area. See **Attachment A** for the inventoried tree locations and **Attachment B** for the tree tables. **Table 1** below breaks down the number of trees and total inches of live DBH per park unit.

Table 1 – Summary of Inventoried Trees

Location	Number of Live Individual Trees	Number of Standing Dead Trees	Total inches of DBH
C&O Canal	1,544	244	19,345
Clara Barton Parkway	756	114	10,098
George Washington Memorial Parkway	2,175	154	31,900
National Capital Parks-East*	16,330	1,281	166,238
TOTAL	**20,805**	**1,793**	**227,581**
*Includes Baltimore-Washington Parkway, Greenbelt Park, and Suitland Parkway			

The average tree DBH was 10 inches. There were a total of 509 significant trees (trees ≥ 24 inches DBH < 30 inches) and 254 specimen trees (≥ 30 inches DBH or 75% of the size of the state champion). There was a high diversity of tree species found within the four park units, with 77 species identified (see **Table 2**).

Table 2 below presents the frequency of live tree species by park unit. Across all park units surveyed, the most frequent tree species inventoried were red maple (*Acer rubrum*), followed by sweetgum (*Liquidambar styraciflua*) and Virginia pine (*Pinus virginiana*; **Table 2**). Within C & O National Historical Park, the three most frequent species were Boxelder (*Acer negundo*), American elm (*Ulmus americana*), and American sycamore (*Platanus occidentalis*; **Table 2**). At Clara Barton Parkway, the three most frequent species were red maple, American elm, and tuliptree (*Liriodendron tulipifera*). Within GWMP, the three most frequent species were tuliptree, red maple, and American beech (*Fagus grandifolia*). Finally, in National Capital Parks-East, red maple, sweetgum, and Virginia pine were most frequent (**Table 2**).

Table 2. Frequency of Live Tree Species by Park Unit

Common Name	Scientific Name	Park Unit			
		C&O	CB	GWMP	NACE
American basswood	*Tilia americana*	5	0	28	0
American beech	*Fagus grandifolia*	19	6	271	190
American chestnut	*Castanea dentata*	0	0	0	1

American elm	*Ulmus americana*	272	150	30	214
American holly	*Ilex opaca*	0	2	8	300
American hornbeam	*Carpinus caroliniana*	19	6	3	1
American sycamore	*Platanus occidentalis*	107	51	17	99
Amur honeysuckle	*Lonicera maackii*	1	0	0	0
Bigtooth aspen	*Populus grandidentata*	0	0	0	14
Bitternut hickory	*Carya cordiformis*	67	14	41	3
Black cherry	*Prunus serotina*	8	8	6	199
Black locust	*Robinia pseudoacacia*	43	41	13	118
Black oak	*Quercus velutina*	2	1	2	76
Black walnut	*Juglans nigra*	91	30	14	4
Black willow	*Salix nigra*	0	0	0	9
Blackgum	*Nyssa sylvatica*	11	1	86	1,085
Blackhaw	*Viburnum prunifolium*	2	0	0	0
Blackjack oak	*Quercus marilandica*	0	0	0	3
Boxelder	*Acer negundo*	410	65	85	6
Callery pear	*Pyrus calleryana*	0	0	0	816
Canadian serviceberry	*Amelanchier canadensis*	0	0	0	1
Cherry sp.	*Prunus* sp.	0	0	1	3
Cherrybark oak	*Quercus pagoda*	0	0	0	1
Chestnut oak	*Quercus montana*	17	0	162	4
Common hackberry	*Celtis occidentalis*	60	10	3	24
Common pear	*Pyrus communis*	0	0	0	1
Common persimmon	*Diospyros virginiana*	2	1	0	104
Crabapple sp.	*Malus* sp.	0	0	0	6
Eastern cottonwood	*Populus deltoides*	0	3	0	2

Eastern redbud	*Cercis canadensis*	16	4	5	1
Eastern redcedar	*Juniperus virginiana*	27	32	0	342
Eastern white pine	*Pinus strobus*	0	4	0	24
Elm sp.	*Ulmus* sp.	0	0	0	1
Flowering dogwood	*Cornus florida*	4	0	3	4
Green ash	*Fraxinus pennsylvanica*	20	5	7	14
Hawthorn sp.	*Crataegus* sp.	0	0	0	7
Hickory sp.	*Carya* sp.	0	0	0	3
Higan cherry	*Pruns subhirtella*	0	0	0	1
Honey locust	*Gleditsia triacanthos*	1	0	0	4
Hophornbeam	*Ostrya virginiana*	0	1	2	0
Littleleaf linden	*Tilia cordata*	3	0	0	1
Loblolly pine	*Pinus taeda*	0	0	0	60
Mockernut hickory	*Carya tomentosa*	28	2	61	52
Northern catalpa	*Catalpa speciosa*	0	0	0	19
Northern red oak	*Quercus rubra*	63	9	95	347
Norway maple	*Acer platanoides*	0	0	9	2
Oak sp.	*Quercus* sp.	0	0	0	1
Pawpaw	*Asimina triloba*	6	0	1	0
Pear sp.	*Pyrus* sp.	0	0	0	3
Pignut hickory	*Carya glabra*	26	0	9	29
Pin oak	*Quercus palustris*	6	5	3	327
Post oak	*Quercus stellata*	0	0	0	6
Princesstree	*Paulownia tomentosa*	0	0	6	2
Red maple	*Acer rubrum*	27	204	405	2,717
Red mulberry	*Morus rubra*	2	0	0	0

River birch	*Betula nigra*	0	0	0	16
Sassafras	*Sassafras albidum*	0	2	3	53
Scarlet oak	*Quercus coccinea*	0	4	6	154
Shortleaf pine	*Pinus taeda*	0	0	0	3
Siberian elm	*Ulmus pumila*	2	0	0	4
Silver maple	*Acer saccharinum*	34	0	9	15
Slippery elm	*Ulmus rubra*	9	0	45	9
Southern red oak	*Quercus falcata*	0	5	3	311
Sugar maple	*Acer saccharum*	31	0	87	6
Sumac sp.	*Rhus* sp.	0	0	0	7
Swamp chestnut oak	*Quercus michauxii*	1	5	23	0
Swamp white oak	*Quercus bicolor*	3	0	0	3
Sweet cherry	*Prunus avium*	1	0	2	10
Sweetbay	*Magnolia virginiana*	0	0	0	4
Sweetgum	*Liquidambar styraciflua*	0	0	0	3,257
Tree of heaven	*Ailanthus altissima*	5	1	28	86
Tuliptree	*Liriodendron tulipifera*	55	73	502	441
Unknown	Unknown	0	0	0	2
Virginia pine	*Pinus virginiana*	0	0	0	3,189
White ash	*Fraxinus americana*	0	0	16	5
White mulberry	*Morus alba*	7	4	1	74
White oak	*Quercus alba*	28	6	74	834
Willow oak	*Quercus phellos*	3	1	0	596

C&O = C&O Canal, CB = Clara Barton Parkway, GWMP = George Washington Memorial Parkway, NACE = National Capital Parks-East (includes BW Parkway, Greenbelt Park, and Suitland Parkway)


Supplemental Draft
Environmental Impact Statement and
Updated Draft Section 4(f) Evaluation

APPENDIX H

ATTACHMENT A: NATIONAL PARK SERVICE TREE INVENTORY MAPS

ATTACHMENT A

Maps

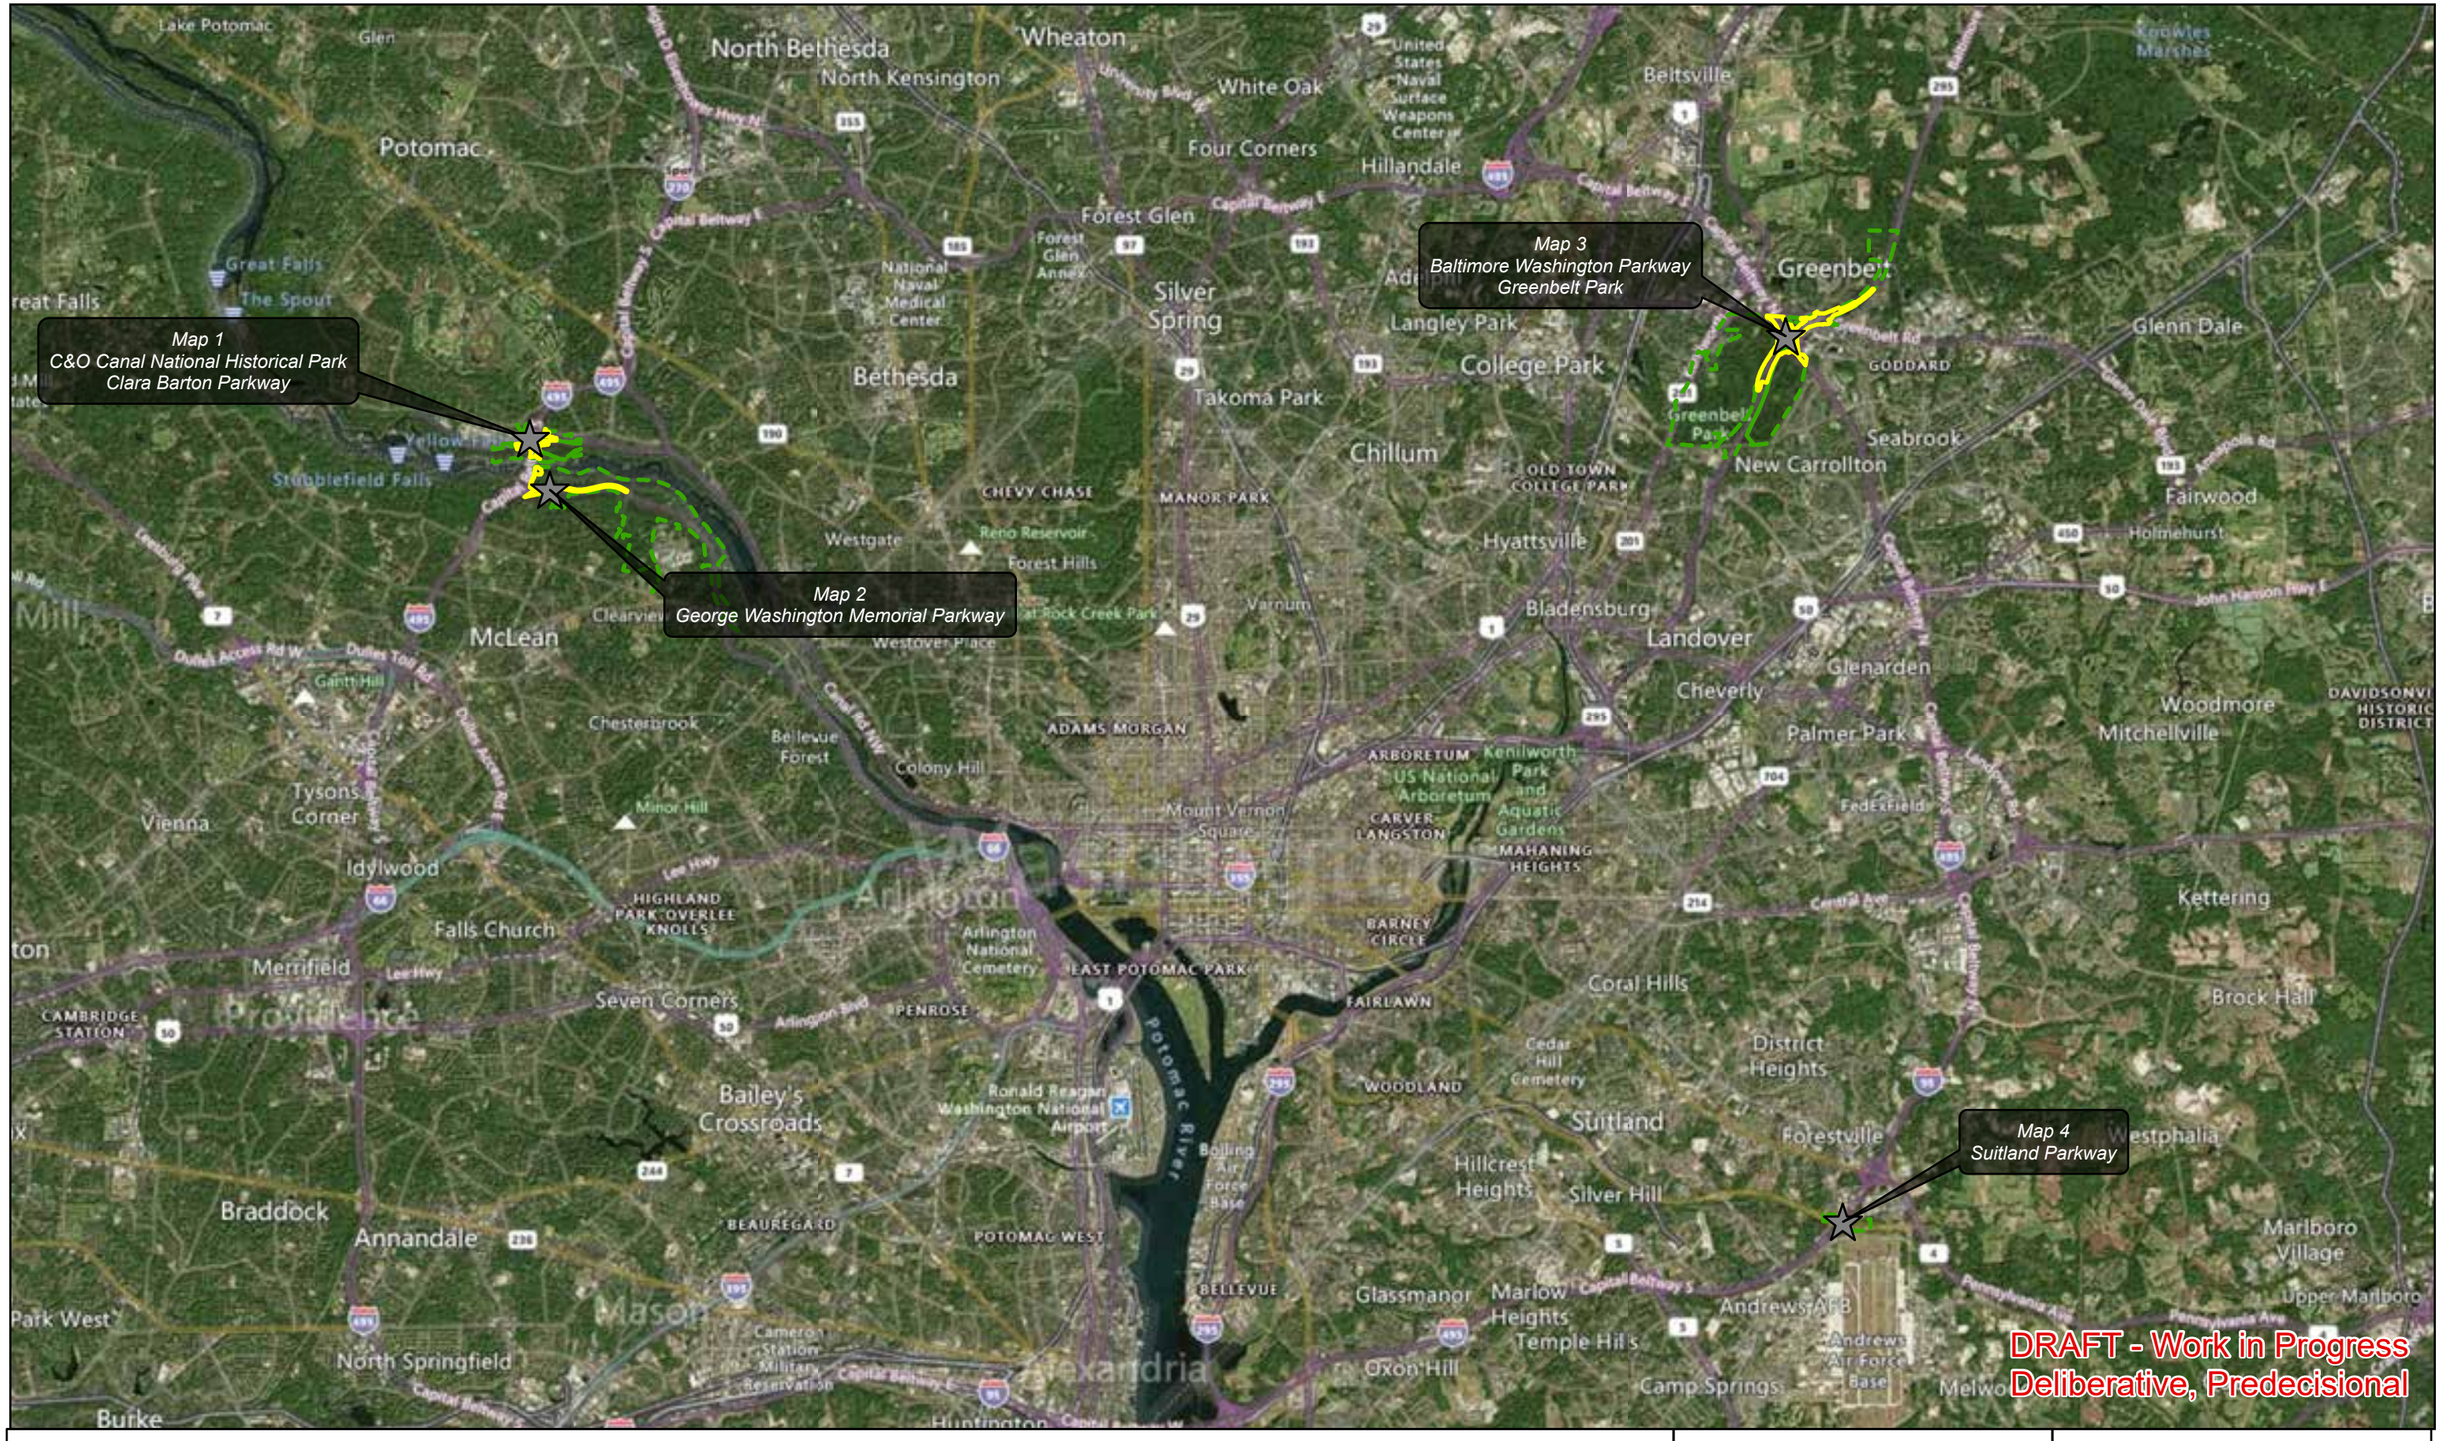

Legend

- NPS Park Boundary
- Tree Survey Area

N W E S

0 0.75 1.5 3

Miles

NPS Tree Survey Limits Overview

I-495 & I-270 Managed Lanes Study

495 270 MANAGED LANES STUDY



Legend

- NPS Park Boundary
- Tree Survey Area
- Baltimore-Washington Parkway
- Chesapeake & Ohio National Historical Park
- Clara Barton Parkway
- George Washington Memorial Parkway
- Greenbelt Park
- Suitland Parkway

N W E S

0 105 210 420

Feet

Map 1 of 4

NPS Tree Survey Limits

C&O Canal National Historical Park
Clara Barton Parkway

I-495 & I-270 Managed Lanes Study

495 270 MANAGED LANES STUDY



Legend

- NPS Park Boundary
- Tree Survey Area
- Baltimore-Washington Parkway
- Chesapeake & Ohio National Historical Park
- Clara Barton Parkway
- George Washington Memorial Parkway
- Greenbelt Park
- Suitland Parkway

N W E S

0 180 360 720

Feet

Map 2 of 4

NPS Tree Survey Limits

George Washington Memorial Parkway

I-495 & I-270 Managed Lanes Study

270 495 MANAGED LANES STUDY

National Capital Parks East - Baltimore-Washington Parkway

National Capital Parks East - Greenbelt Park

National Capital Parks East - Greenbelt Park

DRAFT - Work in Progress
Deliberative, Predecisional

Legend

- NPS Park Boundary
- Tree Survey Area
- Baltimore-Washington Parkway
- Chesapeake & Ohio National Historical Park
- Clara Barton Parkway
- George Washington Memorial Parkway
- Greenbelt Park
- Suitland Parkway

N W E S

0 300 600 1,200

Feet

Map 3 of 4

NPS Tree Survey Limits

National Capital Parks-East
Baltimore-Washington Parkway
Greenbelt Park

I-495 & I-270 Managed Lanes Study

495 270 MANAGED LANES STUDY



Legend

- NPS Park Boundary
- Tree Survey Area
- Baltimore-Washington Parkway
- Chesapeake & Ohio National Historical Park
- Clara Barton Parkway
- George Washington Memorial Parkway
- Greenbelt Park
- Suitland Parkway

N W E S

0 37.5 75 150

Feet

Map 4 of 4

NPS Tree Survey Limits

National Capital Parks-East
Suitland Parkway

I-495 & I-270 Managed Lanes Study

495 270 MANAGED LANES STUDY

Supplemental Draft
Environmental Impact Statement and
Updated Draft Section 4(f) Evaluation

APPENDIX H

ATTACHMENT B: NATIONAL PARK SERVICE TREE INVENTORY MAPS AND TABLES, C&O CANAL HISTORICAL PARK AND CLARA BARTON PARKWAY

ATTACHMENT B

Tree Inventory Maps and Tables

C&O Canal National Historical Park

Clara Barton Parkway



0 80 160 240 320 400 Feet

SCALE: 1" = 400'

NPS Boundary

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


The information shown is for the purpose of determining cost estimates and environmental impacts and is subject to change during the final phase. Any reliance upon these plans is made with full understanding of its draft status. Environmental impacts are based on the proposed limits of disturbance.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 & 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | KEY SHEET

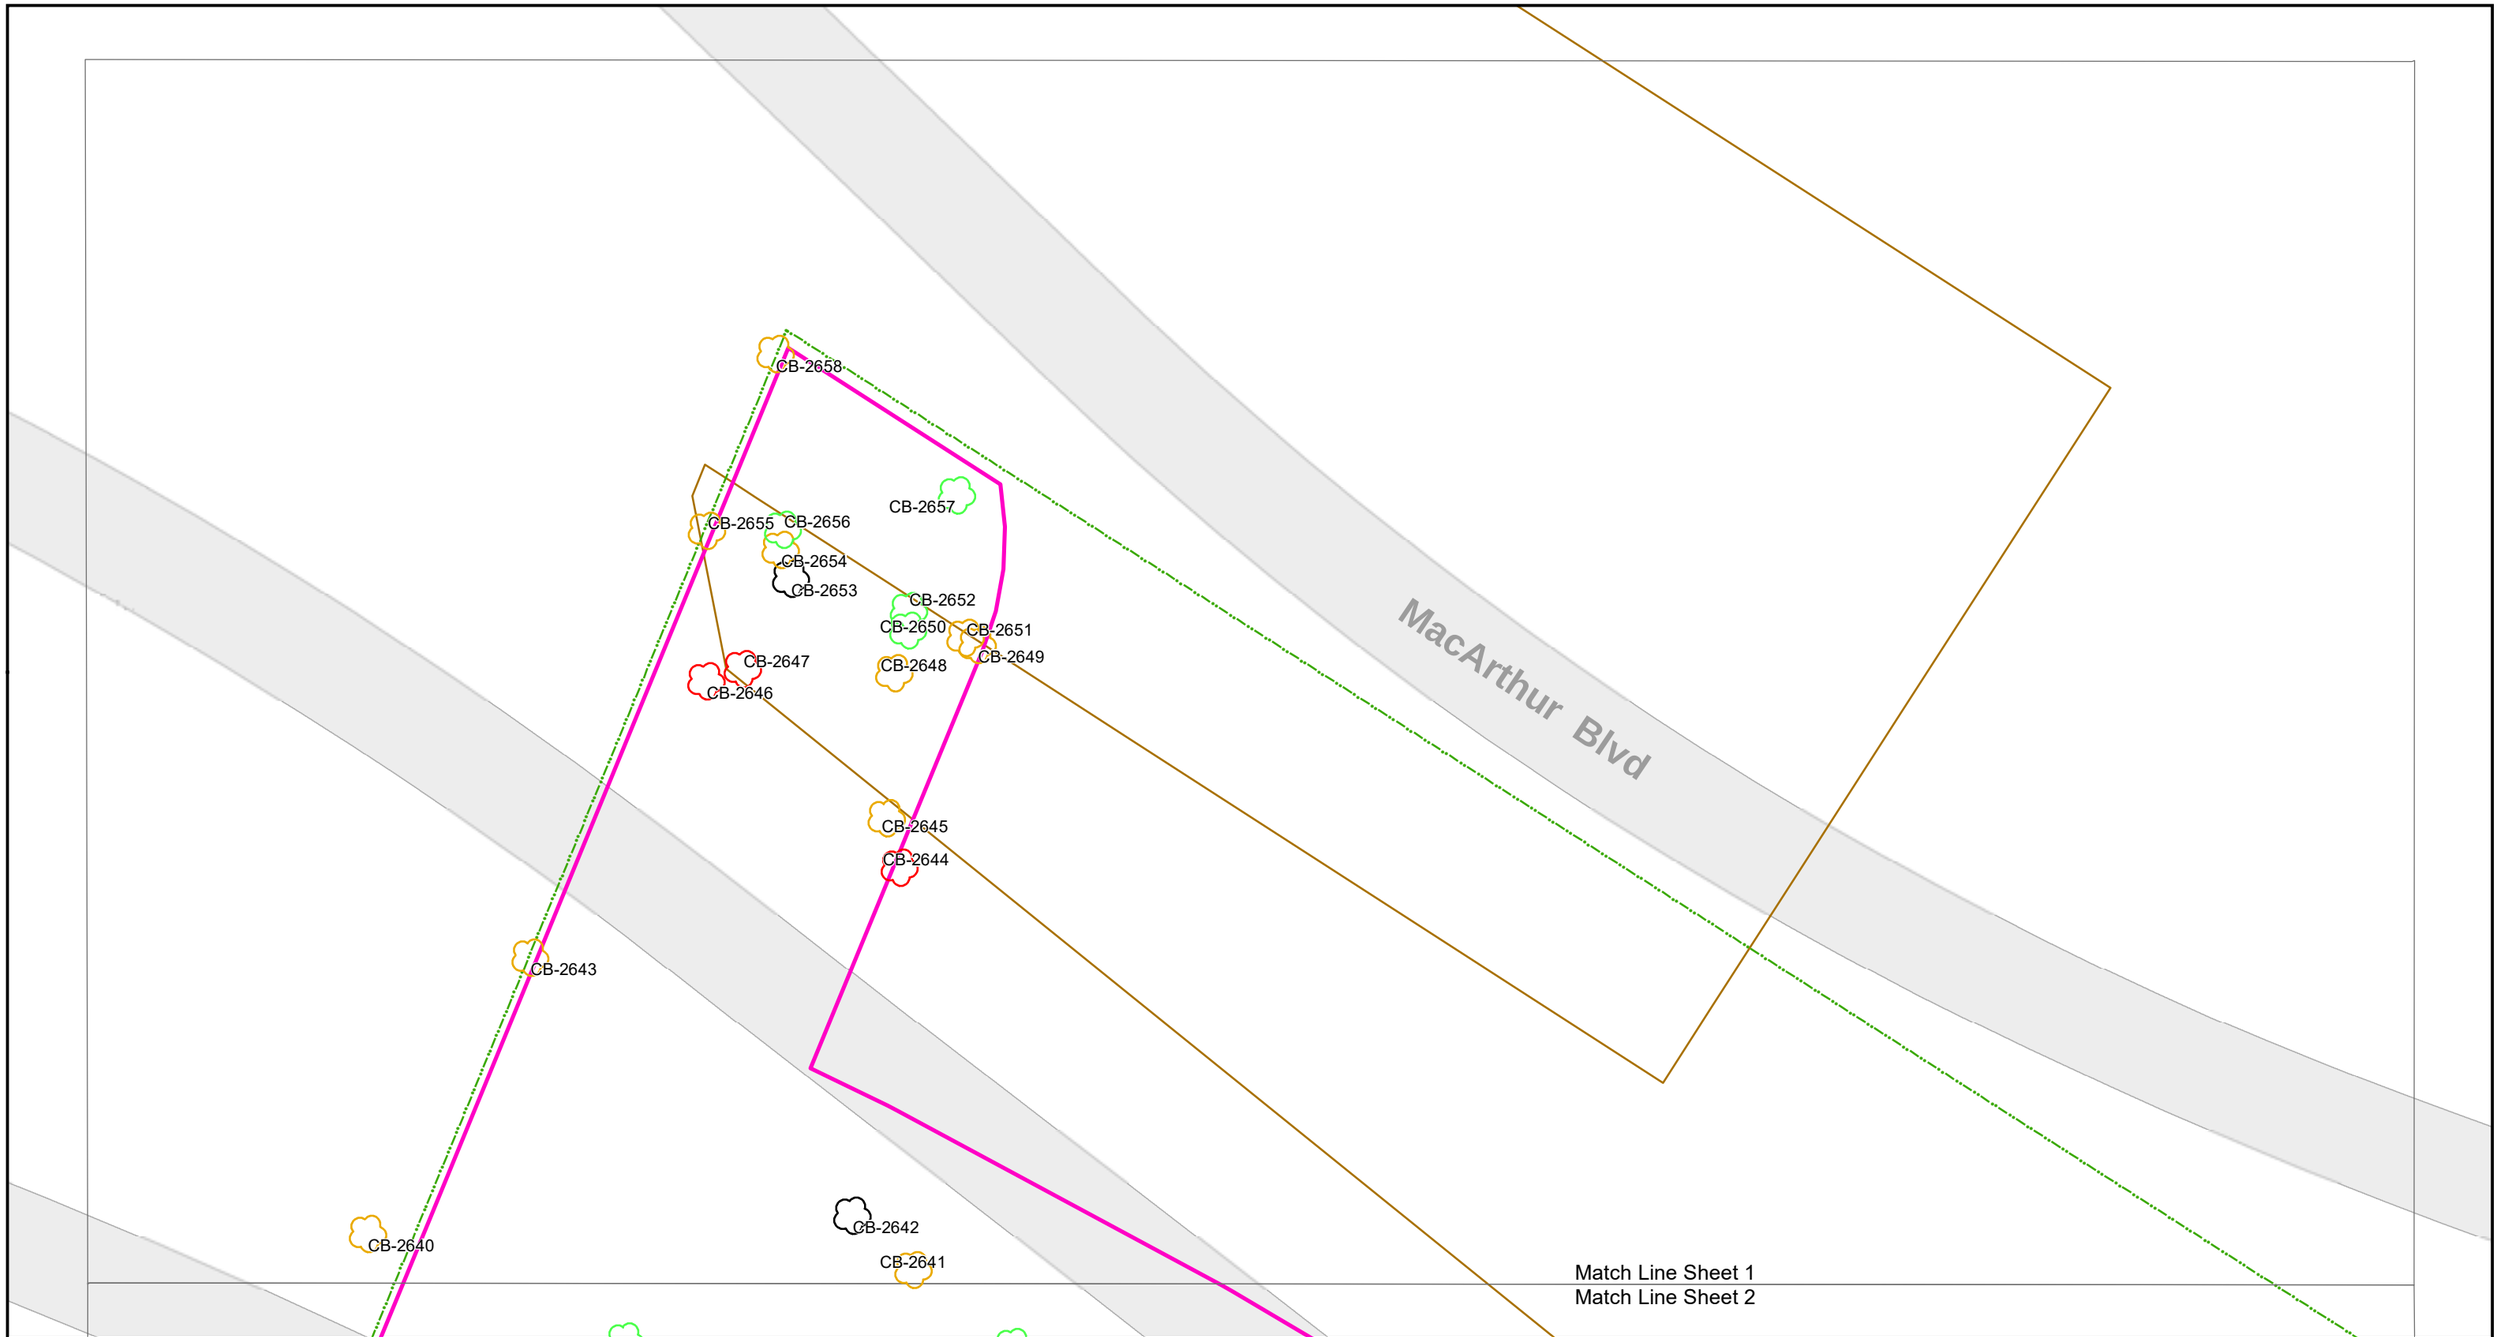

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:


1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 MANAGED LANES STUDY 270

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 1 OF 57

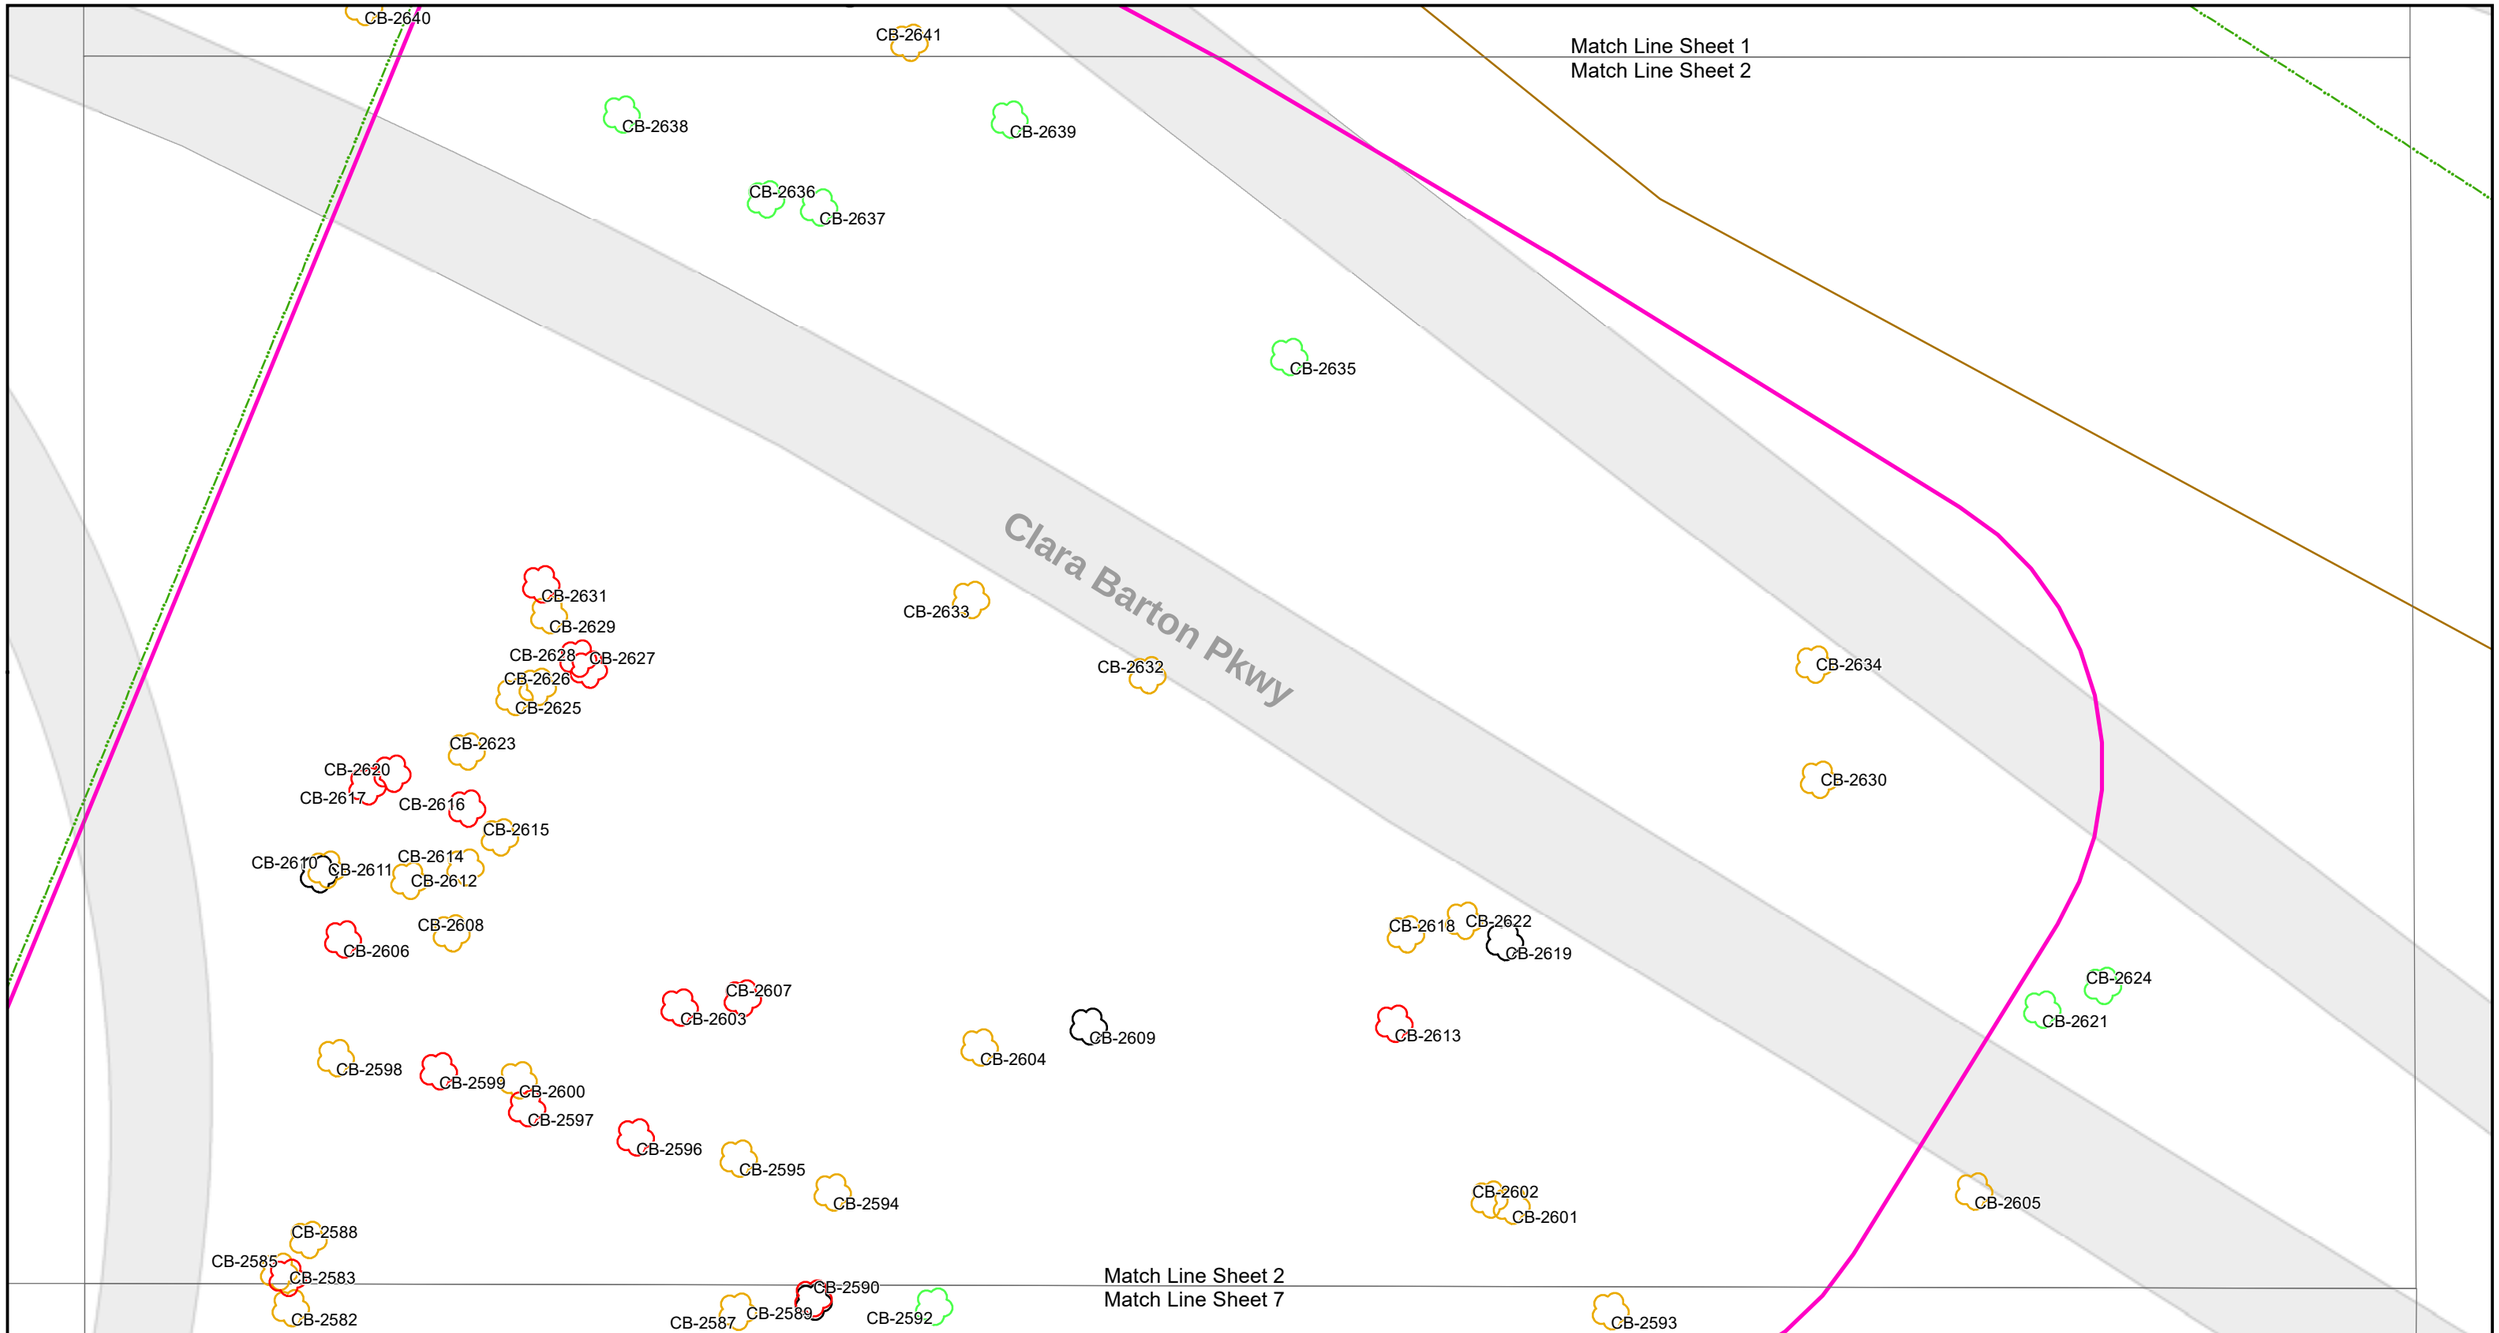

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 MANAGED LANES STUDY 270

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 2 OF 57

Clara Barton Pkwy

Match Line Sheet 3
Match Line Sheet 4

CB-2114
CB-2099
CB-2092
CB-2053
CB-2064
CB-2052
CB-2051
CB-2039
CB-2019
CB-2014
CB-1992
CB-2000
CB-1990
CB-1994
CB-1988
CB-1978
CB-1972
CB-1969
CB-1966
CB-1968
CB-1959
CB-1947
CB-1967
CB-1955

Match Line Sheet 3
Match Line Sheet 8

CB-1927
CB-1933
CB-1934
CB-1944

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 3 OF 57

Match Line Sheet 3
Match Line Sheet 4

Match Line Sheet 4
Match Line Sheet 5

CB-2153
CB-2181
CB-2149
CB-2114
CB-2124
CB-2120
CB-2138
CB-2092
CB-2099
CB-2111
CB-2085
CB-2097
CB-2185
CB-2190
CB-2184
CB-2355
CB-2330
CB-2326
CB-2308
CB-2275
CB-2239
CB-2237
CB-2216
CB-2193
CB-2130

Match Line Sheet 4
Match Line Sheet 9

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 MANAGED LANES STUDY 270

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 4 OF 57

Match Line Sheet 4
Match Line Sheet 5

Capital Beltway Outer Loop

Capital Beltway Inner Loop

I-495

I-495

Match Line Sheet 5
Match Line Sheet 6

CB-2491
CB-2478
CB-2472
CB-2450
CB-2448
CB-2447
CB-2441
CB-2435
CB-2427
CB-2431
CB-2423
CB-2416
CB-2407
CB-2399
CB-2383
CB-2363
CB-2366
CB-2349
CB-2347
CB-2336
CB-2346
CB-2312
CB-2333
CB-2291
CB-2297
CB-2284
CB-2267
CB-2270
CB-2287
CB-2355
CB-2330
CB-2326
CB-2308
CB-2239
CB-2237
CB-2193
CB-2130

Match Line Sheet 5
Match Line Sheet 10

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 MANAGED LANES STUDY 270

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 5 OF 57

Match Line Sheet 5
Match Line Sheet 6

Match Line Sheet 6
Match Line Sheet 7

Match Line Sheet 6
Match Line Sheet 11

CB-2569
CB-2562
CB-2559
CB-2558
CB-2557
CB-2556
CB-2554
CB-2553
CB-2551
CB-2546
CB-2545
CB-2535
CB-2537
CB-2530
CB-2534
CB-2532
CB-2533
CB-2529
CB-2526
CB-2528
CB-2531
CB-2525
CB-2524
CB-2521
CB-2511
CB-2513
CB-2515
CB-2491
CB-2478
CB-2472
CB-2506
CB-2508
CB-2489
CB-2502
CB-2485
CB-2487
CB-2498
CB-2497
CB-2457
CB-2451
CB-2441
CB-2435
CB-2439
CB-2438
CB-2430
CB-2426
CB-2444
CB-2504
CB-2493
CB-2500
CB-2494
CB-2505
CB-2470
CB-2473
CB-2452
CB-2454
CB-2462
CB-2403
CB-2381
CB-2388
CB-2391
CB-2377
CB-2367
CB-2412
CB-2346
CB-2343
CB-2333
CB-2352
CB-2297
CB-2287
CB-2284
CB-2329
CB-2338
CB-2342
CB-2421

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 6 OF 57

Match Line Sheet 2
Match Line Sheet 7

Match Line Sheet 6
Match Line Sheet 7

Match Line Sheet 7
Match Line Sheet 12

CB-2588 CB-2585 CB-2583 CB-2582 CB-2587 CB-2590 CB-2589 CB-2592 CB-2586 CB-2593 CB-2591 CB-2581 CB-2584 CB-2578 CB-2576 CB-2577 CB-2574 CB-2575 CB-2571 CB-2580 CB-2579 CB-2570 CB-2567 CB-2568 CB-2572 CB-2573 CB-2566 CB-2564 CB-2565 CB-2562 CB-2559 CB-2558 CB-2561 CB-2557 CB-2560 CB-2556 CB-2563 CB-2555 CB-2554 CB-2553 CB-2551 CB-2550 CB-2552 CB-2549 CB-2546 CB-2545 CB-2540 CB-2547 CB-2548 CB-2544 CB-2536 CB-2538 CB-2494 CB-2505 CB-2523 CB-2514 CB-2518 CB-2527 CB-2512 CB-2522 CB-2541 CB-2539 CB-2543 CB-2542 CB-2462 CB-2473 CB-2482 CB-2488 CB-2483 CB-2495 CB-2463 CB-2465 CB-2474 CB-2481 CB-2503 CB-2459 CB-2455 CB-2458 CB-2479 CB-2453 CB-2477 CB-2492 CB-2519 CB-2520 CB-2499 CB-2509 CB-2476 CB-2486 CB-2501 CB-2517 CB-2510 CB-2516 CB-2467 CB-2475 CB-2464 CB-2507 CB-2496 CB-2490 CB-2468 CB-2421

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 MANAGED LANES STUDY 270

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 7 OF 57

Match Line Sheet 3
Match Line Sheet 8

CB-1947
CB-1967
CB-1944
CB-1927
CB-1933
CB-1934
CB-1955
CB-1953
CB-1946
CB-1928
CB-1925
CB-1926
CB-1930
CB-1938
CB-1919
CB-1929
CB-1941
CB-1922
CB-1923
CB-1890
CB-1909
CB-1903
CB-1917
CB-1921
CB-1886
CB-1864
CB-1868
CB-1859
CB-1863
CB-1878
CB-1879
CB-1867
CB-1870
CB-1858
CB-1843
CB-1857
CB-1871
CB-1835
CB-1901
CB-1905
CB-1897
CB-1912
CB-1891
CB-1856
CB-1881
CB-1838
CB-1853
CB-1860
CB-1825
CB-1833
CB-1834
CB-1791

Match Line Sheet 8
Match Line Sheet 9

Clara Barton Pkwy

Match Line Sheet 8
Match Line Sheet 16

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 8 OF 57

Match Line Sheet 4
Match Line Sheet 9

Match Line Sheet 8
Match Line Sheet 9

CB-1912
CB-1900
CB-1908
CB-1911
CB-1920
CB-1893
CB-1902
CB-1914
CB-1882
CB-1894
CB-1906
CB-1889
CB-1892
CB-1899
CB-1833
CB-1834
CB-1862
CB-1865
CB-1876
CB-1895
CB-1847
CB-1877
CB-1888
CB-1887
CB-1816
CB-1852
CB-1874
CB-1836
CB-1851
CB-1873
CB-1848
CB-1854
CB-1804
CB-1815
CB-1818
CB-1828
CB-1822
CB-1845
CB-1866
CB-1884
CB-1869
CB-1910
CB-1904
CB-1898
CB-1872
CB-1880
CB-1801
CB-1807
CB-1811
CB-1795
CB-1813
CB-1806
CB-1796
CB-1821
CB-1849
CB-1826
CB-1841
CB-1820
CB-1832
CB-1837
CB-1819
CB-1844
CB-1823
CB-1830
CB-1827
CB-1808
CB-1797
CB-1814
CB-1798
CB-1817
CB-1788
CB-1787
CB-1790
CB-1810
CB-1812
CB-1805
CB-1783
CB-1799
CB-1785
CB-1792
CB-1809
CB-1782
CB-1780
CB-2130
CB-2088
CB-2045
CB-2027
CB-2037
CB-2020
CB-2013
CB-2010
CB-1956
CB-1965
CB-1964
CB-1962
CB-1950
CB-1945
CB-1942
CB-1932
CB-1913
CB-1915
CB-1885
CB-1883
CB-1846
CB-1824
CB-1840
CB-1850
CB-1803
CB-1800

Clara Barton Pkwy

Match Line Sheet 9
Match Line Sheet 10

Match Line Sheet 9
Match Line Sheet 17

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 9 OF 57

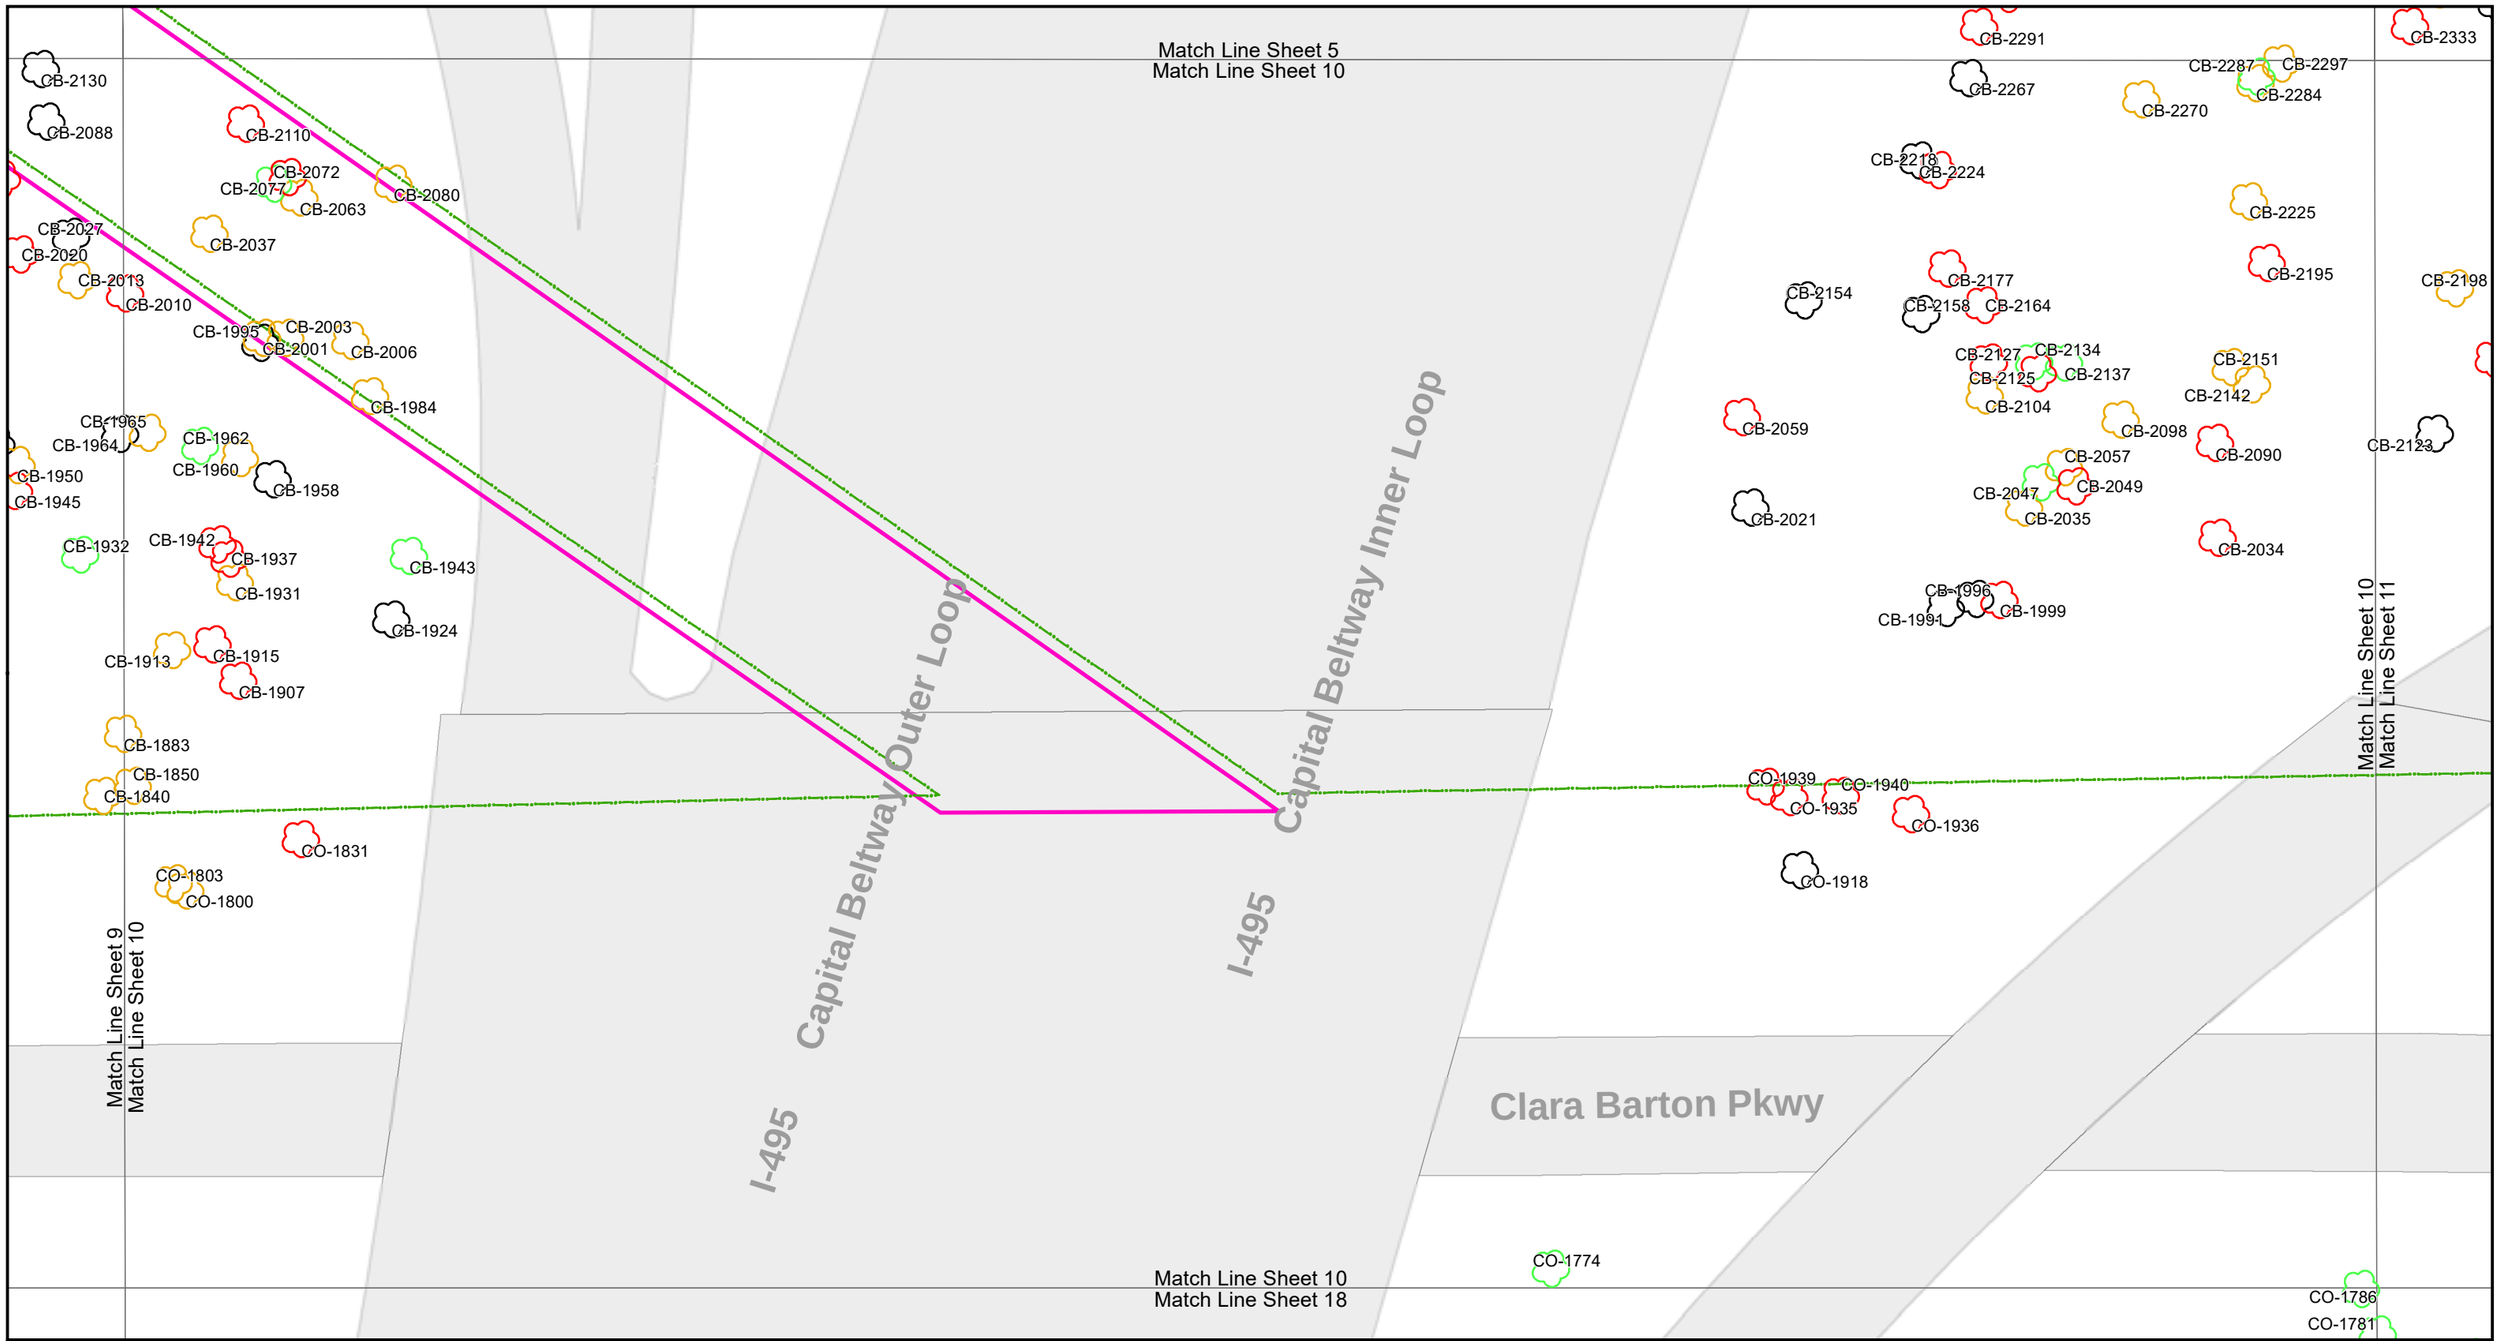

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 10 OF 57

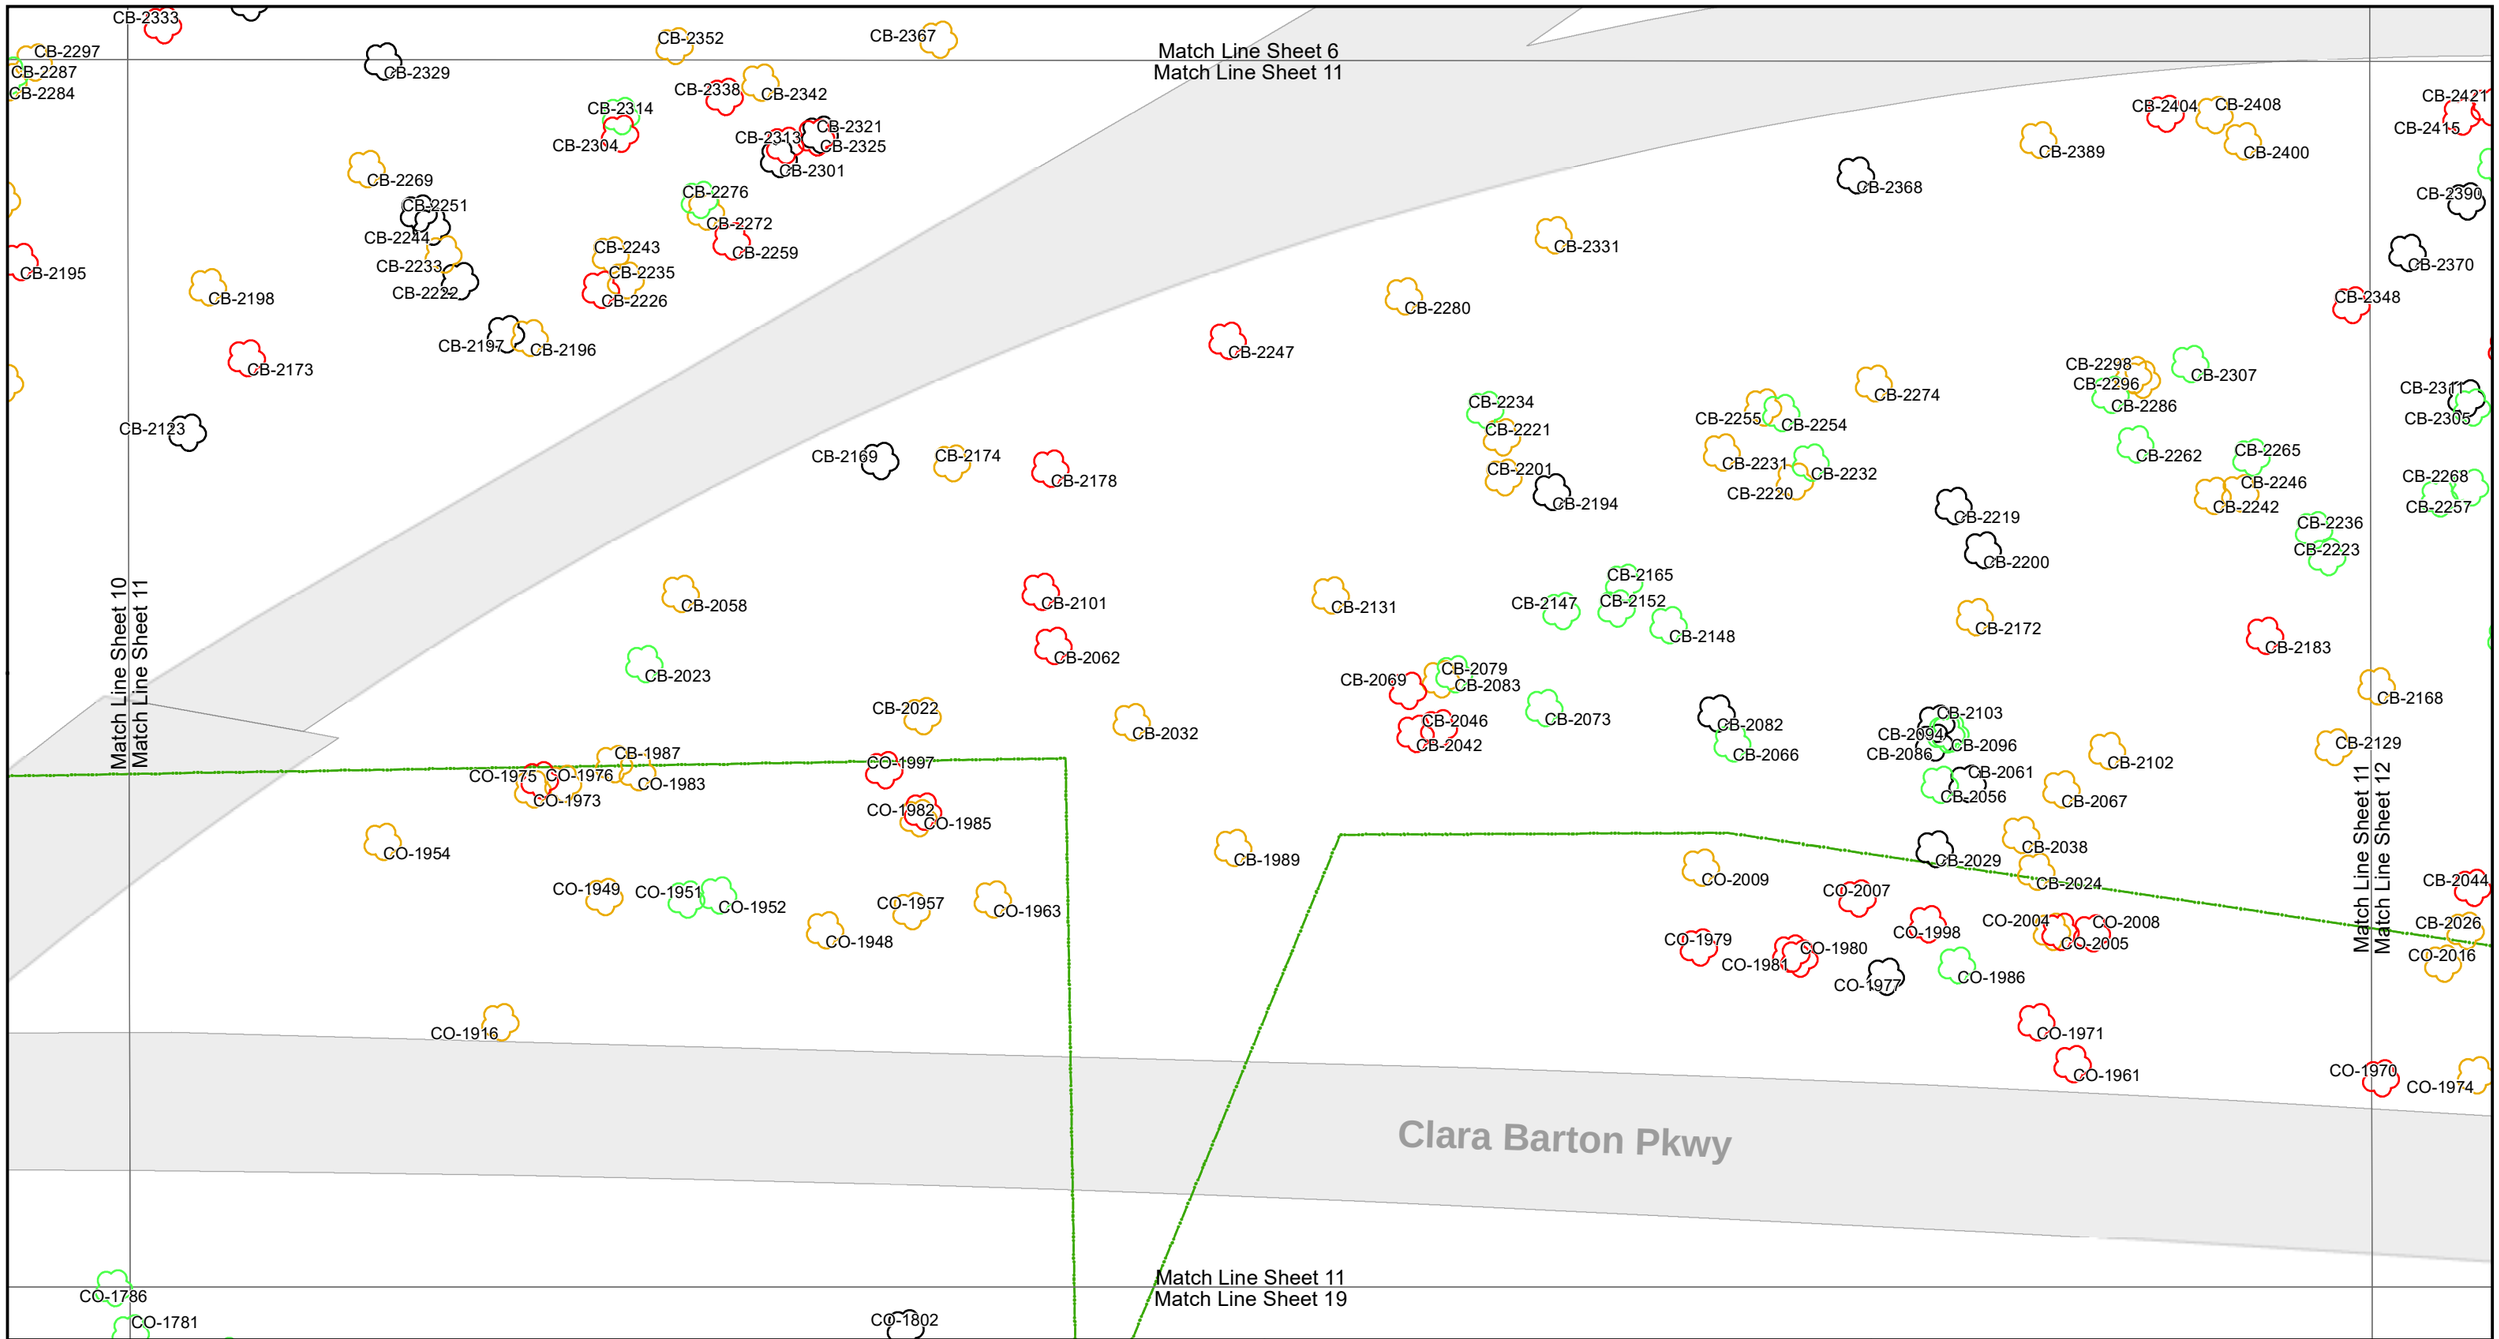

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 11 OF 57

Match Line Sheet 7
Match Line Sheet 12

Match Line Sheet 11
Match Line Sheet 12

Match Line Sheet 12
Match Line Sheet 13

Clara Barton Pkwy

Match Line Sheet 12
Match Line Sheet 20

CB-2507
CB-2496
CB-2490
CB-2468
CB-2460
CB-2449
CB-2445
CB-2446
CB-2443
CB-2442
CB-2482
CB-2471
CB-2415
CB-2421
CB-2413
CB-2424
CB-2411
CB-2410
CB-2402
CB-2390
CB-2397
CB-2405
CB-2420
CB-2417
CB-2425
CB-2419
CB-2401
CB-2370
CB-2348
CB-2418
CB-2440
CB-2434
CB-2432
CB-2340
CB-2372
CB-2385
CB-2364
CB-2311
CB-2305
CB-2350
CB-2344
CB-2324
CB-2378
CB-2392
CB-2396
CB-2387
CB-2375
CB-2373
CB-2393
CB-2386
CB-2379
CB-2374
CB-2300
CB-2268
CB-2278
CB-2283
CB-2257
CB-2260
CB-2277
CB-2256
CB-2258
CB-2250
CB-2380
CB-2382
CB-2361
CB-2359
CB-2365
CB-2376
CB-2236
CB-2223
CB-2319
CB-2306
CB-2289
CB-2332
CB-2334
CB-2210
CB-2205
CB-2192
CB-2285
CB-2281
CB-2320
CB-2328
CB-2295
CB-2310
CB-2339
CB-2168
CB-2179
CB-2288
CB-2290
CB-2229
CB-2191
CB-2227
CB-2212
CB-2273
CB-2327
CB-2129
CB-2161
CB-2143
CB-2166
CB-2162
CB-2203
CB-2208
CB-2245
CB-2266
CB-2279
CB-2248
CB-2263
CB-2264
CB-2261
CB-2074
CB-2087
CB-2075
CB-2118
CB-2133
CB-2187
CB-2189
CB-2240
CB-2206
CB-2044
CB-2160
CB-2167
CB-2186
CB-2214
CB-2230
CB-2211
CB-2207
CB-2026
CO-2016
CB-2081
CB-2041
CB-2105
CB-2093
CB-2091
CB-2170
CB-2175
CB-2180
CB-2150
CB-2141
CO-2017
CO-2015
CO-2011
CB-2139
CB-2135
CB-2155
CO-1970
CO-1974
CB-2050
CB-2132
CB-2119
CB-2126
CO-2012
CO-2002
CO-1993
CO-2018
CB-2030
CB-2025
CB-2055
CB-2043
CB-2121
CB-2107
CB-2033
CB-2071
CB-2100
CB-2028
CB-2036
CB-2106

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 12 OF 57

Clara Barton Pkwy

CB-2482
CB-2471
CB-2480
CB-2469
CB-2461
CB-2440
CB-2466
CB-2456
CB-2436
CB-2437
CB-2433
CB-2428
CB-2429
CB-2414
CB-2422
CB-2409
CB-2398
CB-2395
CB-2406
CB-2394
CB-2327
CB-2318
CB-2323
CB-2293
CB-2317
CB-2282
CB-2264
CB-2261
CB-2292
CB-2369
CB-2358
CB-2362
CB-2384
CB-2371
CB-2351
CB-2356
CB-2357
CB-2354
CB-2360
CB-2345
CB-2353
CB-2207
CB-2230
CB-2211
CB-2215
CB-2209
CB-2335
CB-2341
CB-2315
CB-2316
CB-2337
CB-2309
CB-2303
CB-2322
CB-2299
CB-2302
CB-2253
CB-2252
CB-2238
CB-2249
CB-2241
CB-2217
CB-2228
CB-2213
CB-2294
CB-2271
CB-2155
CB-2121
CB-2159
CB-2119
CB-2126
CB-2140
CB-2144
CB-2115
CB-2107
CB-2100
CB-2108
CB-2117
CB-2112
CB-2128
CB-2157
CB-2146
CB-2084
CB-2054
CB-2070
CB-2065
CB-2199
CB-2202
CB-2188
CB-2204
CB-2171
CB-2113
CB-2116
CB-2136
CB-2156
CB-2163
CB-2182
CB-2060
CB-2078
CB-2122
CB-2176

Match Line Sheet 12
Match Line Sheet 13

Match Line Sheet 13
Match Line Sheet 21

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 13 OF 57

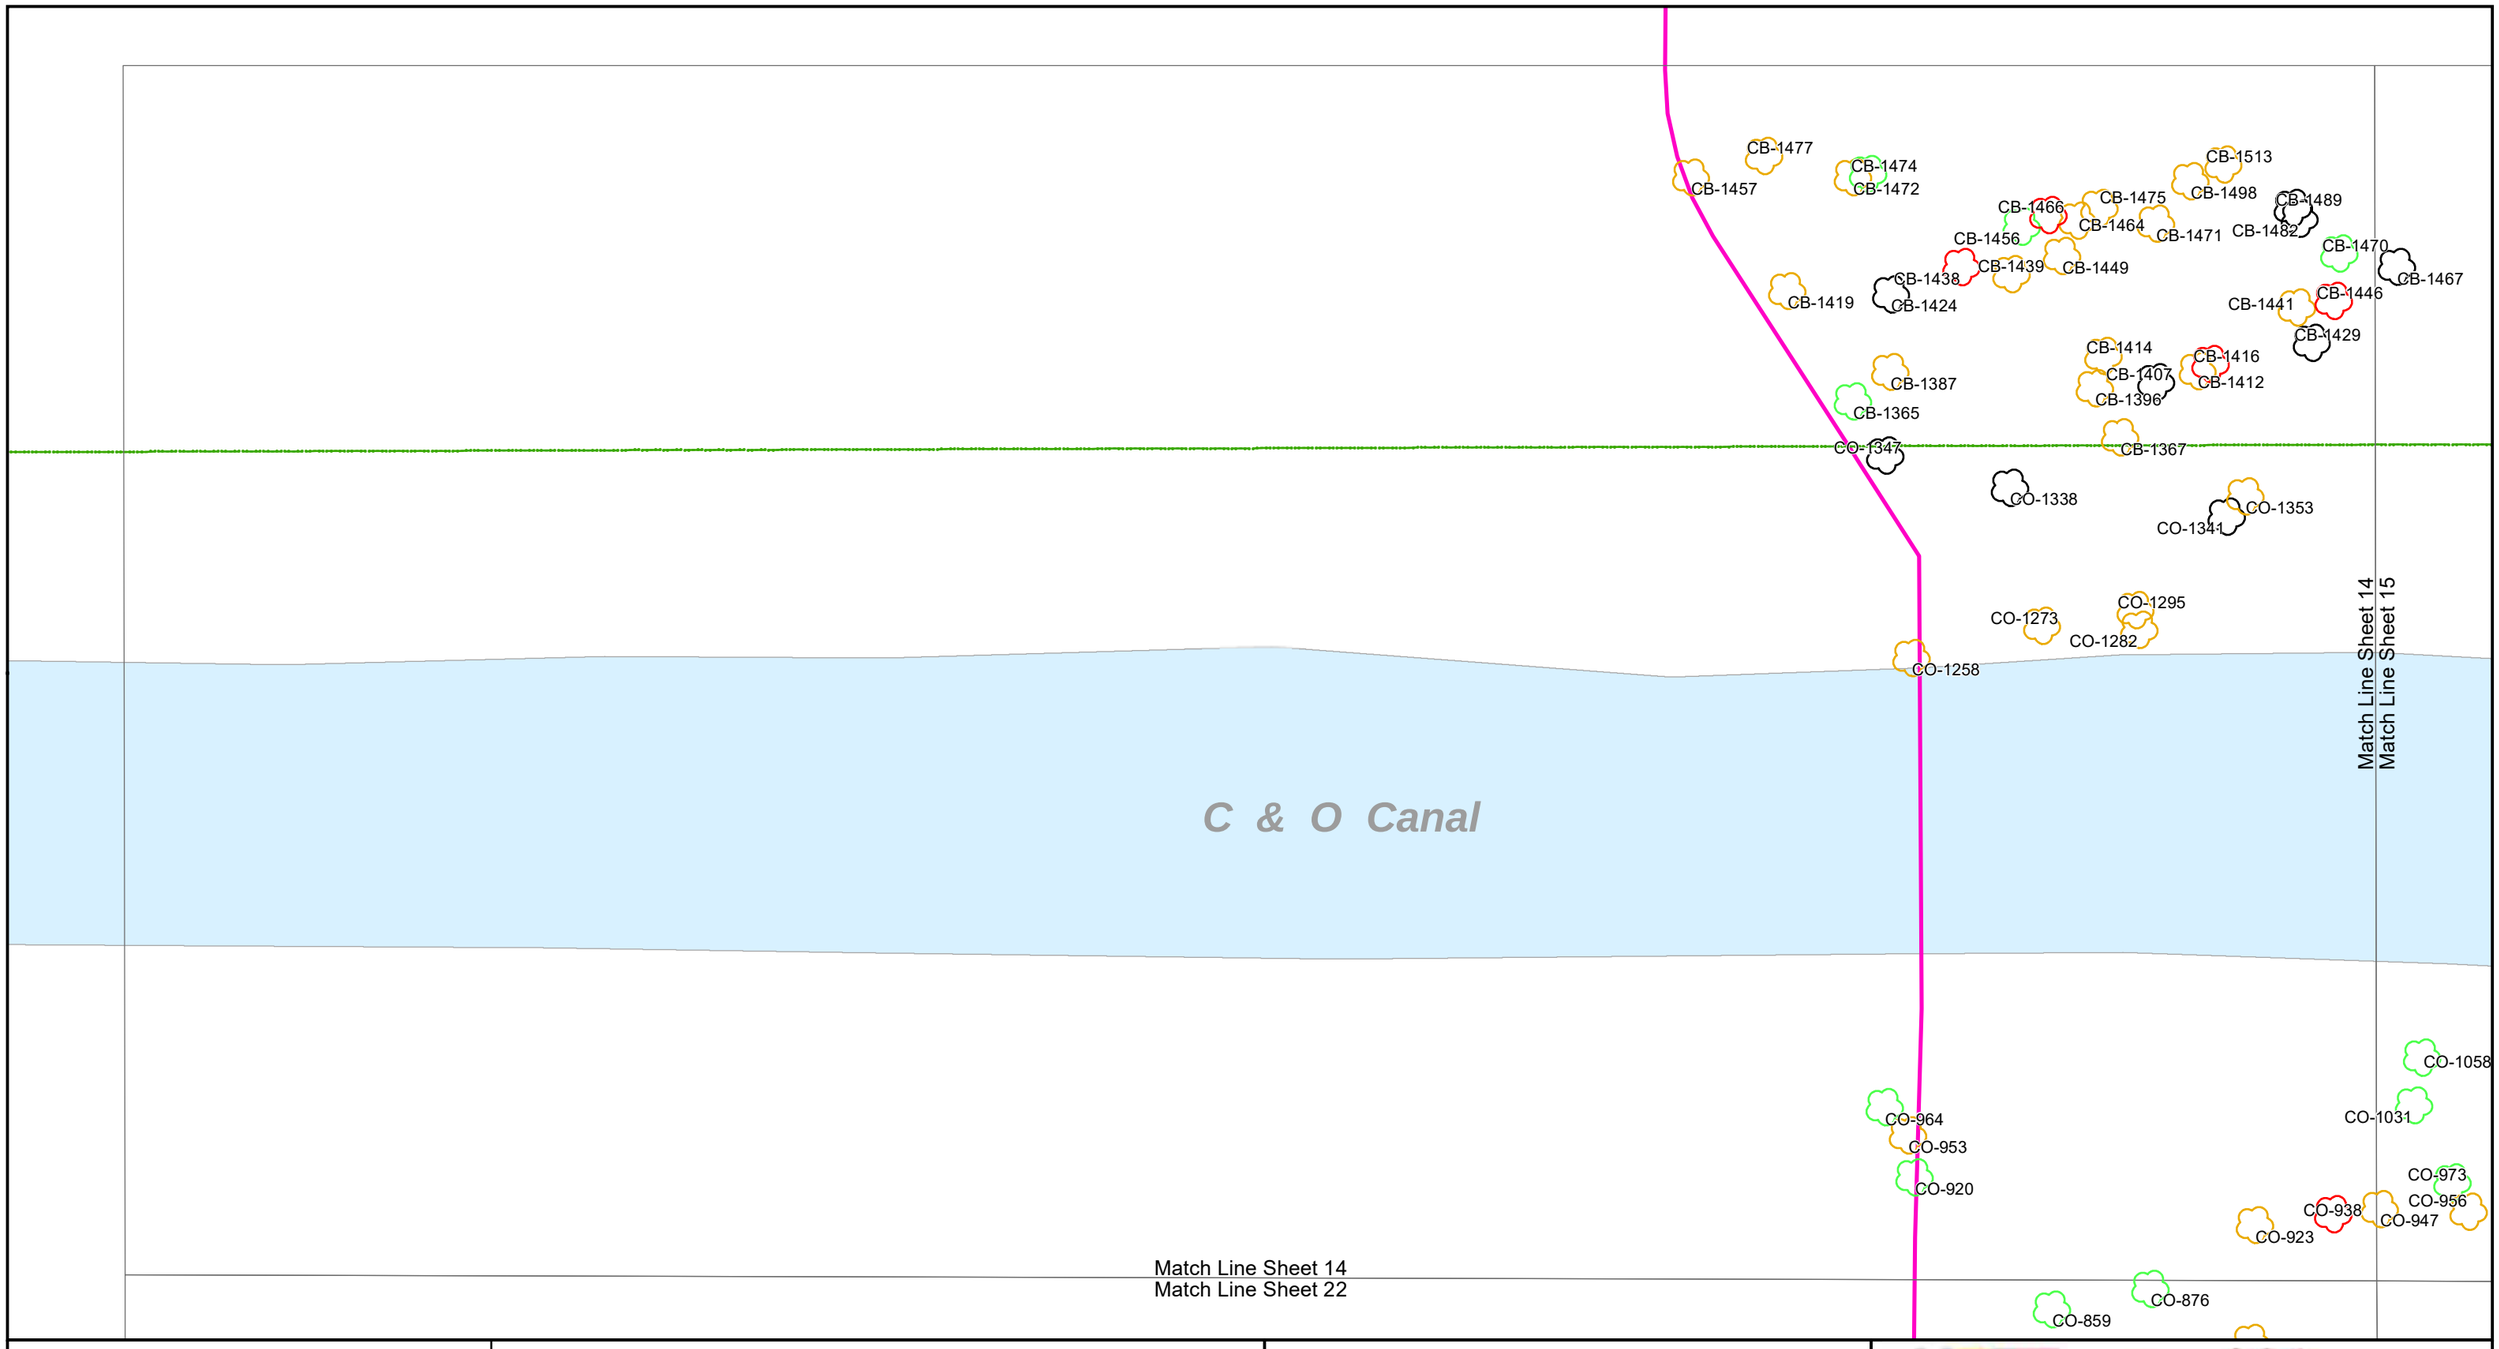

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 14 OF 57

CB-1489
CB-1482
CB-1470
CB-1446
CB-1441
CB-1429
CB-1467
CB-1521
CB-1501
CB-1538
CB-1540
CB-1528
CB-1527
CB-1514
CB-1520
CB-1554
CB-1509
CB-1488
CB-1461
CB-1436
CB-1427
CB-1431
CB-1417
CB-1421
CB-1418
CO-1404
CB-1444
CB-1443
CB-1440
CB-1448
CO-1394
CO-1363
CO-1371
CO-1368
CO-1362
CO-1359
CO-1335
Match Line Sheet 14
Match Line Sheet 15
Match Line Sheet 15
Match Line Sheet 16

C & O Canal

CO-1058
CO-1031
CO-1088
CO-1073
CO-1097
CO-1098
CO-1150
CO-1154
CO-1147
CO-1173
CO-1170
CO-1169
CO-1165
CO-1187
CO-1122
CO-1062
CO-1061
CO-1064
CO-1076
CO-1167
CO-1174
CO-1221
CO-1241
CO-1243
CO-1225
CO-1004
CO-947
CO-973
CO-923
CO-938
CO-956
CO-1019
CO-994
CO-999
CO-986
CO-987
CO-1069
CO-1081
CO-1042
CO-1038
CO-1020
CO-1060
CO-1094
CO-1046
CO-1041
CO-1089
CO-1126
CO-1108
CO-1143
CO-1155
CO-1138
CO-1107
CO-910
CO-932
CO-930
Match Line Sheet 15
Match Line Sheet 23

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 15 OF 57

Match Line Sheet 8
Match Line Sheet 16

Match Line Sheet 15
Match Line Sheet 16

Match Line Sheet 16
Match Line Sheet 17

C & O Canal

CO-1261
CO-1263
CO-1281
CO-1225
CO-1250
CO-1251
CO-1242
CO-1202
CO-1212
CO-1155
CO-1195
CO-1208
CO-1138
CO-1179
CO-1107
CO-1141
CO-1181
CO-1293
CO-1288
CO-1285
CO-1337
CO-1314
CO-1325
CO-1334
CO-1333
CO-1287
Match Line Sheet 16
Match Line Sheet 24
CO-1237
CO-1213
CO-1217
CO-1231
CO-1228
CO-1259
CO-1249
CO-1391
CO-1402
CO-1379
CO-1390
CO-1403
CO-1352
CO-1331
CO-1349
CO-1355
CO-1317
CO-1328
CO-1327
CO-1309
CO-1326
CO-1289
CO-1307
CO-1277
CO-1254
CO-1264

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021

Match Line Sheet 9
Match Line Sheet 17

Match Line Sheet 16
Match Line Sheet 17

Match Line Sheet 17
Match Line Sheet 18

Match Line Sheet 17
Match Line Sheet 25

C & O Canal

CO-1727
CO-1723
CO-1725
CO-1726
CO-1724
CO-1718
CO-1716
CO-1717
CO-1705
CO-1713
CO-1707
CO-1694
CO-1703
CO-1708
CO-1693
CO-1686
CO-1685
CO-1691
CO-1697
CO-1702
CO-1688
CO-1692
CO-1696
CO-1700
CO-1674
CO-1681
CO-1687
CO-1699
CO-1678
CO-1683
CO-1689
CO-1682
CO-1679
CO-1667
CO-1669
CO-1672
CO-1675
CO-1661
CO-1530
CO-1403
CO-1422
CO-1413
CO-1423
CO-1405
CO-1420
CO-1355
CO-1356
CO-1384
CO-1373
CO-1388
CO-1395
CO-1409
CO-1376
CO-1344
CO-1398
CO-1307
CO-1310
CO-1342
CO-1350
CO-1369
CO-1370
CO-1399
CO-1374
CO-1415
CO-1455
CO-1454
CO-1447
CO-1442
CO-1508
CO-1516
CO-1515
CO-1486
CO-1492
CO-1495
CO-1481
CO-1484
CO-1491
CO-1458
CO-1468
CO-1453
CO-1434
CO-1428
CO-1432
CO-1430

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021

Match Line Sheet 10
Match Line Sheet 18

Match Line Sheet 17
Match Line Sheet 18

Match Line Sheet 18
Match Line Sheet 19

Match Line Sheet 18
Match Line Sheet 26

I - 495 Capitol Beltway Outer Loop

I - 495 Capitol Beltway Inner Loop

C & O Canal

CO-1774
CO-1786
CO-1781
CO-1779
CO-1766
CO-1759
CO-1762
CO-1770
CO-1754
CO-1760
CO-1764
CO-1767
CO-1758
CO-1763
CO-1751
CO-1755
CO-1750
CO-1756
CO-1749
CO-1742
CO-1743
CO-1746
CO-1728
CO-1717
CO-1713
CO-1708
CO-1700
CO-1699
CO-1675
CO-1734
CO-1738
CO-1740
CO-1739
CO-1741
CO-1737
CO-1736
CO-1731
CO-1733
CO-1730
CO-1729
CO-1732
CO-1719
CO-1721
CO-1722
CO-1715
CO-1720
CO-1714
CO-1711
CO-1709
CO-1710
CO-1704
CO-1706
CO-1626
CO-1615
CO-1603
CO-1617
CO-1593
CO-1613
CO-1577
CO-1597
CO-1585
CO-1599
CO-1565
CO-1596
CO-1573
CO-1555
CO-1586
CO-1568
CO-1571
CO-1574
CO-1547
CO-1569
CO-1576
CO-1531
CO-1541
CO-1542

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021

Match Line Sheet 11
Match Line Sheet 19

CO-1786
CO-1781
CO-1779
CO-1802
CO-1777
CO-1778
CO-1772
CO-1773
CO-1764
CO-1758
CO-1763
CO-1767
CO-1755
CO-1756
CO-1765
CO-1768
CO-1753
CO-1769
CO-1793
CO-1842
CO-1839
CO-1861
CO-1875
CO-1748
CO-1739
CO-1741
CO-1737
CO-1732

Match Line Sheet 18
Match Line Sheet 19

Match Line Sheet 19
Match Line Sheet 20

CO-1712

C & O Canal

CO-1655
CO-1652
CO-1651
CO-1658
CO-1626
CO-1664
CO-1613
CO-1619
CO-1620
CO-1635
CO-1650
CO-1645
CO-1633
CO-1642
CO-1643
CO-1641
CO-1634
CO-1684
CO-1670
CO-1671
CO-1659
CO-1649
CO-1600
CO-1586
CO-1588
CO-1576
CO-1610

Match Line Sheet 19
Match Line Sheet 27

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 19 OF 57

Match Line Sheet 12
Match Line Sheet 20

Clara Barton Pkwy

CO-1896
CO-1875
CO-1855
CO-1829
CO-1794
CO-1789
CO-1775
CO-1784
CO-1757
CO-1771
CO-1776
CO-1761
CO-1752
CO-1745
CO-1747
CO-1744
CO-1735

Match Line Sheet 19
Match Line Sheet 20

Match Line Sheet 20
Match Line Sheet 21

C & O Canal

CO-1684
CO-1701
CO-1676
CO-1698
CO-1680
CO-1677
CO-1660

Match Line Sheet 20
Match Line Sheet 28

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 20 OF 57

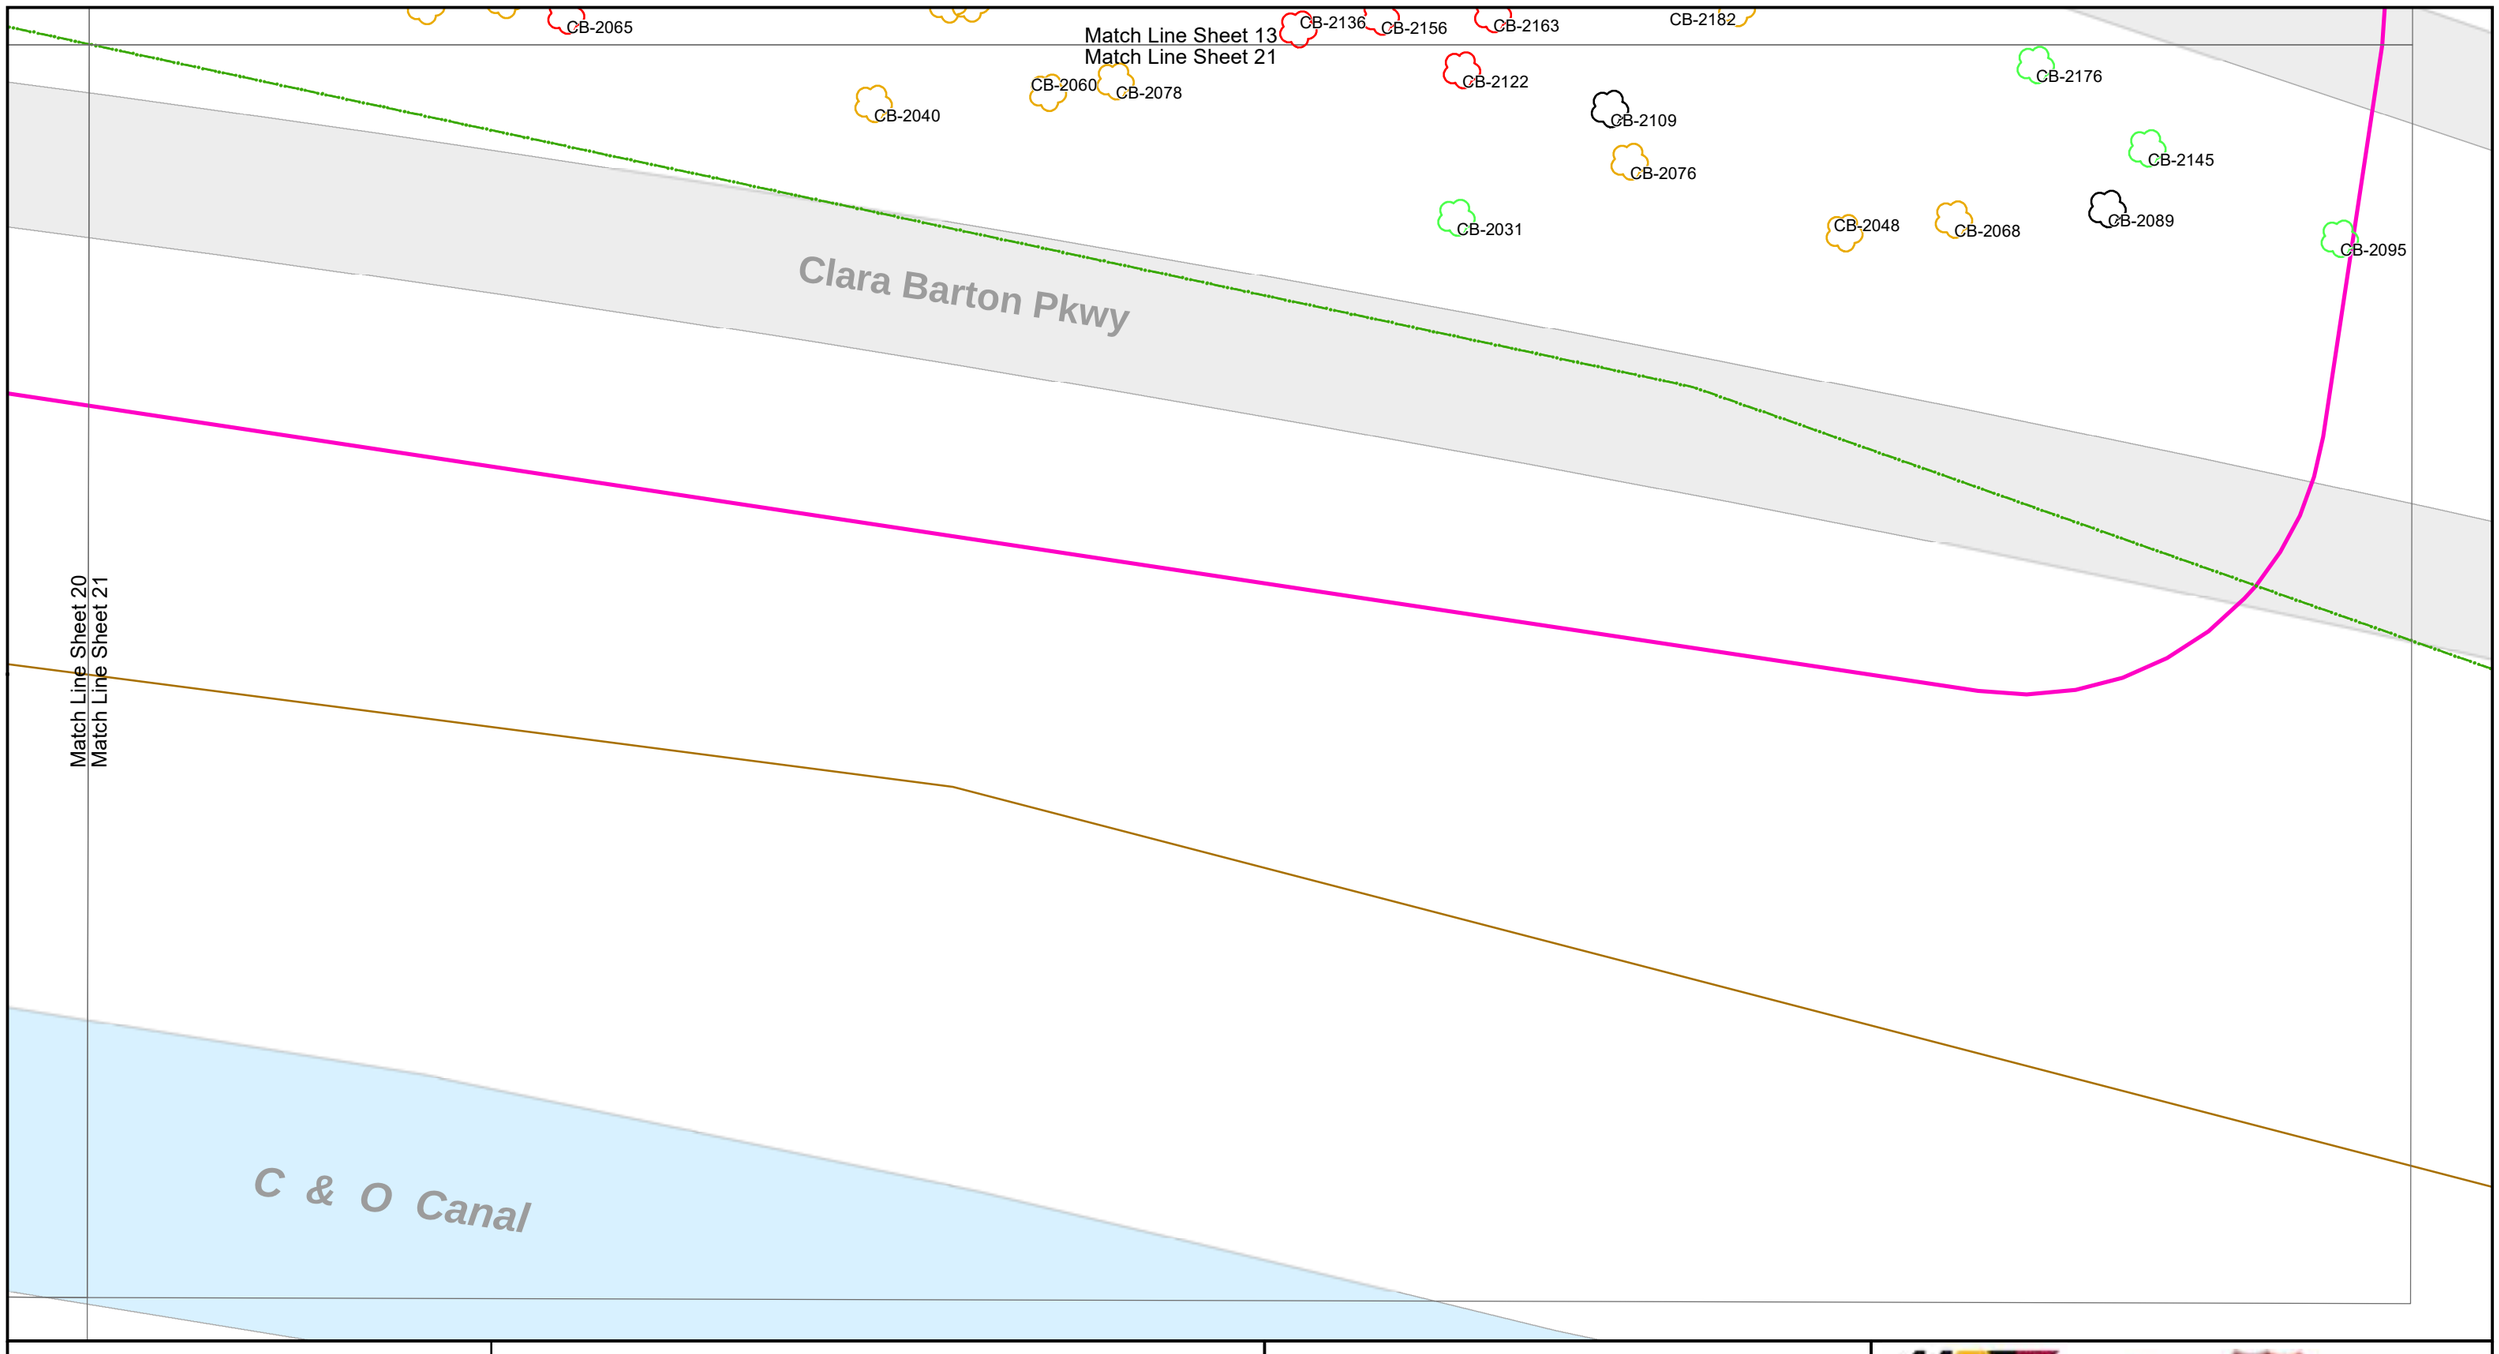

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.


MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 21 OF 57

Match Line Sheet 14
Match Line Sheet 22

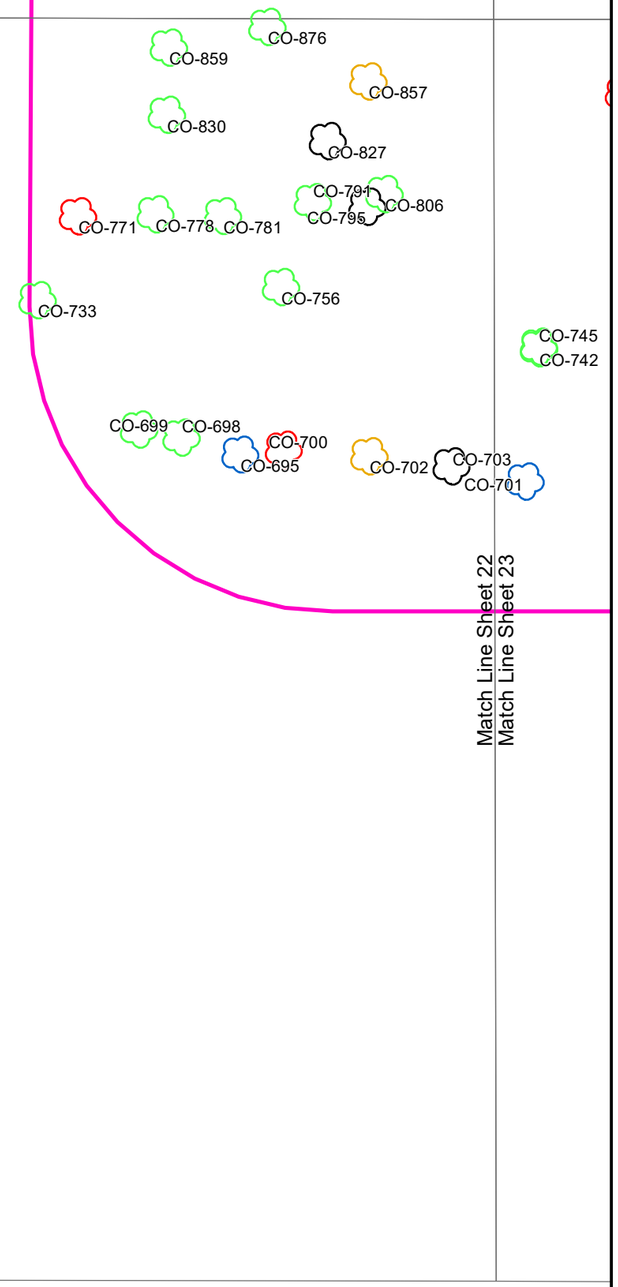

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 22 OF 57

Match Line Sheet 15
Match Line Sheet 23

Match Line Sheet 22
Match Line Sheet 23

Match Line Sheet 23
Match Line Sheet 24

CO-994 CO-999 CO-1042 CO-1060 CO-1094 CO-1143 CO-1155
CO-910 CO-986 CO-987 CO-1038 CO-1126 CO-1138
CO-932 CO-930 CO-1020 CO-1046 CO-1089 CO-1108
CO-873 CO-981 CO-991 CO-1041 CO-1107
CO-874 CO-951 CO-971 CO-963 CO-978 CO-1023 CO-1075
CO-881 CO-924 CO-954 CO-1036
CO-880 CO-890 CO-922 CO-1015
CO-845 CO-903 CO-915 CO-1011
CO-806 CO-825 CO-832 CO-833 CO-865 CO-907 CO-931 CO-944 CO-992
CO-885 CO-959 CO-974
CO-871 CO-849 CO-949
CO-807 CO-856 CO-864 CO-904 CO-948
CO-793 CO-855 CO-886 CO-906
CO-745 CO-863 CO-866 CO-921
CO-742 CO-766 CO-774
CO-787 CO-839
CO-759 CO-782 CO-819 CO-852
CO-763 CO-808 CO-842
CO-703 CO-717 CO-721 CO-743 CO-818 CO-838
CO-701 CO-790 CO-823 CO-826
CO-710 CO-711 CO-712 CO-722 CO-755 CO-783
CO-697 CO-709 CO-732 CO-777 CO-786
CO-744 CO-747
CO-728 CO-731 CO-769
CO-772

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 23 OF 57

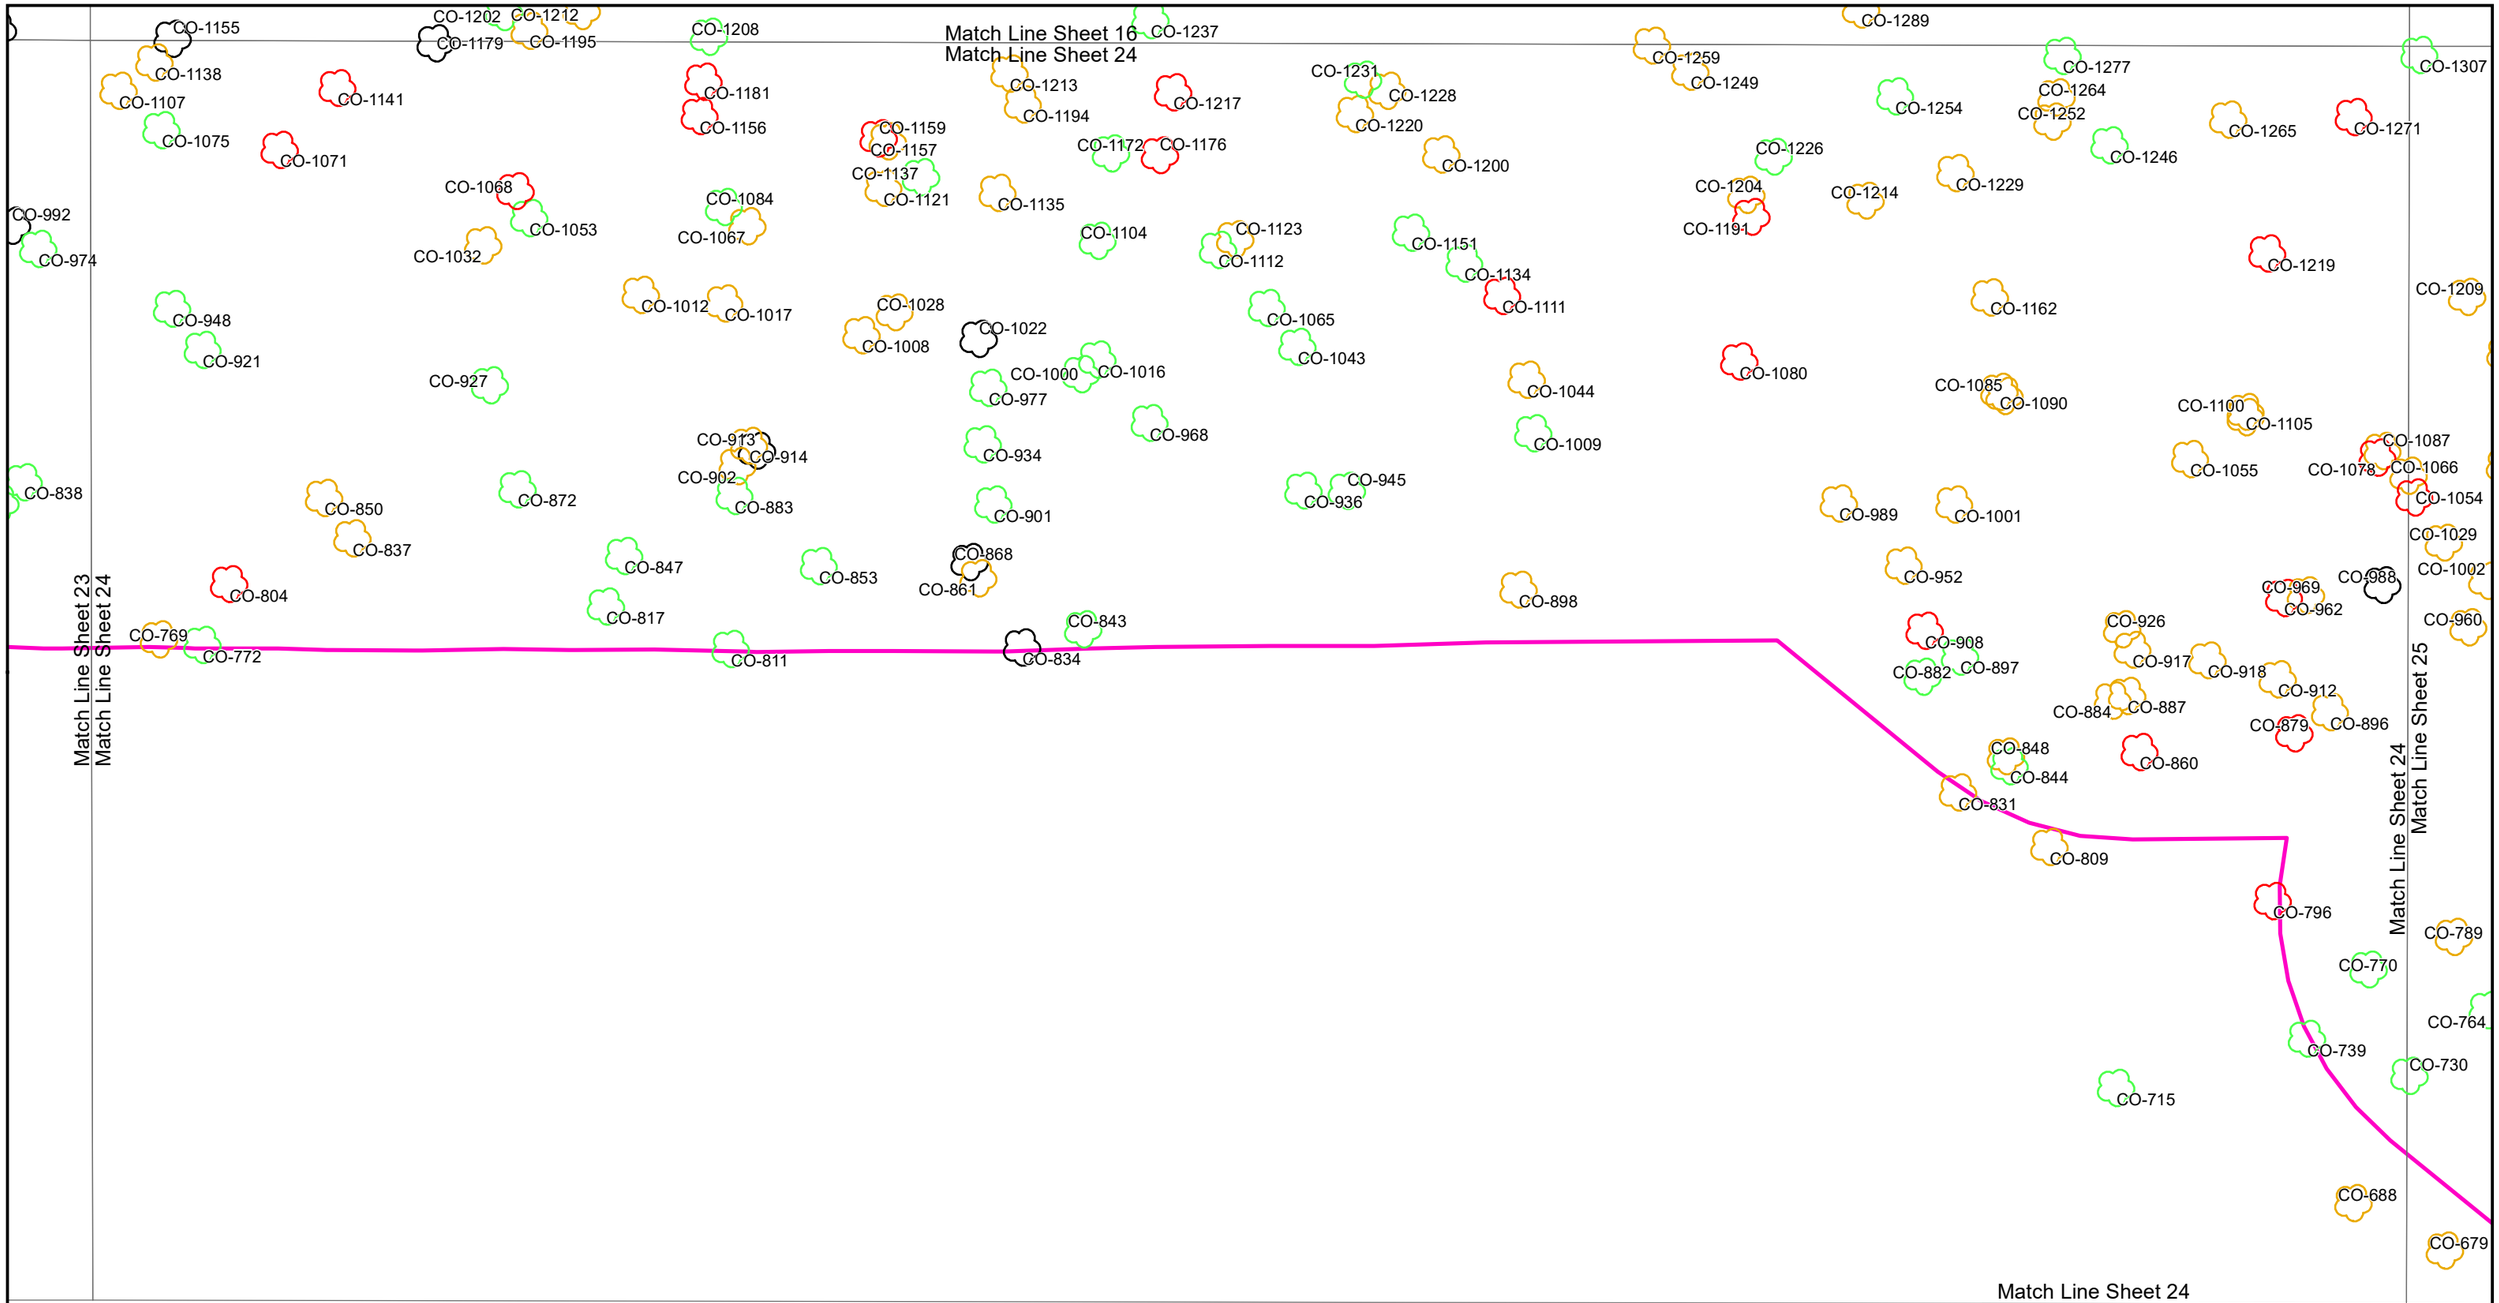

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:

1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 24 OF 57

Match Line Sheet 17
Match Line Sheet 25

Match Line Sheet 24
Match Line Sheet 25

Match Line Sheet 25
Match Line Sheet 29

Match Line Sheet 25
Match Line Sheet 26

Match Line Sheet 25
Match Line Sheet 30

I - 495 Capital Beltway Outer Loop

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 25 OF 57

Match Line Sheet 18
Match Line Sheet 26

Match Line Sheet 25
Match Line Sheet 26

Match Line Sheet 26
Match Line Sheet 27

Match Line Sheet 26
Match Line Sheet 30

I - 495 Capital Beltway Outer Loop

I - 495 Capital Beltway Inner Loop

CO-1600 CO-1596 CO-1573 CO-1568 CO-1571 CO-1574 CO-1569 CO-1586 CO-1576 CO-1558 CO-1556 CO-1544 CO-1548 CO-1547 CO-1555 CO-1531 CO-1541 CO-1542 CO-1536 CO-1532 CO-1512 CO-1518 CO-1493 CO-1480 CO-1473 CO-1505 CO-1490 CO-1503 CO-1519 CO-1504 CO-1535 CO-1524 CO-1522 CO-1500 CO-1487 CO-1497 CO-1507 CO-1494 CO-1525 CO-1511 CO-1496 CO-1499 CO-1478 CO-1463 CO-1445 CO-1479 CO-1469 CO-1450 CO-1459 CO-1465 CO-1451 CO-1452 CO-1426 CO-1435 CO-1433 CO-1382 CO-1383 CO-1386 CO-1361 CO-1357 CO-1366 CO-1354 CO-1381 CO-1408 CO-1400 CO-1393 CO-1364 CO-1406 CO-1389 CO-1380 CO-1375 CO-1437 CO-1316 CO-1311 CO-1320 CO-1322 CO-1336 CO-1323 CO-1343 CO-1304 CO-1332 CO-1276 CO-1297 CO-1313 CO-1291 CO-1308 CO-1294 CO-1303 CO-1275 CO-1255 CO-1279 CO-1283 CO-1269 CO-1256 CO-1253 CO-1260 CO-1278 CO-1210 CO-1223 CO-1224 CO-1227 CO-1247 CO-1188 CO-1203 CO-1230 CO-1233 CO-1222 CO-1236 CO-1186 CO-1178 CO-1192 CO-1216 CO-1232 CO-1161 CO-1149 CO-1182 CO-1163 CO-1175 CO-1184 CO-1185 CO-1189 CO-1193 CO-1218 CO-1183 CO-1128 CO-1131 CO-1132 CO-1114 CO-1113 CO-1153 CO-1051 CO-1072 CO-1030 CO-1048 CO-1110 CO-1095 CO-1059 CO-1083 CO-1116 CO-1102 CO-1127 CO-996 CO-1018 CO-983 CO-990 CO-1049 CO-1025 CO-946 CO-967 CO-979 CO-933 CO-935 CO-941 CO-982 CO-1013 CO-1005 CO-1014 CO-972 CO-985 CO-905 CO-889 CO-888 CO-875 CO-942 CO-877 CO-870 CO-862 CO-899

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 26 OF 57

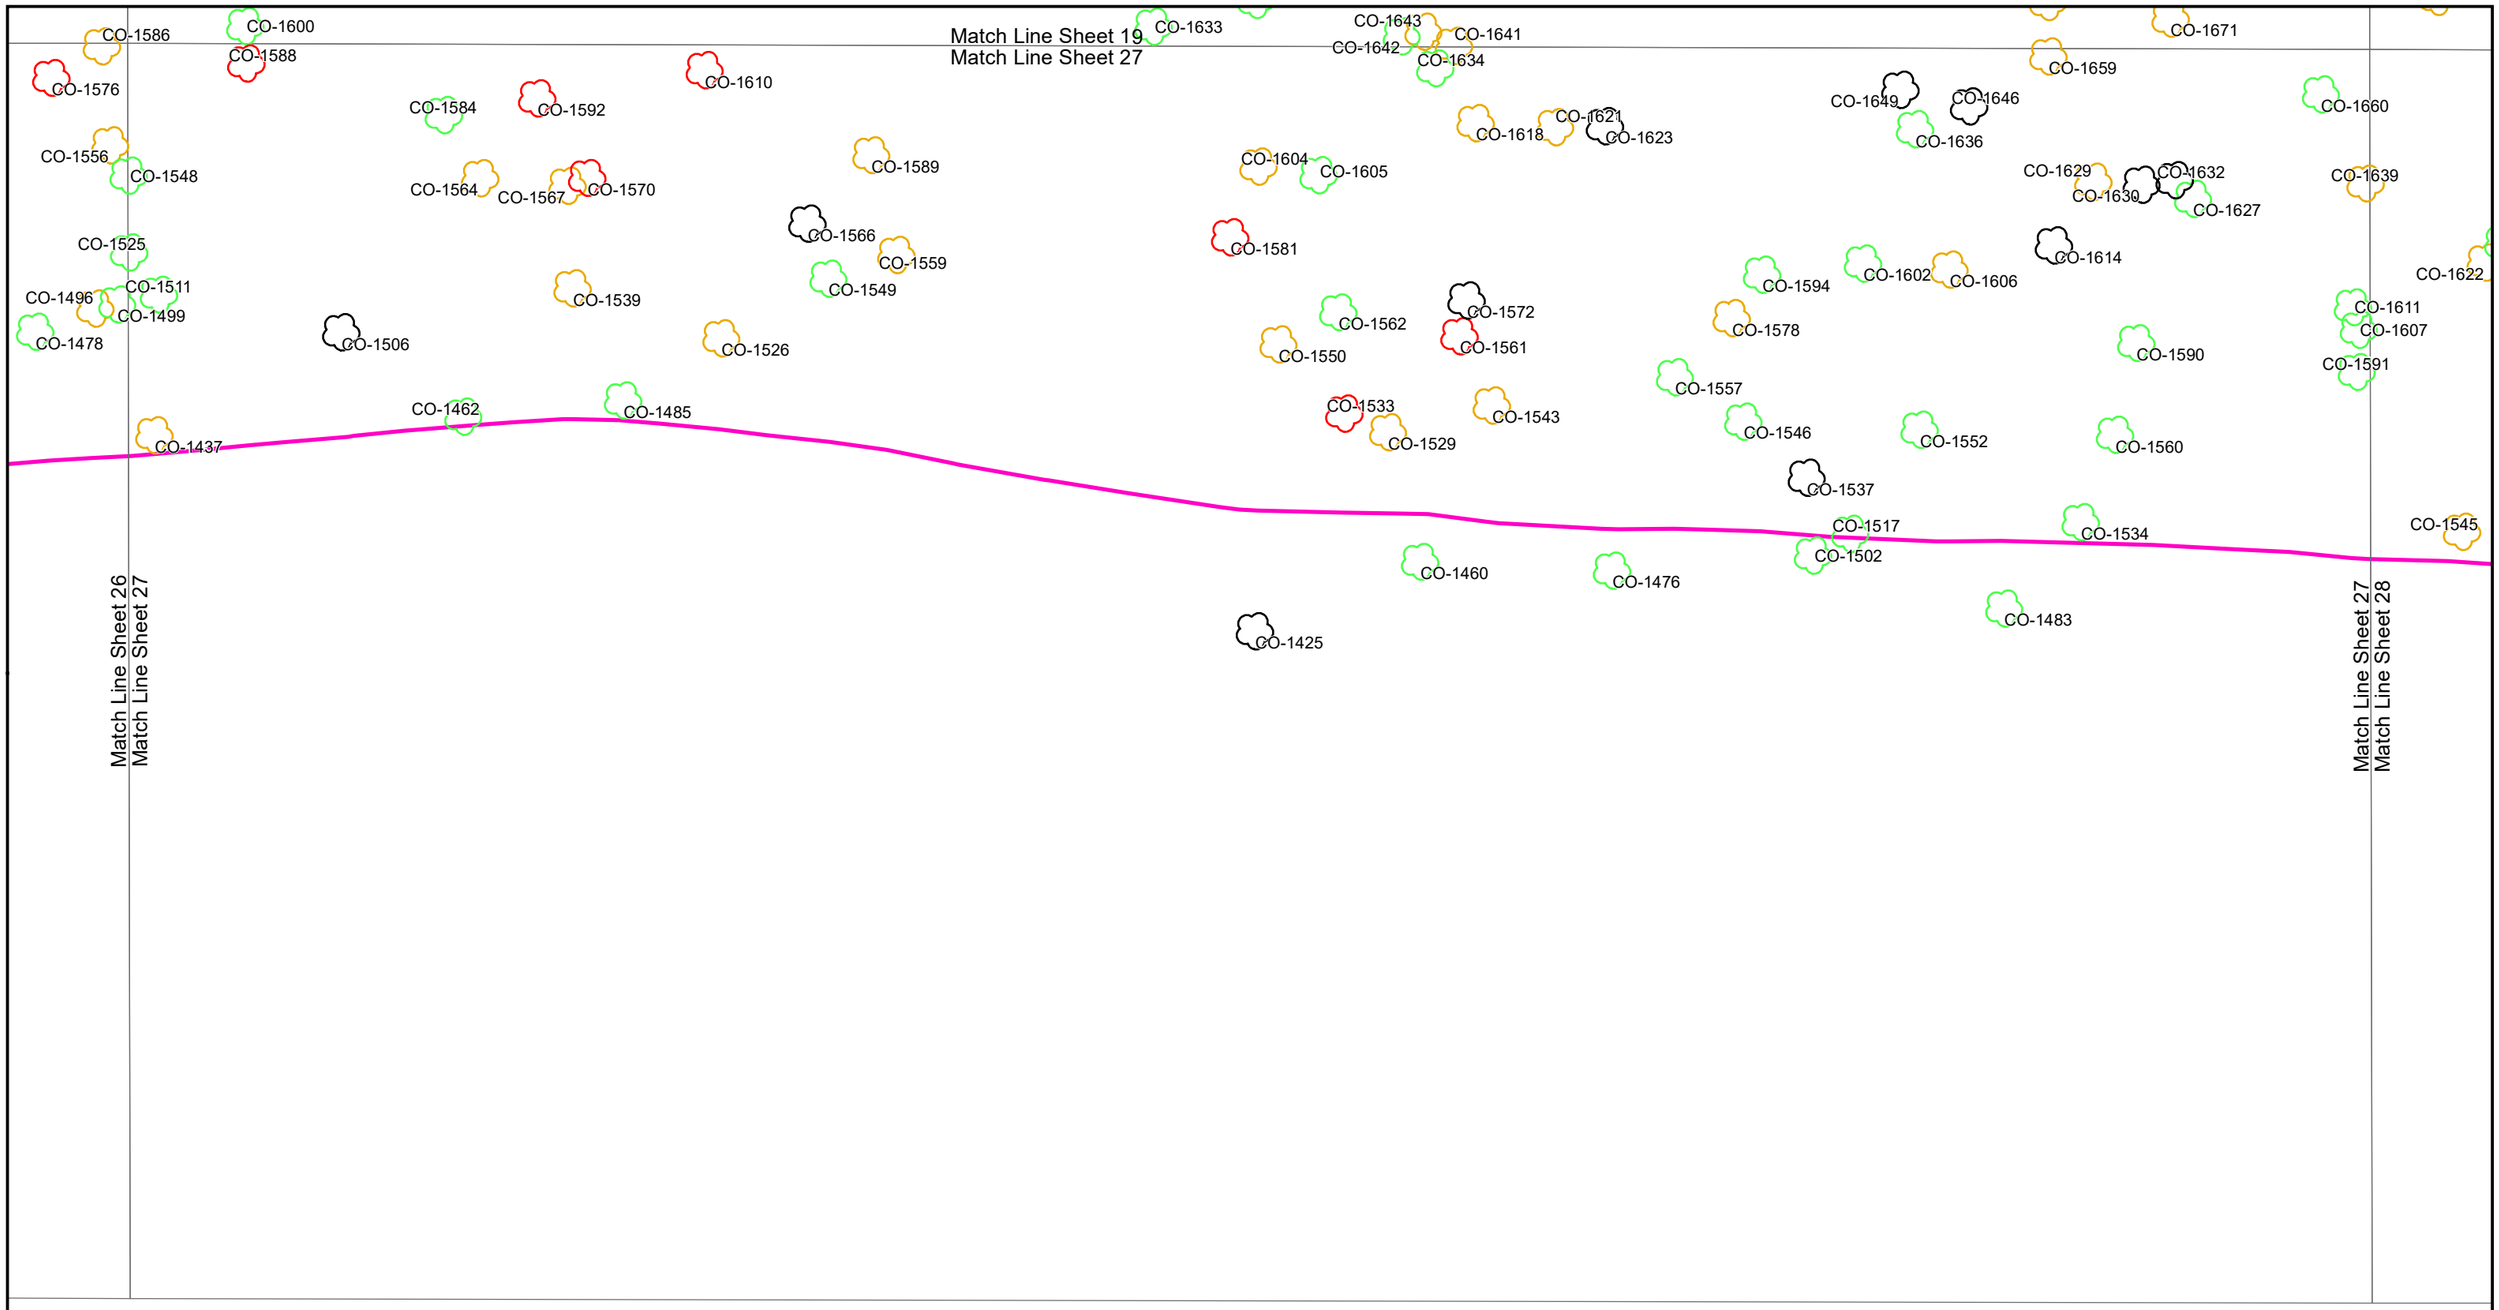

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 27 OF 57

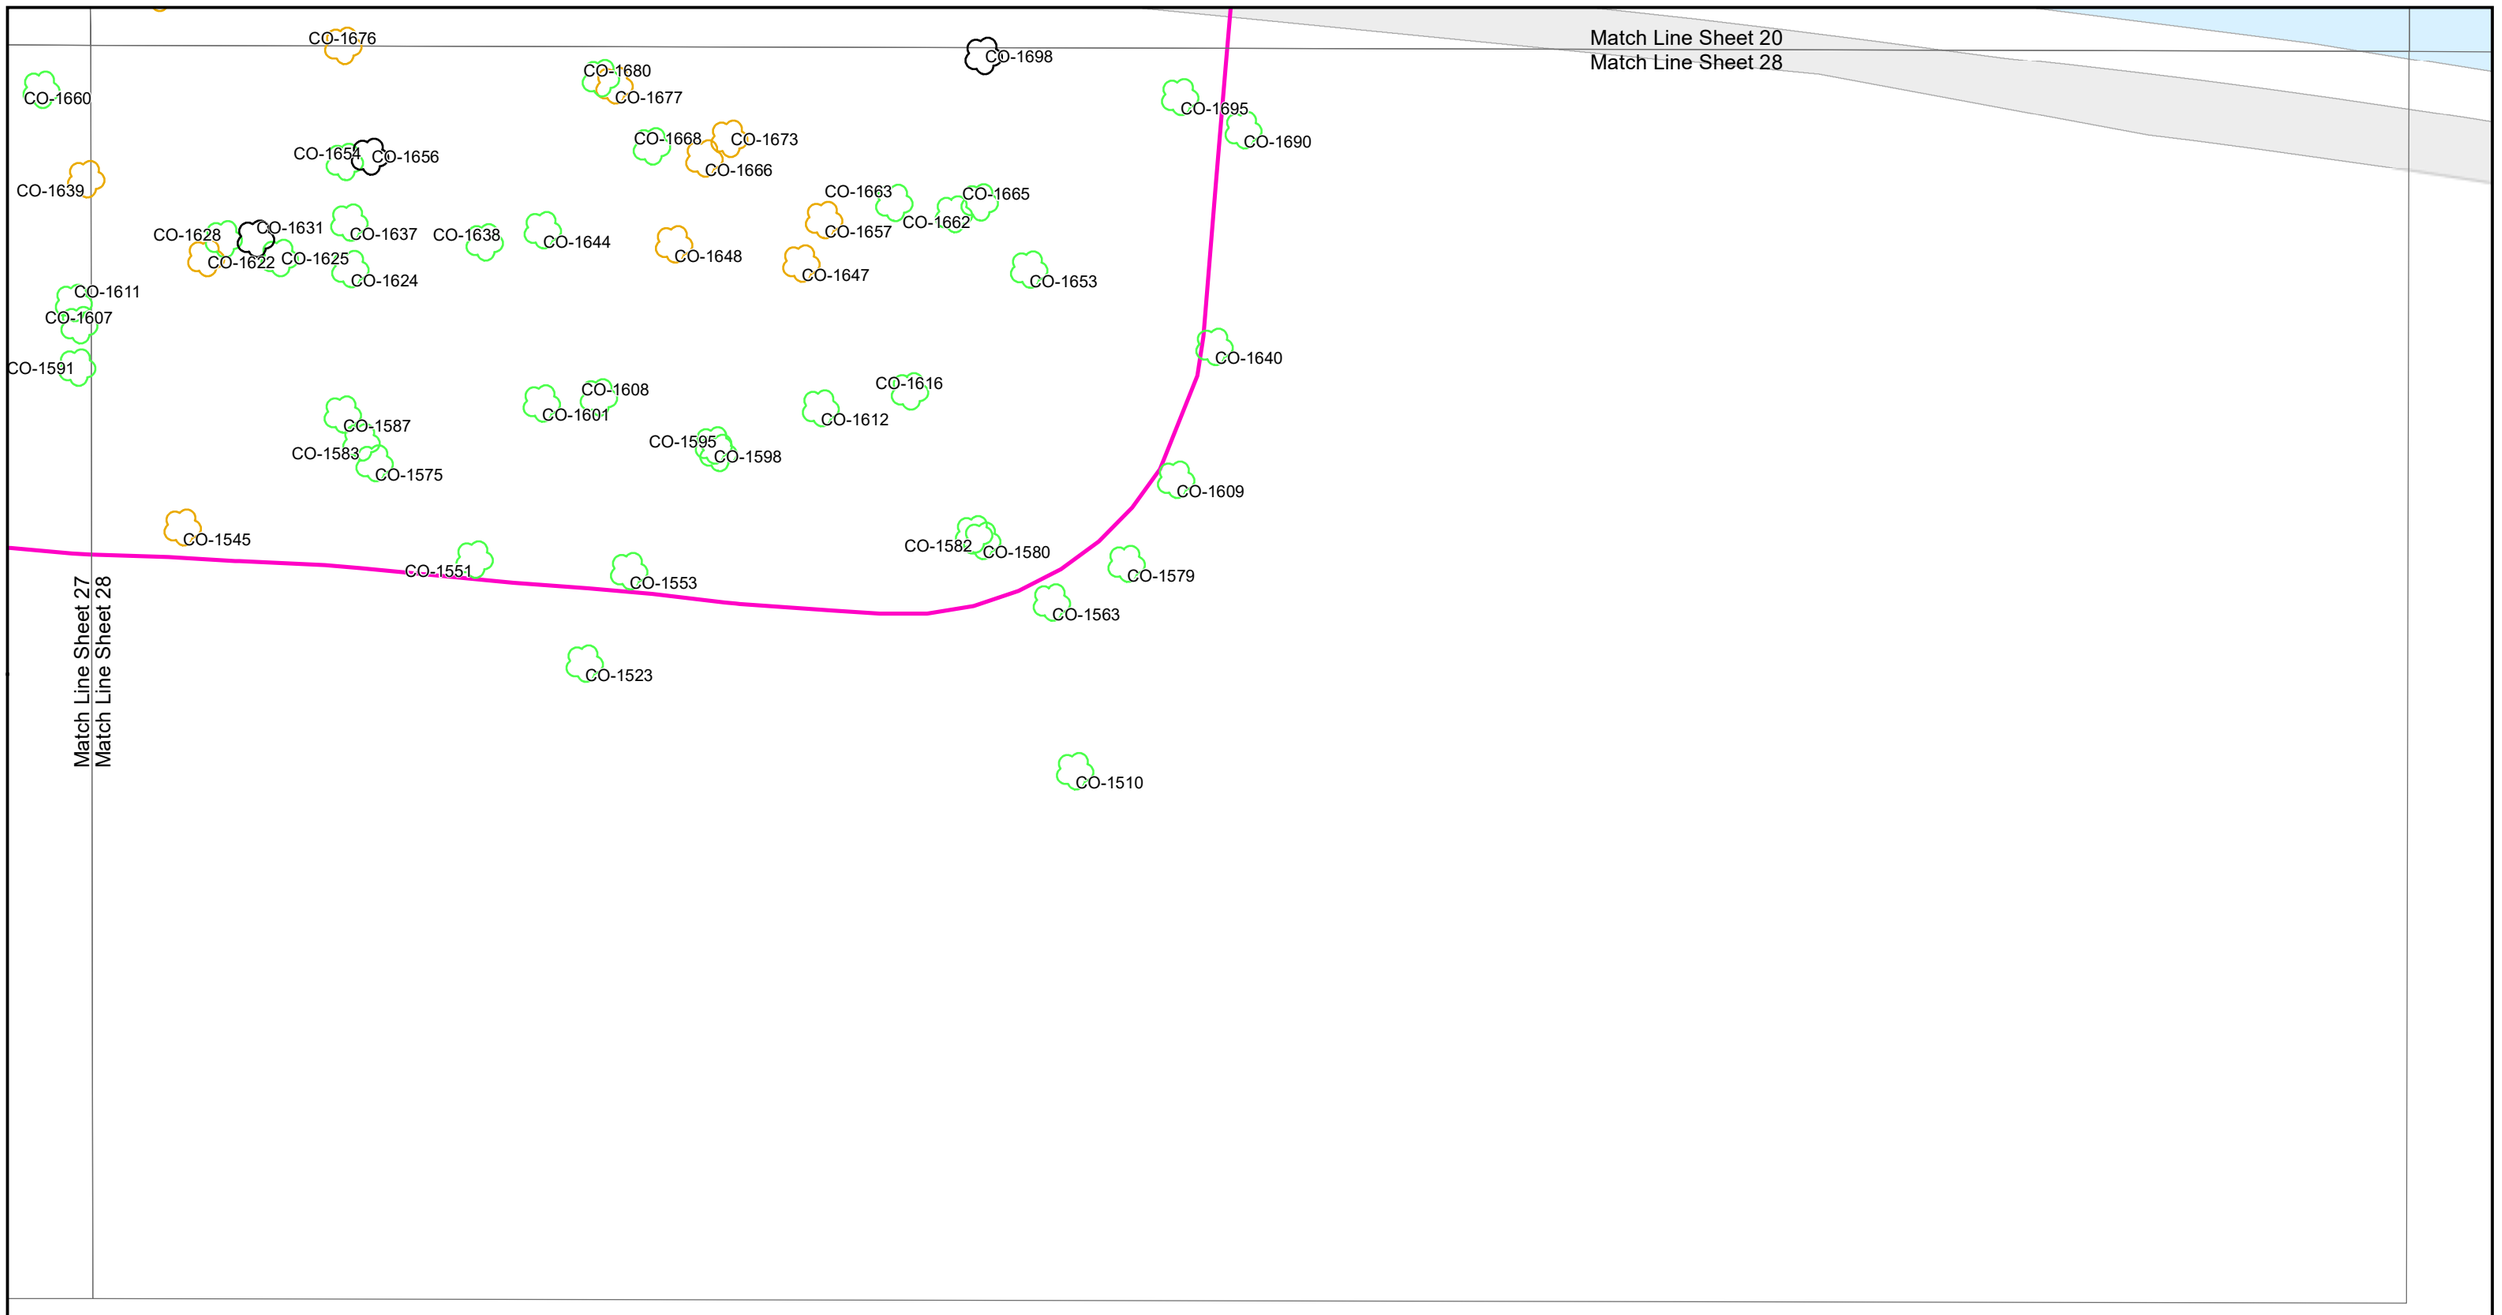

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 28 OF 57

Match Line Sheet 24
Match Line Sheet 29

Match Line Sheet 25
Match Line Sheet 29

Match Line Sheet 29
Match Line Sheet 30

Match Line Sheet 29
Match Line Sheet 31

CO-690
CO-684
CO-683
CO-672
CO-692
CO-686
CO-685
CO-696
CO-714
CO-713
CO-738
CO-750
CO-752
CO-746
CO-751
CO-748
CO-740
CO-723
CO-725
CO-708
CO-707
CO-724
CO-719
CO-664
CO-671
CO-656
CO-677
CO-681
CO-667
CO-662
CO-670
CO-673
CO-674
CO-669
CO-666
CO-665
CO-649
CO-637
CO-648
CO-642
CO-644
CO-652
CO-631
CO-647
CO-646
CO-632
CO-630
CO-625
CO-626
CO-628
CO-621
CO-620
CO-612
CO-629
CO-624
CO-617
CO-613
CO-618
CO-615
CO-614
CO-609
CO-602
CO-594
CO-589
CO-591
CO-582
CO-574
CO-583
CO-577
CO-572
CO-568
CO-553
CO-560
CO-558
CO-554
CO-557
CO-552
CO-551
CO-550
CO-549
CO-541
CO-581
CO-536
CO-532
CO-533
CO-530
CO-524
CO-528
CO-518
CO-519
CO-496
CO-490
CO-510
CO-508

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 29 OF 57

Match Line Sheet 25
Match Line Sheet 30

Match Line Sheet 26
Match Line Sheet 30

Match Line Sheet 29
Match Line Sheet 30

I - 495 Capital Beltway Outer Loop

I - 495 Capital Beltway Inner Loop

Match Line Sheet 30
Match Line Sheet 32

CO-752 CO-751 CO-746 CO-748 CO-740 CO-724 CO-666 CO-665 CO-773 CO-754 CO-737 CO-784 CO-797 CO-768 CO-776 CO-862 CO-870 CO-877 CO-851 CO-867 CO-815 CO-816 CO-794 CO-942 CO-899 CO-820 CO-758 CO-735 CO-720 CO-734 CO-749 CO-785 CO-767 CO-761 CO-762 CO-682 CO-689 CO-694 CO-706 CO-678 CO-668 CO-675 CO-704 CO-691 CO-705 CO-718 CO-716 CO-680 CO-676 CO-687 CO-693 CO-654 CO-657 CO-661 CO-659 CO-655 CO-643 CO-651 CO-640 CO-635 CO-658 CO-660 CO-653 CO-645 CO-638 CO-650 CO-636 CO-663 CO-622 CO-616 CO-611 CO-627 CO-641 CO-634 CO-639 CO-633 CO-608 CO-600 CO-606 CO-623 CO-619 CO-586 CO-578 CO-579 CO-588 CO-590 CO-595 CO-593 CO-592 CO-604 CO-610 CO-607 CO-597 CO-596 CO-605 CO-599 CO-603 CO-576 CO-575 CO-571 CO-569 CO-584 CO-585 CO-580 CO-598 CO-601 CO-564 CO-556 CO-587 CO-563 CO-565 CO-567 CO-561 CO-559 CO-573 CO-570 CO-547 CO-544 CO-543 CO-545 CO-548 CO-542 CO-566 CO-562 CO-546 CO-555 CO-539 CO-540 CO-531

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 30 OF 57

Match Line Sheet 29
Match Line Sheet 31

CO-496
CO-490
CO-485
CO-476
CO-475
CO-484
CO-491
CO-487
CO-478
CO-518
CO-510
CO-508
CO-519
CO-511
CO-509
CO-507
CO-498
CO-501
CO-502
CO-503
CO-500
CO-499
CO-495
CO-492
CO-489
CO-486
CO-483
CO-482
CO-528
CO-493
CO-458
CO-467
CO-470
CO-457
CO-477
CO-479
CO-445
CO-448
CO-437
CO-441
CO-456
CO-452
CO-429
CO-446
CO-436
CO-439
CO-465
CO-444
CO-450
CO-442
CO-426
CO-430
CO-433
CO-411
CO-412
CO-402
CO-415
CO-396
CO-395
CO-389
CO-417
CO-406
CO-377
CO-405
CO-407
CO-393
CO-384
CO-375
CO-356
CO-348
CO-343
CO-337
CO-322
CO-351
CO-350
CO-312
CO-310
CO-305
CO-300
CO-299
CO-318
CO-292
CO-287
CO-302
CO-335
CO-339
CO-330
CO-325
CO-315
CO-320
CO-314
CO-277
CO-266

I - 495 Capital Beltway Outer Loop

Match Line Sheet 31
Match Line Sheet 32

Match Line Sheet 31
Match Line Sheet 33

CO-288
CO-282

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 MANAGED LANES STUDY 270

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 31 OF 57

Match Line Sheet 30
Match Line Sheet 32

Match Line Sheet 31
Match Line Sheet 32

Match Line Sheet 32
Match Line Sheet 34

I - 495 Capital Beltway Inner Loop

Rock Run Culvert

CO-543 CO-542 CO-539 CO-540 CO-546 CO-555 CO-562
CO-531
CO-538 CO-537 CO-535 CO-534
CO-523 CO-522 CO-521 CO-514 CO-517
CO-527 CO-526 CO-529 CO-525
CO-515
CO-472
CO-513 CO-516 CO-520 CO-512 CO-506 CO-505 CO-504
CO-494 CO-497
CO-488 CO-481 CO-480
CO-469 CO-473 CO-474 CO-466 CO-468 CO-462 CO-464 CO-463
CO-449
CO-447 CO-438 CO-435
CO-460 CO-455 CO-454 CO-451 CO-471 CO-461
CO-425
CO-440 CO-431 CO-432 CO-443
CO-420
CO-459 CO-453
CO-408
CO-428 CO-424 CO-422 CO-434
CO-413 CO-410 CO-414 CO-409 CO-400
CO-418 CO-416 CO-421 CO-419 CO-427 CO-423
CO-392
CO-379 CO-371 CO-364
CO-394 CO-386 CO-391 CO-403 CO-404 CO-398
CO-373
CO-385 CO-388 CO-383 CO-382 CO-390 CO-381 CO-399 CO-401 CO-397
CO-369 CO-372 CO-363 CO-367 CO-370 CO-368 CO-378 CO-387
CO-345 CO-341
CO-359 CO-354
CO-340
CO-355
CO-366 CO-374 CO-365 CO-380 CO-376

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 32 OF 57

Match Line Sheet 31
Match Line Sheet 33

Match Line Sheet 33
Match Line Sheet 34

I - 495 Capital Beltway Outer Loop

I - 495 Capital Beltway Inner Loop

CO-277
CO-266
CO-250
CO-244
CO-256
CO-246
CO-265
CO-252
CO-229
CO-223
CO-227
CO-219
CO-202
CO-208
CO-210
CO-212
CO-215
CO-200
CO-233
CO-240
CO-232
CO-231
CO-288
CO-282
CO-272
CO-270
CO-314
CO-311
CO-217
CO-225
CO-182
CO-187
CO-184
CO-168
CO-161
CO-166
CO-163
CO-180
CO-179
CO-174
CO-158
CO-156
CO-153
CO-147
CO-150
CO-134
CO-139
CO-140
CO-143
CO-124
CO-121
CO-136
CO-142
CO-125
CO-126
CO-132
CO-120
CO-137
CO-102
CO-89
CO-106
CO-105
CO-107
CO-109
CO-88
CO-68
CO-76

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 MANAGED LANES STUDY 270

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 33 OF 57

Match Line Sheet 32
Match Line Sheet 34

Match Line Sheet 33
Match Line Sheet 34

Rock Run Culvert

Match Line Sheet 34
Match Line Sheet 35

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021

Match Line Sheet 34
Match Line Sheet 35

CO-1 CO-2 CO-3 CO-4 CO-5 CO-6 CO-7 CO-8 CO-9 CO-10 CO-11 CO-12 CO-13 CO-14 CO-15 CO-16 CO-17 CO-18 CO-19 CO-20 CO-21 CO-22 CO-23 CO-24 CO-25 CO-26 CO-27 CO-28 CO-29 CO-30 CO-31 CO-32 CO-33 CO-34 CO-35 CO-36 CO-37 CO-38 CO-39 CO-40 CO-41 CO-42 CO-43 CO-44 CO-45 CO-46 CO-47 CO-48 CO-49 CO-50 CO-51 CO-52 CO-53 CO-54 CO-55 CO-56 CO-57 CO-58 CO-59 CO-60 CO-61 CO-62 CO-63 CO-64 CO-65 CO-66 CO-67 CO-69 CO-70 CO-71 CO-72 CO-73 CO-74 CO-75 CO-77 CO-78 CO-79 CO-80 CO-81 CO-82 CO-83 CO-84 CO-85 CO-86 CO-87 CO-90 CO-91 CO-92 CO-93 CO-94 CO-95 CO-96 CO-98 CO-99 CO-100 CO-101 CO-103 CO-104 CO-111 CO-115 CO-116 CO-117 CO-123 CO-127 CO-130

Potomac River

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way

- CO/CB-# Tree in Excellent Condition
- CO/CB-# Tree in Good Condition
- CO/CB-# Tree in Fair Condition
- CO/CB-# Tree in Poor Condition
- CO/CB-# Standing Dead

*CO = C&O National Historical Park, CB = Clara Barton Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 36. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 37.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
C&O CANAL NATIONAL HISTORICAL PARK (CO) AND CLARA BARTON PKWY (CB)

AUGUST 2021 | SHEET NO. 35 OF 57

Tree Condition Assessment Guidelines:

- ***Excellent*** – healthy tree with exceptional growth form; no visible defects; well-formed crown; few minor dead branches acceptable; this tree condition is rare.
- ***Good*** – healthy tree; very minor defects/decay acceptable with callous forming/complete; well-formed crown; minor lean and/or few minor/major dead branches acceptable; vines may be growing along trunk but not present within crown.
- ***Fair*** – health questionable/stress evident; structurally sound tree; defects present that do not affect structural integrity; moderate lean; minor/major dead branches may be present; crown not broken out but not necessarily well formed or even; vines may be growing along trunk and within crown.

  Ex. Fair tree could be experiencing insect damage, or exhibit a growth form that makes it very susceptible to wind damage in an open setting.
- ***Poor*** – significant health problems; may be structurally unsound; may be dead or dying; may contain significant decay; may have broken or missing top/crown; may have heavy lean; vines may be significantly affecting tree health.
- ***Standing dead*** – any tree inventoried that was standing upright and determined to be dead by the field team.

These tree species may commonly exhibit dead branches and/or ratty growth form/structure, which should be taken into account when assessing tree condition:

- Mulberry (*Morus spp*.)
- Pin Oak (*Quercus palustris*)
- Silver Maple (*Acer saccharinum*)
- Virginia Pine (*Pinus virginiana*)
- Scarlet Oak (*Quercus coccinea*)
- Black Locust (*Robinia pseudoacacia*)
- Osage Orange (*Maclura pomifera*)
- Willow Oak (*Quercus phellos*)
- Black Willow (*Salix nigra*)

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
C&O Canal National Historic Park								
CO-1	Silver maple	*Acer saccharinum*	13, 10, 8	3	6.5	19.5	Fair	Leaning, multistem 13 x 10 x 8
CO-2	American elm	*Ulmus americana*	12	1	6	18	Fair	Many vines in canopy
CO-3	American sycamore	*Platanus occidentalis*	18	1	9	27	Good	Minor vines
CO-4	American elm	*Ulmus americana*	8	1	N/A	N/A	Standing Dead	
CO-5	Silver maple	*Acer saccharinum*	21, 12	2	10.5	31.5	Good	Minor vines, twin trunk 21 x 12
CO-6	American elm	*Ulmus americana*	15	1	7.5	22.5	Fair	Many vines in canopy
CO-7	Princesstree	*Paulownia tomentosa*	9	1	N/A	N/A	Standing Dead	
CO-8	Silver maple	*Acer saccharinum*	8	1	4	12	Fair	Leaning
CO-9	American sycamore	*Platanus occidentalis*	8	1	4	12	Good	
CO-10	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Vines, leaning
CO-11	American sycamore	*Platanus occidentalis*	8, 6	2	4	12	Fair	Leaning, twin trunk 8 x 6
CO-12	Honey locust	*Gleditsia triacanthos*	7	1	3.5	10.5	Fair	Vines in canopy, trunk damage
CO-13	American sycamore	*Platanus occidentalis*	12, 9, 8	3	6	18	Fair	Leaning, multistem trunk 12 x 9 x 8
CO-14	Boxelder	*Acer negundo*	5	1	2.5	7.5	Good	
CO-15	Black walnut	*Juglans nigra*	12	1	6	18	Fair	Many vines in canopy
CO-16	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Vines, leaning
CO-17	American sycamore	*Platanus occidentalis*	12	1	6	18	Good	
CO-18	Green ash	*Fraxinus pennsylvanica*	13	1	N/A	N/A	Standing Dead	
CO-19	Silver maple	*Acer saccharinum*	14	1	7	21	Fair	Leaning
CO-20	Boxelder	*Acer negundo*	6	1	3	9	Fair	Dead branches
CO-21	American elm	*Ulmus americana*	10	1	5	15	Good	Some vines
CO-22	Unknown		5	1	N/A	N/A	Standing Dead	
CO-23	Northern red oak	*Quercus rubra*	10	1	5	15	Fair	Leaning, few broken branches
CO-24*	Silver maple	*Acer saccharinum*	34	1	17	51	Fair	Leaning dead leader
CO-25	Boxelder	*Acer negundo*	7	1	3.5	10.5	Good	
CO-26	Black walnut	*Juglans nigra*	9	1	4.5	13.5	Fair	Many vines in canopy
CO-27	American elm	*Ulmus americana*	6	1	3	9	Fair	Vines in canopy
CO-28	Green ash	*Fraxinus pennsylvanica*	11	1	5.5	16.5	Poor	One living branch
CO-29	Northern red oak	*Quercus rubra*	25	1	12.5	37.5	Good	
CO-30	Green ash	*Fraxinus pennsylvanica*	12	1	N/A	N/A	Standing Dead	
CO-31	American elm	*Ulmus americana*	6	1	3	9	Fair	Leaning, vines
CO-32	American elm	*Ulmus americana*	10	1	5	15	Fair	Vines in canopy
CO-33	American elm	*Ulmus americana*	17	1	8.5	25.5	Poor	Many vines, reduced crown
CO-34	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Vines in canopy, few dead branches
CO-35	Green ash	*Fraxinus pennsylvanica*	7	1	N/A	N/A	Standing Dead	
CO-36	American elm	*Ulmus americana*	5	1	N/A	N/A	Standing Dead	
CO-37	Green ash	*Fraxinus pennsylvanica*	18	1	N/A	N/A	Standing Dead	
CO-38	Sugar maple	*Acer saccharum*	9	1	4.5	13.5	Good	
CO-39	Green ash	*Fraxinus pennsylvanica*	8	1	N/A	N/A	Standing Dead	
CO-40	Green ash	*Fraxinus pennsylvanica*	11	1	N/A	N/A	Standing Dead	
CO-41	Oak sp.	*Quercus sp.*	12	1	N/A	N/A	Standing Dead	
CO-42	Silver maple	*Acer saccharinum*	9	1	4.5	13.5	Poor	Many dead branches
CO-43	White oak	*Quercus alba*	5	1	2.5	7.5	Good	
CO-44	Green ash	*Fraxinus pennsylvanica*	6	1	N/A	N/A	Standing Dead	
CO-45	Sugar maple	*Acer saccharum*	5	1	2.5	7.5	Good	
CO-46	Northern red oak	*Quercus rubra*	9	1	4.5	13.5	Fair	Fungus, few broken branches
CO-47	Unknown		8	1	N/A	N/A	Standing Dead	Species unknown
CO-48	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Vines in canopy
CO-49	Green ash	*Fraxinus pennsylvanica*	13	1	N/A	N/A	Standing Dead	
CO-50	Sugar maple	*Acer saccharum*	15	1	7.5	22.5	Good	
CO-51	Silver maple	*Acer saccharinum*	20	1	10	30	Fair	Leaning
CO-52	Green ash	*Fraxinus pennsylvanica*	10	1	N/A	N/A	Standing Dead	
CO-53	Northern red oak	*Quercus rubra*	19	1	9.5	28.5	Good	Minor vines
CO-54	Green ash	*Fraxinus pennsylvanica*	7	1	N/A	N/A	Standing Dead	
CO-55	Sugar maple	*Acer saccharum*	6	1	3	9	Good	
CO-56	Silver maple	*Acer saccharinum*	25	1	12.5	37.5	Good	
CO-57	Silver maple	*Acer saccharinum*	15	1	7.5	22.5	Good	
CO-58	Green ash	*Fraxinus pennsylvanica*	9	1	4.5	13.5	Poor	Leaning, dying, vines
CO-59	Silver maple	*Acer saccharinum*	25	1	12.5	37.5	Good	
CO-60	Sugar maple	*Acer saccharum*	10	1	5	15	Good	
CO-61	Boxelder	*Acer negundo*	14	1	7	21	Fair	With vines
CO-62	Sugar maple	*Acer saccharum*	8	1	4	12	Good	
CO-63	Silver maple	*Acer saccharinum*	11	1	5.5	16.5	Fair	Trunk rot
CO-64	Green ash	*Fraxinus pennsylvanica*	17	1	N/A	N/A	Standing Dead	
CO-65	Green ash	*Fraxinus pennsylvanica*	5	1	N/A	N/A	Standing Dead	
CO-66	Northern red oak	*Quercus rubra*	11	1	5.5	16.5	Poor	One living leader, rest are dead
CO-67	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Vines in canopy
CO-68*	Silver maple	*Acer saccharinum*	37, 34	2	18.5	55.5	Fair	Twin trunks 37 x 34. Lean over water, water sprouting, exposed roots, undercut roots.

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-69	Green ash	*Fraxinus pennsylvanica*	7	1	N/A	N/A	Standing Dead	
CO-70	Silver maple	*Acer saccharinum*	19, 17	2	9.5	28.5	Excellent	Twin trunk 19 x 17, leaning
CO-71	American elm	*Ulmus americana*	9	1	4.5	13.5	Poor	Many dead branches
CO-72	American elm	*Ulmus americana*	11	1	5.5	16.5	Fair	Stressed
CO-73	Tree of heaven	*Ailanthus altissima*	15	1	7.5	22.5	Good	
CO-74	Eastern redcedar	*Juniperus virginiana*	9	1	4.5	13.5	Good	
CO-75	Green ash	*Fraxinus pennsylvanica*	6	1	N/A	N/A	Standing Dead	
CO-76*	Silver maple	*Acer saccharinum*	40	1	20	60	Fair	Lean. Exposed roots. Undercut roots.
CO-77	Green ash	*Fraxinus pennsylvanica*	7	1	N/A	N/A	Standing Dead	
CO-78	Tree of heaven	*Ailanthus altissima*	11	1	5.5	16.5	Good	
CO-79	Green ash	*Fraxinus pennsylvanica*	9	1	N/A	N/A	Standing Dead	
CO-80	Green ash	*Fraxinus pennsylvanica*	5	1	2.5	7.5	Poor	Many dead branches
CO-81	Boxelder	*Acer negundo*	14	1	7	21	Fair	Dead branches
CO-82	Silver maple	*Acer saccharinum*	20	1	10	30	Poor	Extensive vines in canopy
CO-83	Boxelder	*Acer negundo*	12, 10	2	6	18	Fair	Twin trunks 12 x 10, many dead branches
CO-84	Silver maple	*Acer saccharinum*	27	1	13.5	40.5	Good	
CO-85	Green ash	*Fraxinus pennsylvanica*	15	1	N/A	N/A	Standing Dead	
CO-86	Pignut hickory	*Carya glabra*	11	1	5.5	16.5	Good	
CO-87	Unknown		5	1	N/A	N/A	Standing Dead	
CO-88*	Silver maple	*Acer saccharinum*	33	1	16.5	49.5	Fair	Significant lean. Dead lower branches.
CO-89	Silver maple	*Acer saccharinum*	29, 24	2	14.5	43.5	Fair	Twin trunk 29 x 24. Significant lean
CO-90	American elm	*Ulmus americana*	6	1	3	9	Fair	Many vines
CO-91	Green ash	*Fraxinus pennsylvanica*	7	1	3.5	10.5	Poor	One living branch
CO-92	Boxelder	*Acer negundo*	19	1	9.5	28.5	Poor	Dead leader, vines in canopy
CO-93	Eastern redcedar	*Juniperus virginiana*	5	1	N/A	N/A	Standing Dead	
CO-94	Northern red oak	*Quercus rubra*	8	1	4	12	Fair	Vines, few dead branches
CO-95	Green ash	*Fraxinus pennsylvanica*	10	1	N/A	N/A	Standing Dead	
CO-96	Green ash	*Fraxinus pennsylvanica*	7	1	N/A	N/A	Standing Dead	
CO-97	Boxelder	*Acer negundo*	19	1	9.5	28.5	Good	
CO-98	Eastern redcedar	*Juniperus virginiana*	7	1	3.5	10.5	Fair	Several dying branches
CO-99	Sugar maple	*Acer saccharum*	9	1	4.5	13.5	Good	
CO-100	Sugar maple	*Acer saccharum*	5	1	2.5	7.5	Good	
CO-101	Black cherry	*Prunus serotina*	8	1	4	12	Poor	One living offshoot
CO-102	Silver maple	*Acer saccharinum*	24	1	12	36	Fair	Water sprouting, slight lean, vines into canopy, sparse crown
CO-103	Green ash	*Fraxinus pennsylvanica*	7	1	N/A	N/A	Standing Dead	
CO-104	Northern red oak	*Quercus rubra*	7	1	3.5	10.5	Fair	A few dead branches
CO-105	Silver maple	*Acer saccharinum*	11	1	5.5	16.5	Fair	Dead branches. Thin canopy. Lean
CO-106	Silver maple	*Acer saccharinum*	23	1	11.5	34.5	Fair	Vine into canopy. Irregular growth
CO-107	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Trunk wound. Dead lower branches.
CO-108*	Silver maple	*Acer saccharinum*	37	1	18.5	55.5	Fair	Many vines
CO-109	Silver maple	*Acer saccharinum*	20	1	10	30	Fair	Lean. One sided growth. Dead branches.
CO-110	American elm	*Ulmus americana*	6	1	3	9	Poor	Vines, dead leader
CO-111	American elm	*Ulmus americana*	8	1	4	12	Good	
CO-112	Boxelder	*Acer negundo*	9	1	4.5	13.5	Poor	Trunk damage, extensive vines
CO-113	Green ash	*Fraxinus pennsylvanica*	17	1	N/A	N/A	Standing Dead	
CO-114	Green ash	*Fraxinus pennsylvanica*	7	1	N/A	N/A	Standing Dead	
CO-115	Eastern redcedar	*Juniperus virginiana*	5	1	2.5	7.5	Good	
CO-116	Princesstree	*Paulownia tomentosa*	8	1	N/A	N/A	Standing Dead	
CO-117	Pignut hickory	*Carya glabra*	19	1	9.5	28.5	Good	
CO-118	Silver maple	*Acer saccharinum*	20	1	10	30	Poor	Extensive vines in canopy
CO-119	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	With vines
CO-120	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Irregular growth. Water sprouting
CO-121	American elm	*Ulmus americana*	22	1	11	33	Fair	Significant lean. Irregular growth
CO-122	Sugar maple	*Acer saccharum*	8	1	4	12	Fair	Dead leader, vines
CO-123	Princesstree	*Paulownia tomentosa*	7	1	N/A	N/A	Standing Dead	
CO-124	Boxelder	*Acer negundo*	8	1	4	12	Fair	Water sprouting. Irregular bark growth.
CO-125	Silver maple	*Acer saccharinum*	29	1	14.5	43.5	Fair	Water sprouting. Included bark. Trunk wound.
CO-126*	Silver maple	*Acer saccharinum*	49, 34	2	24.5	73.5	Fair	Twin trunk 34 x 49. Water sprouting. Dead leader.

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-127	Princesstree	*Paulownia tomentosa*	6	1	N/A	N/A	Standing Dead	
CO-128	Pignut hickory	*Carya glabra*	9	1	4.5	13.5	Good	Vines
CO-129	Red maple	*Acer rubrum*	7, 7, 6	3	3.5	10.5	Fair	Broken leader, multistem 7 x 7 x 6
CO-130	Sugar maple	*Acer saccharum*	11	1	5.5	16.5	Fair	Broken leader
CO-131	Green ash	*Fraxinus pennsylvanica*	7	1	N/A	N/A	Standing Dead	
CO-132	Silver maple	*Acer saccharinum*	25, 23	2	12.5	37.5	Fair	Twin trunk 25 x 23. Significant lean.
CO-133	American elm	*Ulmus americana*	5	1	2.5	7.5	Good	
CO-134	Boxelder	*Acer negundo*	10, 7	2	5	15	Fair	Twin trunk 10 x 7. Water sprouting. Minor trunk damage
CO-135	Green ash	*Fraxinus pennsylvanica*	5	1	N/A	N/A	Standing Dead	
CO-136	Boxelder	*Acer negundo*	6	1	3	9	Fair	Broken branches. Irregular growth
CO-137	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Irregular growth form
CO-138	Chestnut oak	*Quercus montana*	5	1	2.5	7.5	Good	
CO-139	Silver maple	*Acer saccharinum*	20	1	10	30	Fair	Water sprouting. Bark disease
CO-140*	Silver maple	*Acer saccharinum*	31	1	15.5	46.5	Fair	Strong lean. Trunk wound. Minor water sprouting.
CO-141	American sycamore	*Platanus occidentalis*	10	1	5	15	Fair	Many vines, reduced crown
CO-142	Boxelder	*Acer negundo*	15	1	7.5	22.5	Good	
CO-143	Silver maple	*Acer saccharinum*	16	1	N/A	N/A	Standing Dead	
CO-144	Green ash	*Fraxinus pennsylvanica*	13	1	N/A	N/A	Standing Dead	
CO-145	Boxelder	*Acer negundo*	6	1	3	9	Fair	Choked by vines
CO-146	Boxelder	*Acer negundo*	8	1	4	12	Fair	Choked by vines
CO-147	Silver maple	*Acer saccharinum*	7	1	N/A	N/A	Standing Dead	
CO-148	Pignut hickory	*Carya glabra*	7	1	3.5	10.5	Good	Minor vines
CO-149	Pignut hickory	*Carya glabra*	11	1	5.5	16.5	Good	
CO-150*	American sycamore	*Platanus occidentalis*	34	1	17	51	Good	
CO-151	Boxelder	*Acer negundo*	14	1	7	21	Poor	Broken trunk, leaning
CO-152	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Many vines in canopy
CO-153	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Water sprouting. Dead branches
CO-154	Eastern redcedar	*Juniperus virginiana*	8	1	4	12	Good	
CO-155	Green ash	*Fraxinus pennsylvanica*	13	1	N/A	N/A	Standing Dead	
CO-156	Boxelder	*Acer negundo*	23	1	11.5	34.5	Fair	Water sprouting. Included bark. Irregular crown.
CO-157	Common hackberry	*Celtis occidentalis*	5	1	2.5	7.5	Fair	Many vines in canopy
CO-158	American sycamore	*Platanus occidentalis*	28	1	14	42	Good	Slight lean
CO-159	Eastern redcedar	*Juniperus virginiana*	9	1	4.5	13.5	Fair	Few dead branches
CO-160	Green ash	*Fraxinus pennsylvanica*	5	1	N/A	N/A	Standing Dead	
CO-161	Boxelder	*Acer negundo*	7	1	3.5	10.5	Poor	Water sprouts. Trunk wound/cavity. Dead crown.
CO-162	Chestnut oak	*Quercus montana*	5	1	2.5	7.5	Fair	Dead leader
CO-163	Boxelder	*Acer negundo*	10	1	5	15	Fair	Water sprouting. Trunk wounds. Oozing
CO-164	Green ash	*Fraxinus pennsylvanica*	8	1	N/A	N/A	Standing Dead	
CO-165	Northern red oak	*Quercus rubra*	9	1	4.5	13.5	Good	
CO-166	Boxelder	*Acer negundo*	15	1	7.5	22.5	Poor	Major trunk wounds. Hole in tree. Dead canopy.
CO-167	Northern red oak	*Quercus rubra*	10	1	5	15	Fair	Dead leader
CO-168	Boxelder	*Acer negundo*	10	1	5	15	Fair	Water sprouts. Trunk wound/cavity
CO-169	Pignut hickory	*Carya glabra*	7	1	3.5	10.5	Good	
CO-170	Eastern redcedar	*Juniperus virginiana*	6	1	3	9	Fair	Many vines in canopy
CO-171	Pignut hickory	*Carya glabra*	12	1	6	18	Fair	Reduced canopy
CO-172	Pignut hickory	*Carya glabra*	10	1	5	15	Good	
CO-173	Green ash	*Fraxinus pennsylvanica*	28	1	N/A	N/A	Standing Dead	
CO-174	Boxelder	*Acer negundo*	15	1	7.5	22.5	Fair	Trunk decay. Trunk cavity. Good canopy growth
CO-175	Northern red oak	*Quercus rubra*	5	1	2.5	7.5	Poor	Stressed
CO-176	American elm	*Ulmus americana*	5	1	2.5	7.5	Good	
CO-177	Sugar maple	*Acer saccharum*	10	1	5	15	Good	
CO-178	Pignut hickory	*Carya glabra*	7	1	3.5	10.5	Good	
CO-179	Boxelder	*Acer negundo*	21	1	10.5	31.5	Fair	Slight lean. Trunk wounds.
CO-180	Boxelder	*Acer negundo*	6	1	N/A	N/A	Standing Dead	
CO-181	Pignut hickory	*Carya glabra*	7	1	3.5	10.5	Good	
CO-182*	American sycamore	*Platanus occidentalis*	55	1	27.5	82.5	Good	Minor trunk wounds. Minor vines
CO-183	Green ash	*Fraxinus pennsylvanica*	10	1	N/A	N/A	Standing Dead	
CO-184	American sycamore	*Platanus occidentalis*	5	1	2.5	7.5	Fair	Water sprouts. Bark wounds
CO-185	Pignut hickory	*Carya glabra*	8	1	4	12	Good	
CO-186	Sugar maple	*Acer saccharum*	8	1	4	12	Good	

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-187	Unknown		14	1	N/A	N/A	Standing Dead	
CO-188	Pignut hickory	*Carya glabra*	10	1	5	15	Good	
CO-189	Oak sp.	*Quercus sp.*	9	1	N/A	N/A	Standing Dead	
CO-190	Green ash	*Fraxinus pennsylvanica*	5	1	N/A	N/A	Standing Dead	
CO-191	Chestnut oak	*Quercus montana*	7	1	3.5	10.5	Fair	Few broken branches
CO-192	Sugar maple	*Acer saccharum*	9	1	4.5	13.5	Good	
CO-193	Green ash	*Fraxinus pennsylvanica*	11	1	5.5	16.5	Poor	Reduced canopy, dying
CO-194	American elm	*Ulmus americana*	6	1	3	9	Poor	Covered in vines
CO-195	Pignut hickory	*Carya glabra*	9	1	4.5	13.5	Good	
CO-196	American elm	*Ulmus americana*	6	1	3	9	Fair	Reduced canopy
CO-197	Green ash	*Fraxinus pennsylvanica*	5	1	N/A	N/A	Standing Dead	
CO-198	American elm	*Ulmus americana*	6	1	3	9	Fair	Broken branches
CO-199	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Good	
CO-200	Boxelder	*Acer negundo*	14	1	7	21	Fair	Irregular growth. Dead branches
CO-201	Black walnut	*Juglans nigra*	15	1	7.5	22.5	Good	
CO-202	Boxelder	*Acer negundo*	13	1	6.5	19.5	Fair	Slight lean. Vines
CO-203	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Good	
CO-204	American elm	*Ulmus americana*	7	1	3.5	10.5	Good	
CO-205	Sugar maple	*Acer saccharum*	6	1	3	9	Good	
CO-206	White oak	*Quercus alba*	7	1	3.5	10.5	Good	
CO-207	Sugar maple	*Acer saccharum*	9	1	4.5	13.5	Good	
CO-208*	American sycamore	*Platanus occidentalis*	32	1	16	48	Fair	Irregular growth. Dead lower limbs.
CO-209	Sugar maple	*Acer saccharum*	8	1	4	12	Fair	Trunk damage and dead branches
CO-210	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Slight lean. Dead branches
CO-211	American elm	*Ulmus americana*	9	1	N/A	N/A	Standing Dead	
CO-212*	American sycamore	*Platanus occidentalis*	43	1	21.5	64.5	Poor	Severe trunk decay. Hollow.
CO-213	Northern red oak	*Quercus rubra*	11	1	5.5	16.5	Good	
CO-214	Green ash	*Fraxinus pennsylvanica*	8	1	N/A	N/A	Standing Dead	
CO-215	Boxelder	*Acer negundo*	6	1	3	9	Fair	One dead leader. Included bark.
CO-216	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Few broken/dead branches
CO-217*	Boxelder	*Acer negundo*	38	1	19	57	Fair	Dead leader. Irregular growth
CO-218	Sugar maple	*Acer saccharum*	5	1	2.5	7.5	Fair	Vines, stressed
CO-219	Boxelder	*Acer negundo*	6	1	3	9	Fair	Slight lean. Dead branches
CO-220	Sugar maple	*Acer saccharum*	12	1	6	18	Good	
CO-221	Northern red oak	*Quercus rubra*	12	1	6	18	Fair	Few dead branches
CO-222	American elm	*Ulmus americana*	6	1	3	9	Good	Minor vines
CO-223	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Irregular growth. Water sprouting.
CO-224	Sugar maple	*Acer saccharum*	9	1	4.5	13.5	Good	
CO-225	Boxelder	*Acer negundo*	6	1	3	9	Poor	Undercut roots. Dead crown
CO-226	Pignut hickory	*Carya glabra*	13	1	6.5	19.5	Fair	Vines in canopy
CO-227	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Slight lean. Trunk wound
CO-228	Pignut hickory	*Carya glabra*	6	1	3	9	Fair	Few dead branches
CO-229	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Water sprouting.
CO-230	White oak	*Quercus alba*	19	1	N/A	N/A	Standing Dead	
CO-231	Boxelder	*Acer negundo*	6	1	3	9	Poor	Dead crown. Water sprouts
CO-232*	American sycamore	*Platanus occidentalis*	43	1	21.5	64.5	Good	Minor vines
CO-233	Boxelder	*Acer negundo*	12	1	6	18	Fair	Trunk wounds.
CO-234	Chestnut oak	*Quercus montana*	17	1	8.5	25.5	Fair	Stressed
CO-235	Bitternut hickory	*Carya cordiformis*	13	1	6.5	19.5	Good	Vines
CO-236	Green ash	*Fraxinus pennsylvanica*	8	1	N/A	N/A	Standing Dead	
CO-237	American elm	*Ulmus americana*	6	1	3	9	Fair	Vines in canopy
CO-238	Boxelder	*Acer negundo*	19	1	9.5	28.5	Fair	Leaning
CO-239	American elm	*Ulmus americana*	13	1	6.5	19.5	Good	
CO-240	Boxelder	*Acer negundo*	14	1	7	21	Fair	Vines. Water sprouts
CO-241	Pignut hickory	*Carya glabra*	9	1	4.5	13.5	Good	
CO-242	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Good	
CO-243	American elm	*Ulmus americana*	8	1	4	12	Good	
CO-244	Black walnut	*Juglans nigra*	17	1	8.5	25.5	Good	Minor dead lower limbs
CO-245	Sugar maple	*Acer saccharum*	9	1	4.5	13.5	Good	
CO-246	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Severe lean. Water sprouts
CO-247	Green ash	*Fraxinus pennsylvanica*	16	1	N/A	N/A	Standing Dead	
CO-248	Pignut hickory	*Carya glabra*	10	1	5	15	Fair	Few dead branches
CO-249	Pignut hickory	*Carya glabra*	5	1	2.5	7.5	Good	
CO-250	Boxelder	*Acer negundo*	12	1	6	18	Poor	Dead crown. Water sprouting. Trunk wounds.
CO-251	Green ash	*Fraxinus pennsylvanica*	22	1	N/A	N/A	Standing Dead	
CO-252*	Bitternut hickory	*Carya cordiformis*	34, 31	2	17	51	Fair	Twin trunk 34 x 31. One dead/broken leader.

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-253	Green ash	*Fraxinus pennsylvanica*	8	1	N/A	N/A	Standing Dead	
CO-254	Northern red oak	*Quercus rubra*	14	1	7	21	Fair	Few dead branches, stressed
CO-255	Sugar maple	*Acer saccharum*	8	1	4	12	Fair	Trunk damage
CO-256	Boxelder	*Acer negundo*	11	1	5.5	16.5	Poor	Dead crown. Major trunk wounds. Almost dead
CO-257	Green ash	*Fraxinus pennsylvanica*	10	1	N/A	N/A	Standing Dead	
CO-258	American elm	*Ulmus americana*	11	1	5.5	16.5	Fair	Vines and dead branches
CO-259	Bitternut hickory	*Carya cordiformis*	12	1	6	18	Good	
CO-260	Bitternut hickory	*Carya cordiformis*	7	1	3.5	10.5	Fair	Leaning
CO-261	Sugar maple	*Acer saccharum*	9	1	4.5	13.5	Good	
CO-262	Pignut hickory	*Carya glabra*	7	1	3.5	10.5	Good	
CO-263	Boxelder	*Acer negundo*	12	1	6	18	Good	
CO-264	Northern red oak	*Quercus rubra*	17	1	8.5	25.5	Fair	Dead branches, leaning
CO-265	Boxelder	*Acer negundo*	6	1	3	9	Poor	Trunk wounds. Water sprouting. Dead branching. Dead leader
CO-266	Boxelder	*Acer negundo*	14	1	7	21	Fair	Water sprouting. Vines
CO-267	American elm	*Ulmus americana*	6	1	3	9	Good	
CO-268	White oak	*Quercus alba*	7	1	3.5	10.5	Good	
CO-269	American basswood	*Tilia americana*	5	1	2.5	7.5	Good	
CO-270	American elm	*Ulmus americana*	6	1	3	9	Good	
CO-271	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Stressed
CO-272	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Water sprouts
CO-273	American elm	*Ulmus americana*	8	1	4	12	Good	
CO-274	Unknown		11	1	N/A	N/A	Standing Dead	Unknown species
CO-275	American elm	*Ulmus americana*	8	1	4	12	Good	
CO-276	American elm	*Ulmus americana*	6	1	3	9	Good	
CO-277	Boxelder	*Acer negundo*	14	1	7	21	Fair	Water sprouting. Irregular growth
CO-278	Green ash	*Fraxinus pennsylvanica*	8	1	N/A	N/A	Standing Dead	
CO-279	Green ash	*Fraxinus pennsylvanica*	11	1	N/A	N/A	Standing Dead	Two trunks, split above breast height
CO-280	Pignut hickory	*Carya glabra*	5	1	2.5	7.5	Fair	Vines
CO-281	Sugar maple	*Acer saccharum*	6	1	3	9	Fair	Reduced canopy
CO-282	American sycamore	*Platanus occidentalis*	6	1	3	9	Fair	Lean. Irregular crown
CO-283	Bitternut hickory	*Carya cordiformis*	9	1	4.5	13.5	Fair	Few dead branches
CO-284	Pignut hickory	*Carya glabra*	8	1	4	12	Good	Minor vines
CO-285	American elm	*Ulmus americana*	8	1	4	12	Fair	Vines in canopy
CO-286	American sycamore	*Platanus occidentalis*	10	1	5	15	Fair	Vines in canopy
CO-287	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Water sprouting. Irregular growth
CO-288	Boxelder	*Acer negundo*	7	1	N/A	N/A	Standing Dead	
CO-289	Black walnut	*Juglans nigra*	12	1	6	18	Good	Vines
CO-290	Green ash	*Fraxinus pennsylvanica*	8	1	N/A	N/A	Standing Dead	
CO-291	American elm	*Ulmus americana*	6	1	3	9	Good	
CO-292	Boxelder	*Acer negundo*	6	1	3	9	Fair	Water sprouting
CO-293	Green ash	*Fraxinus pennsylvanica*	14	1	N/A	N/A	Standing Dead	
CO-294	Green ash	*Fraxinus pennsylvanica*	11	1	N/A	N/A	Standing Dead	
CO-295	American elm	*Ulmus americana*	7	1	3.5	10.5	Good	
CO-296	Green ash	*Fraxinus pennsylvanica*	6	1	N/A	N/A	Standing Dead	
CO-297	Bitternut hickory	*Carya cordiformis*	8	1	4	12	Fair	With vines
CO-298	American elm	*Ulmus americana*	5	1	2.5	7.5	Fair	Stressed
CO-299	Boxelder	*Acer negundo*	15	1	7.5	22.5	Fair	Water sprouting. Irregular canopy
CO-300	Boxelder	*Acer negundo*	8	1	4	12	Fair	Lean. Irregular crown
CO-301	Chestnut oak	*Quercus montana*	6	1	3	9	Fair	Leaning, few dead branches
CO-302	Boxelder	*Acer negundo*	14	1	7	21	Fair	Trunk wounds. Water sprouting.
CO-303	Bitternut hickory	*Carya cordiformis*	7, 6	2	3.5	10.5	Fair	Twin trunk 7 x 6, vines in canopy
CO-304	American elm	*Ulmus americana*	12	1	6	18	Fair	Vines in canopy
CO-305	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Water sprouting. Slight lean
CO-306	American elm	*Ulmus americana*	9	1	4.5	13.5	Good	
CO-307	Bitternut hickory	*Carya cordiformis*	7, 6	2	3.5	10.5	Fair	Twin trunk 7 x 6, vines in canopy
CO-308	Green ash	*Fraxinus pennsylvanica*	11	1	N/A	N/A	Standing Dead	
CO-309	Green ash	*Fraxinus pennsylvanica*	14	1	N/A	N/A	Standing Dead	
CO-310	Boxelder	*Acer negundo*	10	1	5	15	Poor	Water sprouting. Trunk wounds
CO-311	American sycamore	*Platanus occidentalis*	13	1	6.5	19.5	Fair	Leaning, vines
CO-312*	Bitternut hickory	*Carya cordiformis*	39	1	19.5	58.5	Fair	Included bark. Vines.
CO-313	Sugar maple	*Acer saccharum*	5	1	2.5	7.5	Good	
CO-314	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Water sprouting
CO-315	Boxelder	*Acer negundo*	6	1	3	9	Poor	Dead crown
CO-316	Green ash	*Fraxinus pennsylvanica*	9	1	N/A	N/A	Standing Dead	
CO-317	Green ash	*Fraxinus pennsylvanica*	14	1	N/A	N/A	Standing Dead	Multiple trunks
CO-318	Boxelder	*Acer negundo*	15	1	7.5	22.5	Poor	Major trunk wounds.
CO-319	American elm	*Ulmus americana*	6	1	3	9	Poor	Extensive vines
CO-320	Boxelder	*Acer negundo*	6	1	N/A	N/A	Standing Dead	
CO-321	Green ash	*Fraxinus pennsylvanica*	13	1	N/A	N/A	Standing Dead	
CO-322	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Heavy lean. Irregular growth. Sparse crown
CO-323	Bitternut hickory	*Carya cordiformis*	10	1	5	15	Fair	Extensive vines
CO-324	American elm	*Ulmus americana*	13	1	6.5	19.5	Fair	Leaning, vines
CO-325	Boxelder	*Acer negundo*	8	1	4	12	Fair	Water sprouting
CO-326	Green ash	*Fraxinus pennsylvanica*	6	1	N/A	N/A	Standing Dead	
CO-327	Pignut hickory	*Carya glabra*	5	1	2.5	7.5	Fair	Vines in canopy
CO-328	Common hackberry	*Celtis occidentalis*	5	1	2.5	7.5	Good	
CO-329	White oak	*Quercus alba*	15	1	7.5	22.5	Fair	Vines in canopy
CO-330	Boxelder	*Acer negundo*	6	1	3	9	Poor	Water sprouting. Broken crown
CO-331	Bitternut hickory	*Carya cordiformis*	6	1	3	9	Good	
CO-332	Black walnut	*Juglans nigra*	13	1	6.5	19.5	Good	
CO-333	American elm	*Ulmus americana*	11	1	5.5	16.5	Good	
CO-334*	American sycamore	*Platanus occidentalis*	32	1	16	48	Good	
CO-335	Black walnut	*Juglans nigra*	7	1	3.5	10.5	Poor	Lean. Heavy vines.
CO-336	Bitternut hickory	*Carya cordiformis*	13	1	6.5	19.5	Good	Minor vines
CO-337	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Fair	Slight lean. Dead branches
CO-338	American elm	*Ulmus americana*	15	1	7.5	22.5	Poor	Possibly dead
CO-339	Green ash	*Fraxinus pennsylvanica*	6	1	3	9	Poor	Sparse canopy. Dead branches
CO-340	Boxelder	*Acer negundo*	7	1	3.5	10.5	Poor	Trunk rot, dead leader
CO-341	Boxelder	*Acer negundo*	7, 6	2	3.5	10.5	Fair	Fungus, trunk rot, twin trunk 7 x 6
CO-342	Green ash	*Fraxinus pennsylvanica*	6	1	N/A	N/A	Standing Dead	
CO-343	Boxelder	*Acer negundo*	10	1	5	15	Fair	Water sprouting. Dead branching
CO-344	American elm	*Ulmus americana*	6	1	3	9	Fair	Few broken branches
CO-345	Boxelder	*Acer negundo*	6	1	3	9	Poor	Leaning, extensive vines in canopy
CO-346	Tree of heaven	*Ailanthus altissima*	8	1	4	12	Good	
CO-347	Bitternut hickory	*Carya cordiformis*	7	1	3.5	10.5	Good	
CO-348	Boxelder	*Acer negundo*	6	1	3	9	Poor	Trunk wounds. Water sprouting.
CO-349	Bitternut hickory	*Carya cordiformis*	7	1	3.5	10.5	Fair	Dead branch
CO-350	American sycamore	*Platanus occidentalis*	10	1	5	15	Poor	Tree leaning on trunk, vines in canopy
CO-351	American sycamore	*Platanus occidentalis*	6	1	3	9	Poor	Overtopped by vines
CO-352	Green ash	*Fraxinus pennsylvanica*	7	1	N/A	N/A	Standing Dead	
CO-353	Bitternut hickory	*Carya cordiformis*	8	1	4	12	Fair	Leaning, vines
CO-354	American sycamore	*Platanus occidentalis*	20	1	10	30	Fair	Vines in canopy
CO-355	Common hackberry	*Celtis occidentalis*	17	1	8.5	25.5	Fair	Vines
CO-356	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Water sprouting. Dead branching
CO-357	Common hackberry	*Celtis occidentalis*	10	1	5	15	Good	
CO-358	Common hackberry	*Celtis occidentalis*	6	1	3	9	Fair	Leaning
CO-359	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Leaning
CO-360	American elm	*Ulmus americana*	11	1	5.5	16.5	Good	
CO-361	American elm	*Ulmus americana*	9	1	4.5	13.5	Good	
CO-362	Green ash	*Fraxinus pennsylvanica*	7	1	N/A	N/A	Standing Dead	
CO-363	Eastern redcedar	*Juniperus virginiana*	8	1	4	12	Poor	Extensive vines
CO-364	Green ash	*Fraxinus pennsylvanica*	6	1	3	9	Poor	Leaning, dying
CO-365	Green ash	*Fraxinus pennsylvanica*	5	1	N/A	N/A	Standing Dead	
CO-366	American basswood	*Tilia americana*	11	1	5.5	16.5	Good	
CO-367	American elm	*Ulmus americana*	6	1	3	9	Good	
CO-368	Bitternut hickory	*Carya cordiformis*	15	1	7.5	22.5	Good	
CO-369	American elm	*Ulmus americana*	10	1	5	15	Fair	Many vines
CO-370	Bitternut hickory	*Carya cordiformis*	13	1	6.5	19.5	Good	
CO-371	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Leaning
CO-372	Bitternut hickory	*Carya cordiformis*	12	1	6	18	Good	
CO-373	Red maple	*Acer rubrum*	16	1	N/A	N/A	Standing Dead	
CO-374	Bitternut hickory	*Carya cordiformis*	13	1	6.5	19.5	Good	
CO-375	American sycamore	*Platanus occidentalis*	6	1	3	9	Fair	Vines into canopy
CO-376	Northern red oak	*Quercus rubra*	10	1	5	15	Fair	Many vines
CO-377	Pawpaw	*Asimina triloba*	6	1	3	9	Fair	Slight lean
CO-378	Common hackberry	*Celtis occidentalis*	12	1	6	18	Good	Vines
CO-379	American elm	*Ulmus americana*	9, 9	2	4.5	13.5	Good	Vines, twin trunk 9 x 9
CO-380	Bitternut hickory	*Carya cordiformis*	15	1	7.5	22.5	Good	Vines
CO-381	Northern red oak	*Quercus rubra*	14	1	7	21	Fair	Several dead branches

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-382	Northern red oak	*Quercus rubra*	15	1	7.5	22.5	Fair	Vines and dead branches
CO-383	Bitternut hickory	*Carya cordiformis*	5	1	2.5	7.5	Fair	Leaning, vines
CO-384	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Poor	Vines into canopy. Overtopped with vines
CO-385	Sugar maple	*Acer saccharum*	6	1	3	9	Good	
CO-386	Boxelder	*Acer negundo*	18	1	9	27	Poor	Trunk rot, leaning
CO-387	Green ash	*Fraxinus pennsylvanica*	13	1	N/A	N/A	Standing Dead	
CO-388	American elm	*Ulmus americana*	5	1	2.5	7.5	Fair	Dead branches and vines
CO-389*	American sycamore	*Platanus occidentalis*	30	1	15	45	Fair	Heavy vines. Minor bark wounds.
CO-390	Bitternut hickory	*Carya cordiformis*	10	1	5	15	Good	
CO-391	Sugar maple	*Acer saccharum*	10, 8	2	5	15	Good	Twin trunk 10 x 8, minor vines
CO-392	Boxelder	*Acer negundo*	10	1	5	15	Fair	Leaning
CO-393	Tuliptree	*Liriodendron tulipifera*	5	1	2.5	7.5	Poor	Vines into canopy. Overtopped with vines
CO-394*	Boxelder	*Acer negundo*	30	1	15	45	Poor	Trunk rot
CO-395	Boxelder	*Acer negundo*	10	1	5	15	Fair	Lean. Broken branches.
CO-396	Boxelder	*Acer negundo*	6	1	3	9	Fair	Water sprouting.
CO-397	American elm	*Ulmus americana*	9	1	4.5	13.5	Good	
CO-398	Common hackberry	*Celtis occidentalis*	6	1	3	9	Fair	Dead leader
CO-399	Bitternut hickory	*Carya cordiformis*	9	1	4.5	13.5	Good	
CO-400	American basswood	*Tilia americana*	12, 6, 4	3	6	18	Fair	Stressed, multistem trunk 12 x 6 x 4
CO-401	American elm	*Ulmus americana*	5	1	2.5	7.5	Good	
CO-402	Boxelder	*Acer negundo*	16	1	8	24	Fair	Vines into crown. Lean. Broker branches.
CO-403	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Extensive vines
CO-404	Bitternut hickory	*Carya cordiformis*	16	1	8	24	Good	
CO-405	American sycamore	*Platanus occidentalis*	7	1	3.5	10.5	Good	
CO-406	American hornbeam	*Carpinus caroliniana*	7	1	3.5	10.5	Poor	Uprooted. Almost dead
CO-407	American elm	*Ulmus americana*	8	1	4	12	Fair	Vines
CO-408	Boxelder	*Acer negundo*	7	1	3.5	10.5	Poor	Leaning, dead leader
CO-409	American elm	*Ulmus americana*	11	1	5.5	16.5	Fair	Many vines in canopy
CO-410	Sugar maple	*Acer saccharum*	8	1	4	12	Good	
CO-411	Boxelder	*Acer negundo*	6, 5	2	3	9	Fair	Twin trunk 6 x 5. Water sprouting.
CO-412	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Water sprouting.
CO-413	American basswood	*Tilia americana*	9	1	4.5	13.5	Good	
CO-414	American elm	*Ulmus americana*	8	1	4	12	Fair	Vines in canopy
CO-415	Boxelder	*Acer negundo*	10	1	5	15	Poor	Dead crown. Poor growth
CO-416	Green ash	*Fraxinus pennsylvanica*	6	1	N/A	N/A	Standing Dead	
CO-417	Siberian elm	*Ulmus pumila*	6	1	3	9	Fair	Water sprouts, dead branches
CO-418	Green ash	*Fraxinus pennsylvanica*	8	1	4	12	Poor	Almost dead
CO-419	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Few dead branches
CO-420	Black locust	*Robinia pseudoacacia*	9	1	4.5	13.5	Fair	Dead branches, vines
CO-421*	Northern red oak	*Quercus rubra*	33	1	16.5	49.5	Fair	Leaning, trunk rot at base
CO-422	Green ash	*Fraxinus pennsylvanica*	8	1	N/A	N/A	Standing Dead	
CO-423	Pignut hickory	*Carya glabra*	13	1	6.5	19.5	Good	
CO-424	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Vines and dead branches
CO-425	Boxelder	*Acer negundo*	5	1	N/A	N/A	Standing Dead	
CO-426	Boxelder	*Acer negundo*	12	1	6	18	Poor	Dead crown.
CO-427	Bitternut hickory	*Carya cordiformis*	10	1	5	15	Good	
CO-428	Black cherry	*Prunus serotina*	9	1	4.5	13.5	Poor	Almost dead
CO-429	American hornbeam	*Carpinus caroliniana*	6	1	3	9	Poor	Irregular growth. Water sprouting. Damaged crown
CO-430	Black locust	*Robinia pseudoacacia*	5	1	2.5	7.5	Poor	Broken leader
CO-431	American elm	*Ulmus americana*	10	1	5	15	Fair	Vines in canopy
CO-432	American basswood	*Tilia americana*	5	1	2.5	7.5	Fair	Trunk rot
CO-433	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Water sprouts, dead branches
CO-434	Common hackberry	*Celtis occidentalis*	23	1	11.5	34.5	Fair	Vines
CO-435	Green ash	*Fraxinus pennsylvanica*	5	1	N/A	N/A	Standing Dead	
CO-436	Boxelder	*Acer negundo*	12	1	6	18	Fair	Water sprouting.
CO-437	Bitternut hickory	*Carya cordiformis*	10, 9	2	5	15	Fair	Twin trunk 10 x 9. Vines into canopy
CO-438	American elm	*Ulmus americana*	6	1	N/A	N/A	Standing Dead	
CO-439	American elm	*Ulmus americana*	8	1	4	12	Poor	Water sprouts. Irregular leaves.
CO-440	American elm	*Ulmus americana*	11	1	5.5	16.5	Poor	Many vines in canopy, leaning
CO-441	American elm	*Ulmus americana*	21	1	10.5	31.5	Fair	Fused trunks. Included bark. Spots on leaves.
CO-442	Black locust	*Robinia pseudoacacia*	11	1	5.5	16.5	Fair	Vines
CO-443	Green ash	*Fraxinus pennsylvanica*	14	1	N/A	N/A	Standing Dead	
CO-444	Boxelder	*Acer negundo*	14	1	7	21	Fair	Dead wood. Water sprouts
CO-445	American sycamore	*Platanus occidentalis*	11	1	5.5	16.5	Good	
CO-446	Black walnut	*Juglans nigra*	10	1	5	15	Poor	Lean. Irregular crown
CO-447	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Dead branches
CO-448	American sycamore	*Platanus occidentalis*	28	1	14	42	Good	Minor vines
CO-449	American elm	*Ulmus americana*	11	1	5.5	16.5	Fair	Vines in canopy
CO-450	American elm	*Ulmus americana*	6	1	3	9	Fair	Broken branches
CO-451	Black walnut	*Juglans nigra*	13	1	6.5	19.5	Fair	Vines in canopy
CO-452	Black walnut	*Juglans nigra*	17	1	8.5	25.5	Fair	Heavy vines
CO-453	Green ash	*Fraxinus pennsylvanica*	9	1	N/A	N/A	Standing Dead	
CO-454	Bitternut hickory	*Carya cordiformis*	11, 9, 7	3	5.5	16.5	Fair	Vines, multistem trunk 11 x 9 x 7
CO-455	Northern red oak	*Quercus rubra*	21	1	10.5	31.5	Fair	Trunk rot at base
CO-456	American elm	*Ulmus americana*	20	1	10	30	Poor	Big tree leaning on tree. Exposed roots. Severe lean
CO-457	Boxelder	*Acer negundo*	10	1	5	15	Fair	Water sprouts. Dead wood
CO-458	American elm	*Ulmus americana*	5	1	2.5	7.5	Fair	Irregular crown
CO-459	Bitternut hickory	*Carya cordiformis*	12	1	6	18	Fair	Vines
CO-460	Bitternut hickory	*Carya cordiformis*	13	1	6.5	19.5	Fair	Vines and trunk rot
CO-461	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Fair	Vines in canopy
CO-462	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Vines in canopy
CO-463	Boxelder	*Acer negundo*	13, 11	2	6.5	19.5	Fair	Many vines, twin trunk 13 x 11
CO-464	Black locust	*Robinia pseudoacacia*	12	1	6	18	Fair	Vines in canopy
CO-465	Siberian elm	*Ulmus pumila*	9	1	4.5	13.5	Fair	Dead wood
CO-466	Black locust	*Robinia pseudoacacia*	28	1	14	42	Poor	Extensive vines, reduced canopy
CO-467	American elm	*Ulmus americana*	15	1	7.5	22.5	Poor	Dead leader. Sparse growth
CO-468	Boxelder	*Acer negundo*	6	1	3	9	Fair	Vines, dead branches
CO-469	Common hackberry	*Celtis occidentalis*	7	1	3.5	10.5	Good	
CO-470	American elm	*Ulmus americana*	11	1	5.5	16.5	Poor	Heavy vines into canopy. Lean
CO-471	Bitternut hickory	*Carya cordiformis*	12	1	6	18	Fair	Many vines in canopy
CO-472	Boxelder	*Acer negundo*	14	1	7	21	Fair	Vines, dead branches
CO-473	Boxelder	*Acer negundo*	8	1	4	12	Poor	Trunk rot, dying, leaning
CO-474	Boxelder	*Acer negundo*	12	1	6	18	Fair	Leaning, dead branches
CO-475	Black walnut	*Juglans nigra*	14	1	7	21	Poor	Heavy vines into canopy. Lean
CO-476	American elm	*Ulmus americana*	20	1	10	30	Fair	Thin crown. Dead wood
CO-477	Ash sp.	*Fraxinus sp.*	7, 6	2	N/A	N/A	Standing Dead	Twin 7 x 6. Dead
CO-478	Boxelder	*Acer negundo*	5	1	2.5	7.5	Good	Some water sprout
CO-479	Tree of heaven	*Ailanthus altissima*	7	1	3.5	10.5	Poor	Crown dead. Leaning out from under the bridge
CO-480	Green ash	*Fraxinus pennsylvanica*	22	1	N/A	N/A	Standing Dead	
CO-481	Black walnut	*Juglans nigra*	24	1	12	36	Fair	Lots of vines
CO-482	American sycamore	*Platanus occidentalis*	13	1	6.5	19.5	Poor	Undercut roots, strong lean
CO-483	American elm	*Ulmus americana*	6	1	3	9	Fair	Undercut roots
CO-484	Boxelder	*Acer negundo*	10	1	5	15	Poor	Dead crown. Uprooted
CO-485	American elm	*Ulmus americana*	11	1	5.5	16.5	Poor	Thin crown. Dead leader. Water sprouting
CO-486	Boxelder	*Acer negundo*	6	1	3	9	Poor	dead branches, water sprouts, dead canopy
CO-487	American elm	*Ulmus americana*	17	1	8.5	25.5	Fair	Vines in canopy
CO-488	Bitternut hickory	*Carya cordiformis*	8	1	4	12	Poor	Leaning, dead leader
CO-489	Boxelder	*Acer negundo*	9	1	N/A	N/A	Standing Dead	
CO-490	American elm	*Ulmus americana*	5	1	2.5	7.5	Poor	Dead branches. Dead leaves
CO-491	Unknown		18	1	N/A	N/A	Standing Dead	
CO-492	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Few dead branches, water sprouts, irregular canopy
CO-493	Boxelder	*Acer negundo*	5	1	2.5	7.5	Good	
CO-494	American sycamore	*Platanus occidentalis*	18	1	9	27	Poor	Fallen
CO-495	American elm	*Ulmus americana*	5	1	2.5	7.5	Fair	Few dead branches
CO-496	American elm	*Ulmus americana*	14	1	7	21	Fair	Thin canopy
CO-497	American hornbeam	*Carpinus caroliniana*	5	1	2.5	7.5	Good	
CO-498	American elm	*Ulmus americana*	11	1	5.5	16.5	Fair	Few dead branches
CO-499	Boxelder	*Acer negundo*	8	1	4	12	Poor	Severe lean. Dead wood
CO-500	American elm	*Ulmus americana*	8	1	4	12	Fair	Leaf spotting
CO-501	Boxelder	*Acer negundo*	6	1	3	9	Fair	Water sprouts, dead branch
CO-502	American sycamore	*Platanus occidentalis*	12	1	6	18	Good	Lean
CO-503	American sycamore	*Platanus occidentalis*	10	1	5	15	Good	
CO-504	Green ash	*Fraxinus pennsylvanica*	14	1	N/A	N/A	Standing Dead	
CO-505	American hornbeam	*Carpinus caroliniana*	5	1	2.5	7.5	Fair	Few dead branches
CO-506	Green ash	*Fraxinus pennsylvanica*	18	1	N/A	N/A	Standing Dead	
CO-507	Boxelder	*Acer negundo*	8	1	4	12	Fair	Water sprouting
CO-508	Boxelder	*Acer negundo*	10	1	5	15	Poor	Large trunk wound, dead crown
CO-509	American elm	*Ulmus americana*	15	1	7.5	22.5	Good	Leaf spots
CO-510	American sycamore	*Platanus occidentalis*	9	1	4.5	13.5	Good	
CO-511	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Dead branches

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-512	Boxelder	*Acer negundo*	8	1	4	12	Good	
CO-513	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Fair	Vines and trunk damage
CO-514	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Vines
CO-515	Boxelder	*Acer negundo*	15	1	7.5	22.5	Good	
CO-516	American elm	*Ulmus americana*	15	1	7.5	22.5	Fair	Some trunk rot
CO-517	Boxelder	*Acer negundo*	13	1	6.5	19.5	Fair	Vines in canopy
CO-518	American sycamore	*Platanus occidentalis*	17	1	8.5	25.5	Good	
CO-519	American sycamore	*Platanus occidentalis*	11	1	5.5	16.5	Good	Bend in trunk, Irregular growth
CO-520	Boxelder	*Acer negundo*	21	1	10.5	31.5	Poor	Leaning, dead leader, fungus
CO-521	Boxelder	*Acer negundo*	6	1	3	9	Fair	Dead branches
CO-522	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Dead branches
CO-523	Boxelder	*Acer negundo*	12	1	6	18	Good	
CO-524	American sycamore	*Platanus occidentalis*	21	1	10.5	31.5	Fair	Lean, water sprouts
CO-525	Black locust	*Robinia pseudoacacia*	8	1	N/A	N/A	Standing Dead	
CO-526	American sycamore	*Platanus occidentalis*	6	1	3	9	Poor	Extensive vines, dying leader
CO-527	American elm	*Ulmus americana*	15	1	7.5	22.5	Fair	Vines in canopy
CO-528	Boxelder	*Acer negundo*	8	1	4	12	Fair	Dead branches
CO-529	Black walnut	*Juglans nigra*	8	1	4	12	Good	
CO-530	American sycamore	*Platanus occidentalis*	11	1	5.5	16.5	Good	
CO-531	Unknown		7	1	N/A	N/A	Standing Dead	Enclosed by vines
CO-532	American sycamore	*Platanus occidentalis*	24, 6	2	12	36	Poor	Twins 24 x 6, dead leader. Decaying bark.
CO-533	American sycamore	*Platanus occidentalis*	20	1	N/A	N/A	Standing Dead	Dead
CO-534	Black walnut	*Juglans nigra*	15	1	7.5	22.5	Fair	Leaning, undermined
CO-535*	American sycamore	*Platanus occidentalis*	37	1	18.5	55.5	Fair	Vines in canopy
CO-536	American sycamore	*Platanus occidentalis*	25	1	N/A	N/A	Standing Dead	Dead
CO-537	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Vines
CO-538	Boxelder	*Acer negundo*	17	1	8.5	25.5	Good	Vines
CO-539	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Vines in canopy
CO-540	Boxelder	*Acer negundo*	7	1	3.5	10.5	Good	Leaning
CO-541	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Lean, one sided
CO-542	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Leaning, vines
CO-543	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Vines, broken branches
CO-544	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Vines in canopy
CO-545	American sycamore	*Platanus occidentalis*	28	1	14	42	Good	With vines
CO-546	American elm	*Ulmus americana*	19	1	9.5	28.5	Good	
CO-547	Boxelder	*Acer negundo*	12	1	6	18	Fair	Leaning
CO-548	Boxelder	*Acer negundo*	10	1	5	15	Good	Leaning
CO-549	Green ash	*Fraxinus pennsylvanica*	14	1	N/A	N/A	Standing Dead	
CO-550	American elm	*Ulmus americana*	11	1	5.5	16.5	Poor	Broken leader
CO-551	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Dead wood
CO-552	Boxelder	*Acer negundo*	9	1	4.5	13.5	Poor	Broken leader, significant lean
CO-553	American sycamore	*Platanus occidentalis*	6, 5	2	3	9	Good	Lean, undercut roots. Twin trunks 6 x 5
CO-554	American elm	*Ulmus americana*	14	1	7	21	Fair	On steep slope, high vines on trunk
CO-555	American sycamore	*Platanus occidentalis*	28	1	14	42	Good	Minor vines
CO-556	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	With vines
CO-557	Green ash	*Fraxinus pennsylvanica*	10	1	N/A	N/A	Standing Dead	
CO-558	Green ash	*Fraxinus pennsylvanica*	12	1	N/A	N/A	Standing Dead	
CO-559	Boxelder	*Acer negundo*	10	1	5	15	Good	
CO-560	Black locust	*Robinia pseudoacacia*	17, 17	2	N/A	N/A	Poor	Dead twin trunk, thin canopy, on steep slope
CO-561*	Silver maple	*Acer saccharinum*	31	1	15.5	46.5	Fair	Many vines
CO-562	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Leaning, vines, trunk rot
CO-563	Boxelder	*Acer negundo*	5	1	2.5	7.5	Good	
CO-564	Black locust	*Robinia pseudoacacia*	6	1	N/A	N/A	Standing Dead	
CO-565	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Broken branches
CO-566	American sycamore	*Platanus occidentalis*	28	1	14	42	Good	Leaning, minor vines
CO-567	Silver maple	*Acer saccharinum*	24	1	12	36	Fair	Many vines
CO-568	Black locust	*Robinia pseudoacacia*	10	1	N/A	N/A	Standing Dead	
CO-569	Black locust	*Robinia pseudoacacia*	14, 9	2	7	21	Fair	Twin trunk 14 x 9, with vines
CO-570	Boxelder	*Acer negundo*	6	1	3	9	Fair	Leaning, stressed
CO-571	American elm	*Ulmus americana*	6	1	3	9	Fair	Leaning
CO-572	Black locust	*Robinia pseudoacacia*	12	1	N/A	N/A	Standing Dead	
CO-573	American sycamore	*Platanus occidentalis*	28, 26	2	14	42	Good	Vines, twin trunk 28 x 26
CO-574	Boxelder	*Acer negundo*	20	1	10	30	Fair	Vines on trunk, lean
CO-575	Green ash	*Fraxinus pennsylvanica*	11	1	5.5	16.5	Fair	Vines, dead branches
CO-576	American elm	*Ulmus americana*	6	1	3	9	Fair	With vines
CO-577	Black walnut	*Juglans nigra*	10	1	5	15	Fair	Vines on trunk, on steep slope
CO-578	Black locust	*Robinia pseudoacacia*	11, 10	2	5.5	16.5	Fair	Reduced canopy, twin trunk 11 x 10
CO-579	Unknown		5	1	N/A	N/A	Standing Dead	
CO-580*	American sycamore	*Platanus occidentalis*	33	1	16.5	49.5	Good	
CO-581*	Green ash	*Fraxinus pennsylvanica*	33	1	N/A	N/A	Standing Dead	
CO-582	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Fair	Heavy vines on trunk
CO-583	American elm	*Ulmus americana*	5	1	2.5	7.5	Fair	Broken branches. On steep slope
CO-584	Silver maple	*Acer saccharinum*	26	1	13	39	Fair	Trunk damage, vines
CO-585	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Dead leader
CO-586	American elm	*Ulmus americana*	17	1	8.5	25.5	Good	
CO-587	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Vines in canopy
CO-588	Black locust	*Robinia pseudoacacia*	7	1	N/A	N/A	Standing Dead	
CO-589	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Fair	Heavy vines on trunk
CO-590	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Fair	Trunk damage
CO-591	Boxelder	*Acer negundo*	8	1	4	12	Fair	Lean, water sprouts.
CO-592	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	
CO-593	American sycamore	*Platanus occidentalis*	8	1	4	12	Fair	Vines in canopy
CO-594	Black locust	*Robinia pseudoacacia*	11	1	N/A	N/A	Standing Dead	
CO-595	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Good	
CO-596	Boxelder	*Acer negundo*	7	1	3.5	10.5	Good	
CO-597	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Vines in canopy
CO-598	Boxelder	*Acer negundo*	10	1	5	15	Good	
CO-599	Boxelder	*Acer negundo*	6	1	3	9	Good	
CO-600	Boxelder	*Acer negundo*	8	1	N/A	N/A	Standing Dead	
CO-601	Boxelder	*Acer negundo*	24	1	12	36	Good	Vines
CO-602	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Heavy vines on trunk, one sided
CO-603*	American sycamore	*Platanus occidentalis*	34	1	17	51	Good	Vines
CO-604	American elm	*Ulmus americana*	5	1	2.5	7.5	Good	
CO-605	Boxelder	*Acer negundo*	16	1	8	24	Fair	Trunk damage
CO-606	American elm	*Ulmus americana*	5	1	2.5	7.5	Fair	Dead branches
CO-607	American sycamore	*Platanus occidentalis*	22	1	11	33	Fair	Vines in canopy
CO-608	Black locust	*Robinia pseudoacacia*	11, 9	2	5.5	16.5	Fair	Twin trunk 11 x 9, with vines
CO-609	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Fair	Irregular growth form
CO-610	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Trunk rot
CO-611	Black locust	*Robinia pseudoacacia*	7	1	N/A	N/A	Standing Dead	
CO-612	American sycamore	*Platanus occidentalis*	21	1	10.5	31.5	Good	Slight trunk wound.
CO-613	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Fair	Heavy vines on trunk
CO-614	Boxelder	*Acer negundo*	16	1	8	24	Poor	On steep slope, heavy vines, water sprouts
CO-615	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	On steep slope, water sprouts
CO-616	American elm	*Ulmus americana*	9	1	4.5	13.5	Good	
CO-617	Unknown		13	1	N/A	N/A	Standing Dead	
CO-618	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Poor	Broken leader, heavy vines
CO-619	American sycamore	*Platanus occidentalis*	25	1	12.5	37.5	Good	Vines
CO-620	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Fair	Interfering with adjacent tree, vines
CO-621	Boxelder	*Acer negundo*	11	1	5.5	16.5	Good	
CO-622	Black walnut	*Juglans nigra*	13	1	6.5	19.5	Good	
CO-623	Boxelder	*Acer negundo*	8	1	4	12	Good	
CO-624	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Broken leader, vines
CO-625	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Water sprouts, dead branches
CO-626	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Lean, broken branches, water sprouts
CO-627	Boxelder	*Acer negundo*	7	1	3.5	10.5	Good	
CO-628*	Tuliptree	*Liriodendron tulipifera*	30	1	15	45	Fair	Lean, broken branches
CO-629	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Water sprouts, lean
CO-630	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	Some vines on trunk
CO-631	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Water sprouts, broken branches
CO-632	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	
CO-633*	American sycamore	*Platanus occidentalis*	35	1	17.5	52.5	Good	Vines
CO-634	American elm	*Ulmus americana*	12	1	N/A	N/A	Standing Dead	
CO-635	Boxelder	*Acer negundo*	6	1	3	9	Fair	Many vines
CO-636	American elm	*Ulmus americana*	5	1	2.5	7.5	Fair	Dead branches
CO-637	Black locust	*Robinia pseudoacacia*	14	1	7	21	Poor	Dying crown, heavy vines
CO-638	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Fair	Vines in canopy
CO-639	Boxelder	*Acer negundo*	8	1	4	12	Good	
CO-640	Common hackberry	*Celtis occidentalis*	7	1	3.5	10.5	Good	
CO-641	Common hackberry	*Celtis occidentalis*	15	1	7.5	22.5	Fair	Trunk damage, vines
CO-642	American elm	*Ulmus americana*	6	1	3	9	Poor	Broken leader, diseased foliage
CO-643	Tuliptree	*Liriodendron tulipifera*	11	1	N/A	N/A	Standing Dead	
CO-644	Boxelder	*Acer negundo*	17	1	8.5	25.5	Poor	Large trunk wound at top
CO-645	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	
CO-646	Boxelder	*Acer negundo*	10	1	5	15	Fair	Water sprouts, lean

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-647	American elm	*Ulmus americana*	7	1	3.5	10.5	Poor	Broken leader, undercut roots
CO-648	Boxelder	*Acer negundo*	13	1	6.5	19.5	Poor	Vines on trunk, lean, dead crown
CO-649	Boxelder	*Acer negundo*	10	1	5	15	Fair	Water sprouts, broken branches
CO-650	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Poor	Many dead branches
CO-651	Green ash	*Fraxinus pennsylvanica*	5	1	N/A	N/A	Standing Dead	
CO-652	Green ash	*Fraxinus pennsylvanica*	5	1	2.5	7.5	Fair	Vines cutting into trunk
CO-653	American elm	*Ulmus americana*	6	1	3	9	Poor	Many dead branches
CO-654	Black locust	*Robinia pseudoacacia*	10	1	5	15	Fair	Many vines
CO-655	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Poor	Vines, reduced canopy
CO-656	Green ash	*Fraxinus pennsylvanica*	26	1	N/A	N/A	Standing Dead	
CO-657	Black locust	*Robinia pseudoacacia*	11	1	5.5	16.5	Fair	Leaning, vines
CO-658	Boxelder	*Acer negundo*	6	1	3	9	Good	With vines
CO-659	Green ash	*Fraxinus pennsylvanica*	12	1	N/A	N/A	Standing Dead	
CO-660	American elm	*Ulmus americana*	6	1	3	9	Fair	Few broken branches
CO-661	Tuliptree	*Liriodendron tulipifera*	28	1	14	42	Good	
CO-662	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Water sprouts, broken branches, trunk wound
CO-663	Boxelder	*Acer negundo*	16	1	8	24	Good	
CO-664	Boxelder	*Acer negundo*	10	1	5	15	Fair	Water sprouts, lean, dead branch
CO-665	Black locust	*Robinia pseudoacacia*	11	1	5.5	16.5	Fair	On slope, vines on trunk
CO-666	Green ash	*Fraxinus pennsylvanica*	6	1	N/A	N/A	Standing Dead	
CO-667	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Water sprouts, dead wood
CO-668	Black walnut	*Juglans nigra*	8	1	4	12	Good	
CO-669	American elm	*Ulmus americana*	9	1	4.5	13.5	Poor	Irregular growth form, heavy vines, steep slope
CO-670	American elm	*Ulmus americana*	6	1	3	9	Poor	Dying crown
CO-671	Bitternut hickory	*Carya cordiformis*	8	1	4	12	Fair	Vines on trunk, spots on foliage
CO-672	Boxelder	*Acer negundo*	20	1	10	30	Fair	
CO-673	Black walnut	*Juglans nigra*	13	1	6.5	19.5	Good	Slight lean
CO-674	Boxelder	*Acer negundo*	17	1	8.5	25.5	Poor	Irregular growth form, heavy vines, steep slope
CO-675	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Fair	Vines
CO-676	Boxelder	*Acer negundo*	8	1	N/A	N/A	Standing Dead	
CO-677	Boxelder	*Acer negundo*	15	1	7.5	22.5	Fair	Slight lean, trunk wound
CO-678	Tuliptree	*Liriodendron tulipifera*	19	1	N/A	N/A	Standing Dead	
CO-679	Common hackberry	*Celtis occidentalis*	13	1	6.5	19.5	Fair	Heavy vines, dead branches
CO-680	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Fair	Vines in canopy
CO-681	Boxelder	*Acer negundo*	6	1	3	9	Poor	Overtopped by vines, dead leader
CO-682	Black locust	*Robinia pseudoacacia*	10	1	5	15	Poor	Broken leader, split trunk
CO-683	White oak	*Quercus alba*	10	1	5	15	Good	Slight lean
CO-684	Common hackberry	*Celtis occidentalis*	19	1	9.5	28.5	Fair	Interfering crown
CO-685	Common hackberry	*Celtis occidentalis*	5	1	2.5	7.5	Fair	Irregular trunk
CO-686	Bitternut hickory	*Carya cordiformis*	11	1	5.5	16.5	Good	Splits above DBH
CO-687	Common hackberry	*Celtis occidentalis*	10	1	5	15	Fair	Trunk rot
CO-688	American elm	*Ulmus americana*	15	1	7.5	22.5	Fair	Thin canopy, scorched leaves
CO-689	American elm	*Ulmus americana*	8	1	4	12	Fair	Dead branches
CO-690	Common hackberry	*Celtis occidentalis*	15	1	7.5	22.5	Good	
CO-691*	Common hackberry	*Celtis occidentalis*	30	1	15	45	Good	Minor trunk rot
CO-692	Common hackberry	*Celtis occidentalis*	8	1	4	12	Good	A little one sided
CO-693	Common hackberry	*Celtis occidentalis*	17	1	8.5	25.5	Good	Vines
CO-694	Tuliptree	*Liriodendron tulipifera*	10	1	N/A	N/A	Standing Dead	
CO-695	Northern red oak	*Quercus rubra*	12	1	6	18	Excellent	
CO-696	Bitternut hickory	*Carya cordiformis*	10	1	5	15	Fair	Heavy vines
CO-697*	Black oak	*Quercus velutina*	40	1	20	60	Good	
CO-698	Mockernut hickory	*Carya tomentosa*	15	1	7.5	22.5	Good	
CO-699*	American sycamore	*Platanus occidentalis*	30	1	15	45	Good	
CO-700	American hornbeam	*Carpinus caroliniana*	5	1	2.5	7.5	Poor	Dead leader, trunk decay
CO-701	Mockernut hickory	*Carya tomentosa*	7	1	3.5	10.5	Excellent	
CO-702	American beech	*Fagus grandifolia*	6	1	3	9	Fair	Heavy lean
CO-703	Green ash	*Fraxinus pennsylvanica*	25	1	N/A	N/A	Standing Dead	
CO-704	Bitternut hickory	*Carya cordiformis*	16	1	8	24	Fair	Stressed
CO-705	Bitternut hickory	*Carya cordiformis*	24	1	12	36	Fair	Vines in canopy
CO-706	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Poor	Reduced canopy, vines
CO-707	Boxelder	*Acer negundo*	9	1	N/A	N/A	Standing Dead	
CO-708	Boxelder	*Acer negundo*	6	1	3	9	Poor	Dying leader, heavy lean
CO-709	Unknown		10	1	N/A	N/A	Standing Dead	
CO-710	American beech	*Fagus grandifolia*	13	1	6.5	19.5	Good	
CO-711	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Good	
CO-712	Common hackberry	*Celtis occidentalis*	7	1	3.5	10.5	Good	Minor lean
CO-713	Boxelder	*Acer negundo*	14	1	7	21	Poor	Dying leader, peeling bark
CO-714	Common hackberry	*Celtis occidentalis*	29	1	14.5	43.5	Fair	Heavy vines
CO-715	Bitternut hickory	*Carya cordiformis*	13	1	6.5	19.5	Good	
CO-716	Boxelder	*Acer negundo*	6	1	3	9	Fair	Leaning, vines
CO-717	Unknown		25	1	N/A	N/A	Standing Dead	
CO-718*	Black walnut	*Juglans nigra*	31	1	15.5	46.5	Good	
CO-719	American elm	*Ulmus americana*	10, 7	2	5	15	Fair	Some vines, on steep slope. Twin trunks 10 x 7
CO-720	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Fair	Vines in canopy
CO-721	Blackgum	*Nyssa sylvatica*	5	1	2.5	7.5	Good	Minor vines
CO-722	Blackgum	*Nyssa sylvatica*	12	1	6	18	Fair	Heavy vines
CO-723	Boxelder	*Acer negundo*	12	1	N/A	N/A	Standing Dead	
CO-724	American elm	*Ulmus americana*	6	1	3	9	Fair	Irregular crown
CO-725	Boxelder	*Acer negundo*	12	1	6	18	Poor	Leader broken
CO-726	Common hackberry	*Celtis occidentalis*	9	1	4.5	13.5	Good	
CO-727*	Tuliptree	*Liriodendron tulipifera*	34	1	17	51	Good	Few vines on trunk
CO-728	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Heavy vines
CO-729	White oak	*Quercus alba*	13	1	6.5	19.5	Good	
CO-730	White oak	*Quercus alba*	27	1	13.5	40.5	Good	Few broken branches
CO-731	Boxelder	*Acer negundo*	8	1	4	12	Poor	Missing leader, water sprouts
CO-732	American elm	*Ulmus americana*	8	1	4	12	Fair	Lean, exposed roots
CO-733	Swamp chestnut oak	*Quercus michauxii*	8	1	4	12	Good	
CO-734	Boxelder	*Acer negundo*	7	1	3.5	10.5	Good	
CO-735	Tuliptree	*Liriodendron tulipifera*	20	1	N/A	N/A	Standing Dead	
CO-736	Bitternut hickory	*Carya cordiformis*	18	1	9	27	Fair	Strong lean, healed over lightning scar
CO-737	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Many vines
CO-738	Boxelder	*Acer negundo*	6	1	3	9	Fair	Water sprouts, lean
CO-739	Pawpaw	*Asimina triloba*	6	1	3	9	Good	Some dead branches
CO-740	Black walnut	*Juglans nigra*	18	1	9	27	Fair	Some vines in canopy
CO-741	Common hackberry	*Celtis occidentalis*	12	1	6	18	Good	
CO-742	Blackgum	*Nyssa sylvatica*	15	1	7.5	22.5	Good	
CO-743	Mockernut hickory	*Carya tomentosa*	7	1	3.5	10.5	Good	
CO-744	American hornbeam	*Carpinus caroliniana*	5	1	2.5	7.5	Fair	Heavy vines
CO-745	American beech	*Fagus grandifolia*	6	1	3	9	Good	
CO-746	American elm	*Ulmus americana*	9	1	4.5	13.5	Good	
CO-747	Common hackberry	*Celtis occidentalis*	9	1	4.5	13.5	Good	
CO-748	American elm	*Ulmus americana*	16, 5	2	8	24	Fair	Some vines in canopy. Twin trunks 16 x 5
CO-749	Boxelder	*Acer negundo*	14	1	7	21	Good	
CO-750	Unknown		9	1	N/A	N/A	Standing Dead	
CO-751	Boxelder	*Acer negundo*	7	1	3.5	10.5	Poor	Dead leader, water sprouts
CO-752	Unknown		7	1	N/A	N/A	Standing Dead	
CO-753*	Northern red oak	*Quercus rubra*	37	1	18.5	55.5	Fair	Significant lean, some vines
CO-754	Black locust	*Robinia pseudoacacia*	22	1	11	33	Fair	Many vines
CO-755	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Lean, exposed roots
CO-756	Bitternut hickory	*Carya cordiformis*	8	1	4	12	Good	Lean
CO-757*	Northern red oak	*Quercus rubra*	37	1	18.5	55.5	Good	
CO-758	American hornbeam	*Carpinus caroliniana*	6	1	3	9	Good	
CO-759	Unknown		11	1	N/A	N/A	Standing Dead	
CO-760	White oak	*Quercus alba*	8	1	4	12	Good	
CO-761	Boxelder	*Acer negundo*	6	1	3	9	Fair	With vines
CO-762	Boxelder	*Acer negundo*	6	1	3	9	Good	
CO-763	Mockernut hickory	*Carya tomentosa*	10	1	5	15	Good	
CO-764	American elm	*Ulmus americana*	8	1	4	12	Good	
CO-765	Bitternut hickory	*Carya cordiformis*	8	1	4	12	Good	Vine on trunk
CO-766	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
CO-767	Boxelder	*Acer negundo*	11	1	5.5	16.5	Good	
CO-768	Boxelder	*Acer negundo*	10	1	5	15	Fair	Leaning, many vines
CO-769	American elm	*Ulmus americana*	14	1	7	21	Fair	Heavy lean, heavy vines
CO-770	Pawpaw	*Asimina triloba*	6	1	3	9	Good	
CO-771	Bitternut hickory	*Carya cordiformis*	25	1	12.5	37.5	Poor	Large trunk wound, trunk decay
CO-772	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Good	
CO-773	American elm	*Ulmus americana*	18	1	9	27	Fair	Many vines
CO-774	American beech	*Fagus grandifolia*	9	1	4.5	13.5	Good	
CO-775	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Water sprouts, broken branches
CO-776*	American sycamore	*Platanus occidentalis*	32	1	16	48	Good	
CO-777	Northern red oak	*Quercus rubra*	9	1	4.5	13.5	Poor	Significant trunk damage
CO-778	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
CO-779	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Water sprouts, dead wood
CO-780	Boxelder	*Acer negundo*	12	1	6	18	Fair	Water sprouts, dead tree leaning on tree

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-781	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
CO-782	Mockernut hickory	*Carya tomentosa*	6	1	3	9	Poor	Heavy vines
CO-783	Eastern redbud	*Cercis canadensis*	5	1	2.5	7.5	Good	
CO-784	American elm	*Ulmus americana*	6	1	3	9	Fair	Dead branches
CO-785	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Trunk damage
CO-786	Green ash	*Fraxinus pennsylvanica*	11	1	5.5	16.5	Poor	EAB infestation, dying
CO-787	American beech	*Fagus grandifolia*	6	1	3	9	Good	
CO-788	Pawpaw	*Asimina triloba*	5	1	2.5	7.5	Fair	Sapsucker holes
CO-789	Northern red oak	*Quercus rubra*	15	1	7.5	22.5	Fair	Vines, lean
CO-790	American hornbeam	*Carpinus caroliniana*	5	1	2.5	7.5	Fair	Water sprouts, dead wood
CO-791	Mockernut hickory	*Carya tomentosa*	8	1	4	12	Good	
CO-792	American elm	*Ulmus americana*	6	1	3	9	Fair	Vines in canopy
CO-793	Mockernut hickory	*Carya tomentosa*	12	1	6	18	Poor	Broken leader, vines
CO-794	Boxelder	*Acer negundo*	12	1	6	18	Good	
CO-795	Unknown		10	1	N/A	N/A	Standing Dead	
CO-796	Eastern redbud	*Cercis canadensis*	9	1	4.5	13.5	Poor	Large trunk wound, many dead branches
CO-797	Boxelder	*Acer negundo*	12	1	6	18	Fair	Many vines, trunk rot
CO-798	Unknown		10	1	N/A	N/A	Standing Dead	
CO-799	Bitternut hickory	*Carya cordiformis*	14	1	7	21	Good	
CO-800	Mockernut hickory	*Carya tomentosa*	9	1	4.5	13.5	Good	
CO-801	Black locust	*Robinia pseudoacacia*	7	1	N/A	N/A	Standing Dead	
CO-802	Pawpaw	*Asimina triloba*	5	1	2.5	7.5	Good	Slight lean
CO-803	Unknown		7	1	N/A	N/A	Standing Dead	
CO-804	Boxelder	*Acer negundo*	10	1	5	15	Poor	Dead leader, lean
CO-805	Bitternut hickory	*Carya cordiformis*	22, 14, 10	3	11	33	Good	Multistem 22 x 14 x 10
CO-806	American sycamore	*Platanus occidentalis*	21	1	10.5	31.5	Good	
CO-807	Unknown		40	1	N/A	N/A	Standing Dead	
CO-808	Black locust	*Robinia pseudoacacia*	11	1	5.5	16.5	Poor	Lean, fungus on trunk
CO-809	Common hackberry	*Celtis occidentalis*	12	1	6	18	Fair	Large broken branches
CO-810	American elm	*Ulmus americana*	5	1	2.5	7.5	Fair	Bend in trunk, scorched foliage
CO-811	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Good	
CO-812	Bitternut hickory	*Carya cordiformis*	19, 12	2	9.5	28.5	Good	Some vines on trunk, twins 19 x 12
CO-813	Black locust	*Robinia pseudoacacia*	12	1	N/A	N/A	Standing Dead	
CO-814	Black walnut	*Juglans nigra*	15	1	7.5	22.5	Fair	Vines in canopy
CO-815	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Fair	Reduced canopy
CO-816	Bitternut hickory	*Carya cordiformis*	18	1	9	27	Good	
CO-817	Boxelder	*Acer negundo*	11	1	5.5	16.5	Good	
CO-818	Unknown		10	1	N/A	N/A	Standing Dead	
CO-819	Boxelder	*Acer negundo*	6	1	3	9	Poor	Vines, thin canopy
CO-820	Boxelder	*Acer negundo*	12	1	6	18	Fair	Dead limbs
CO-821	American elm	*Ulmus americana*	9	1	4.5	13.5	Good	
CO-822	American elm	*Ulmus americana*	5	1	2.5	7.5	Poor	Broken leader, lean
CO-823	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Poor growth form, water sprouts
CO-824	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Water sprouts, lean, healed trunk wounds
CO-825	Mockernut hickory	*Carya tomentosa*	11	1	5.5	16.5	Good	
CO-826	White oak	*Quercus alba*	13	1	6.5	19.5	Good	
CO-827	Green ash	*Fraxinus pennsylvanica*	10	1	N/A	N/A	Standing Dead	
CO-828	White oak	*Quercus alba*	11	1	5.5	16.5	Fair	Heavy vines
CO-829	Black locust	*Robinia pseudoacacia*	5	1	N/A	N/A	Standing Dead	
CO-830	American beech	*Fagus grandifolia*	23	1	11.5	34.5	Good	
CO-831	Boxelder	*Acer negundo*	10	1	5	15	Fair	Water sprouts, exposed roots
CO-832	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
CO-833	Flowering dogwood	*Cornus florida*	5	1	2.5	7.5	Fair	Lean
CO-834	Unknown		16	1	N/A	N/A	Standing Dead	
CO-835	American elm	*Ulmus americana*	21, 12	2	10.5	31.5	Fair	Dead part of large branch, lean. Twins 21 x 12
CO-836	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Fair	Some large broken branches
CO-837	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Heavy vines
CO-838	Mockernut hickory	*Carya tomentosa*	10	1	5	15	Good	
CO-839	White oak	*Quercus alba*	14	1	7	21	Good	
CO-840	Pin oak	*Quercus palustris*	22	1	11	33	Fair	Broken branches, thin canopy
CO-841	American elm	*Ulmus americana*	17	1	8.5	25.5	Fair	Dead branches, lean
CO-842	Northern red oak	*Quercus rubra*	21	1	10.5	31.5	Good	Minor trunk wound
CO-843	Northern red oak	*Quercus rubra*	11	1	5.5	16.5	Good	Minor vines
CO-844	Common hackberry	*Celtis occidentalis*	21	1	10.5	31.5	Good	Interfering trunks
CO-845	Bitternut hickory	*Carya cordiformis*	19	1	9.5	28.5	Good	
CO-846	American elm	*Ulmus americana*	5	1	2.5	7.5	Poor	Thin canopy, not much foliage
CO-847	Boxelder	*Acer negundo*	10	1	5	15	Good	Lean
CO-848	Black walnut	*Juglans nigra*	27	1	13.5	40.5	Fair	Large broken branches, vines

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-849	American elm	*Ulmus americana*	16	1	8	24	Good	
CO-850	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Fair	Unusual growth form
CO-851	American elm	*Ulmus americana*	10	1	5	15	Poor	Dying
CO-852	Mockernut hickory	*Carya tomentosa*	6	1	3	9	Poor	Bent over nearly 90 degrees
CO-853	Boxelder	*Acer negundo*	9	1	4.5	13.5	Good	
CO-854	American elm	*Ulmus americana*	6	1	3	9	Good	
CO-855	Black cherry	*Prunus serotina*	10	1	5	15	Poor	Heavy vine, erosion around roots
CO-856	Black cherry	*Prunus serotina*	8	1	4	12	Poor	Heavy vines, thin crown
CO-857	American hornbeam	*Carpinus caroliniana*	5	1	2.5	7.5	Fair	Lean, vines
CO-858	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Vines in canopy
CO-859*	Tuliptree	*Liriodendron tulipifera*	53	1	26.5	79.5	Good	Minor vines
CO-860	Boxelder	*Acer negundo*	8	1	4	12	Poor	Dying canopy, many water sprouts
CO-861	Northern red oak	*Quercus rubra*	24	1	12	36	Fair	Lean, vines in canopy
CO-862	Boxelder	*Acer negundo*	9	1	4.5	13.5	Good	
CO-863	Northern red oak	*Quercus rubra*	12	1	6	18	Good	Minor vines
CO-864	Boxelder	*Acer negundo*	11	1	5.5	16.5	Poor	Vines, dead crown
CO-865	Red maple	*Acer rubrum*	17	1	8.5	25.5	Fair	Heavy vines
CO-866	Northern red oak	*Quercus rubra*	22	1	11	33	Good	
CO-867	Bitternut hickory	*Carya cordiformis*	18	1	9	27	Good	
CO-868	Unknown		13	1	N/A	N/A	Standing Dead	
CO-869	Northern red oak	*Quercus rubra*	5	1	2.5	7.5	Good	
CO-870	Bitternut hickory	*Carya cordiformis*	11	1	5.5	16.5	Good	
CO-871*	White oak	*Quercus alba*	30	1	15	45	Good	Vines
CO-872	American sycamore	*Platanus occidentalis*	21	1	10.5	31.5	Good	Minor lean
CO-873	American hornbeam	*Carpinus caroliniana*	5	1	2.5	7.5	Poor	Major trunk damage
CO-874	White oak	*Quercus alba*	26	1	13	39	Good	Minor vines
CO-875	Black walnut	*Juglans nigra*	7	1	3.5	10.5	Poor	Dying
CO-876*	Tuliptree	*Liriodendron tulipifera*	30	1	15	45	Good	
CO-877	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Dead leader
CO-878	Unknown		9, 7	2	N/A	N/A	Standing Dead	Twins 9 x 7
CO-879	Boxelder	*Acer negundo*	8	1	4	12	Poor	Heavy vines, overtopped
CO-880	Green ash	*Fraxinus pennsylvanica*	9	1	N/A	N/A	Standing Dead	
CO-881	Sweet cherry	*Prunus avium*	10	1	5	15	Poor	Very thin canopy
CO-882	Common hackberry	*Celtis occidentalis*	9	1	4.5	13.5	Good	
CO-883	American sycamore	*Platanus occidentalis*	14	1	7	21	Good	
CO-884	Common hackberry	*Celtis occidentalis*	11	1	5.5	16.5	Fair	Dead wood in canopy
CO-885	Black cherry	*Prunus serotina*	7	1	3.5	10.5	Fair	Heavy vines
CO-886	Mockernut hickory	*Carya tomentosa*	5	1	2.5	7.5	Good	
CO-887	Boxelder	*Acer negundo*	13	1	6.5	19.5	Fair	Lean, many water sprouts
CO-888	American elm	*Ulmus americana*	10	1	5	15	Good	
CO-889	Green ash	*Fraxinus pennsylvanica*	12	1	N/A	N/A	Standing Dead	
CO-890	Mockernut hickory	*Carya tomentosa*	7	1	3.5	10.5	Fair	Broken branches
CO-891	American elm	*Ulmus americana*	12	1	N/A	N/A	Standing Dead	
CO-892	American elm	*Ulmus americana*	6	1	3	9	Fair	Vines, scorched foliage
CO-893	American sycamore	*Platanus occidentalis*	22	1	11	33	Good	
CO-894	American elm	*Ulmus americana*	13	1	N/A	N/A	Standing Dead	
CO-895	Black walnut	*Juglans nigra*	11	1	5.5	16.5	Good	Some vines on trunk
CO-896	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Significant lean, dead branches, water sprouts
CO-897	Boxelder	*Acer negundo*	7	1	3.5	10.5	Good	
CO-898	American elm	*Ulmus americana*	8	1	4	12	Fair	Heavy vines
CO-899	Boxelder	*Acer negundo*	13	1	6.5	19.5	Good	
CO-900	Black locust	*Robinia pseudoacacia*	14	1	7	21	Poor	Dead leader
CO-901	White oak	*Quercus alba*	11	1	5.5	16.5	Good	Minor vines
CO-902	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Exposed roots
CO-903	Flowering dogwood	*Cornus florida*	5	1	2.5	7.5	Poor	Very thin canopy, vines
CO-904	Northern red oak	*Quercus rubra*	28	1	14	42	Fair	Heavy vines
CO-905	American elm	*Ulmus americana*	5	1	2.5	7.5	Poor	Leaning, reduced canopy
CO-906	Flowering dogwood	*Cornus florida*	5	1	2.5	7.5	Fair	Lean, waterspouts
CO-907	American sycamore	*Platanus occidentalis*	11	1	5.5	16.5	Fair	Erosion around roots
CO-908	Boxelder	*Acer negundo*	9	1	4.5	13.5	Poor	Significant trunk decay
CO-909	American elm	*Ulmus americana*	10	1	5	15	Fair	Thin canopy, dying leaves
CO-910	Common persimmon	*Diospyros virginiana*	8	1	4	12	Good	
CO-911	Red maple	*Acer rubrum*	5	1	2.5	7.5	Poor	Overtopped, heavy vines
CO-912	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Water sprouts, lean
CO-913	Unknown		15	1	N/A	N/A	Standing Dead	
CO-914	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Exposed roots
CO-915	Black locust	*Robinia pseudoacacia*	11	1	5.5	16.5	Poor	Missing leader
CO-916	Bitternut hickory	*Carya cordiformis*	12	1	6	18	Good	Included bark
CO-917	Common hackberry	*Celtis occidentalis*	9	1	4.5	13.5	Fair	Lean, one sided
CO-918	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Water sprouts, irregular trunk

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-919	American elm	*Ulmus americana*	6	1	3	9	Good	
CO-920	Bitternut hickory	*Carya cordiformis*	17	1	8.5	25.5	Good	
CO-921*	Northern red oak	*Quercus rubra*	31	1	15.5	46.5	Good	
CO-922	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Broken branches
CO-923	American sycamore	*Platanus occidentalis*	17	1	8.5	25.5	Fair	Heavy vines
CO-924	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Good	Minor vines
CO-925	American elm	*Ulmus americana*	6	1	3	9	Fair	Slight lean, thin canopy
CO-926	Common hackberry	*Celtis occidentalis*	12	1	6	18	Fair	Some dead wood
CO-927	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Good	
CO-928	American elm	*Ulmus americana*	5	1	2.5	7.5	Good	
CO-929	Boxelder	*Acer negundo*	6	1	3	9	Poor	Heavy vines, water sprouts
CO-930	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
CO-931	American sycamore	*Platanus occidentalis*	8	1	4	12	Fair	Significant lean
CO-932	Flowering dogwood	*Cornus florida*	5	1	2.5	7.5	Fair	Lean minor dead branches
CO-933	American elm	*Ulmus americana*	5	1	2.5	7.5	Poor	Leaning, dead branches
CO-934	American elm	*Ulmus americana*	7	1	3.5	10.5	Good	
CO-935	American elm	*Ulmus americana*	7	1	3.5	10.5	Good	
CO-936	American sycamore	*Platanus occidentalis*	18	1	9	27	Good	
CO-937	Blackhaw	*Viburnum prunifolium*	5, 2	2	2.5	7.5	Poor	Overtopped, dead branches, trunk wounds, twins 5 x 2
CO-938	Tree of heaven	*Ailanthus altissima*	20	1	10	30	Poor	Large trunk cavity
CO-939	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Water sprouts, irregular leader
CO-940	Black locust	*Robinia pseudoacacia*	28	1	14	42	Fair	Some vines on trunk
CO-941	American elm	*Ulmus americana*	9	1	4.5	13.5	Poor	Leaning, vines in canopy
CO-942	Boxelder	*Acer negundo*	11	1	5.5	16.5	Good	
CO-943*	Northern red oak	*Quercus rubra*	32	1	16	48	Good	
CO-944	Northern red oak	*Quercus rubra*	12	1	6	18	Good	
CO-945	Pawpaw	*Asimina triloba*	5	1	2.5	7.5	Good	
CO-946	Green ash	*Fraxinus pennsylvanica*	18	1	N/A	N/A	Standing Dead	
CO-947	American hornbeam	*Carpinus caroliniana*	5	1	2.5	7.5	Fair	Poor growth form
CO-948*	Northern red oak	*Quercus rubra*	33	1	16.5	49.5	Good	Twin trunk, included bark
CO-949	White oak	*Quercus alba*	10	1	5	15	Fair	Heavy vines
CO-950	Unknown		9	1	N/A	N/A	Standing Dead	
CO-951	Eastern redbud	*Cercis canadensis*	5	1	2.5	7.5	Good	
CO-952	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Trunk cavity, dead wood
CO-953	Northern red oak	*Quercus rubra*	10	1	5	15	Fair	Heavy vines
CO-954	Unknown		8	1	N/A	N/A	Standing Dead	
CO-955	Boxelder	*Acer negundo*	8	1	4	12	Fair	Some vines on trunk, lean, water sprouts
CO-956	American hornbeam	*Carpinus caroliniana*	8	1	4	12	Fair	Heavy lean
CO-957	American elm	*Ulmus americana*	6	1	3	9	Fair	Some sap coming out of trunk
CO-958	American elm	*Ulmus americana*	7	1	N/A	N/A	Standing Dead	
CO-959	American hornbeam	*Carpinus caroliniana*	5	1	2.5	7.5	Good	
CO-960	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Vines in canopy
CO-961	Common hackberry	*Celtis occidentalis*	6	1	3	9	Fair	Some vines on trunk, lean
CO-962	American elm	*Ulmus americana*	8	1	4	12	Poor	Water sprouts, very thin canopy
CO-963	Unknown		10	1	N/A	N/A	Standing Dead	
CO-964	Bitternut hickory	*Carya cordiformis*	24	1	12	36	Good	
CO-965	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Water sprouts
CO-966	Black walnut	*Juglans nigra*	12	1	6	18	Fair	Vines, lean
CO-967	Red mulberry	*Morus rubra*	6	1	3	9	Good	
CO-968	Mockernut hickory	*Carya tomentosa*	13	1	6.5	19.5	Good	
CO-969	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Water sprouts, vines
CO-970	Red maple	*Acer rubrum*	8	1	4	12	Good	
CO-971	Boxelder	*Acer negundo*	8	1	4	12	Fair	Heavy lean
CO-972	Boxelder	*Acer negundo*	10	1	5	15	Fair	Reduced canopy
CO-973	American beech	*Fagus grandifolia*	8	1	4	12	Good	Vines
CO-974	American beech	*Fagus grandifolia*	16	1	8	24	Good	
CO-975	Unknown		7	1	N/A	N/A	Standing Dead	
CO-976	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Vines in canopy
CO-977	American elm	*Ulmus americana*	11	1	5.5	16.5	Good	
CO-978	Unknown		11	1	N/A	N/A	Standing Dead	
CO-979	Common hackberry	*Celtis occidentalis*	12	1	6	18	Good	With vines
CO-980	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Appears drought stressed
CO-981	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Vines, split above DBH
CO-982	Boxelder	*Acer negundo*	12	1	6	18	Good	
CO-983	American elm	*Ulmus americana*	5	1	2.5	7.5	Good	
CO-984	American sycamore	*Platanus occidentalis*	13	1	6.5	19.5	Fair	Lean, some vines, water sprouts
CO-985	Black oak	*Quercus velutina*	12	1	6	18	Good	
CO-986	Northern red oak	*Quercus rubra*	8	1	4	12	Fair	Heavy vines
CO-987	White oak	*Quercus alba*	12	1	6	18	Good	

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-988	American elm	*Ulmus americana*	15	1	N/A	N/A	Standing Dead	
CO-989	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Heavy vines
CO-990	American elm	*Ulmus americana*	5	1	2.5	7.5	Good	
CO-991	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Lean
CO-992	Unknown		9	1	N/A	N/A	Standing Dead	
CO-993	Unknown		9	1	N/A	N/A	Standing Dead	
CO-994	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Vines, poor growth form
CO-995	American elm	*Ulmus americana*	10	1	5	15	Fair	Thin canopy, dying leaves, lean
CO-996	Red mulberry	*Morus rubra*	5	1	2.5	7.5	Good	
CO-997	American elm	*Ulmus americana*	5	1	2.5	7.5	Fair	Vines on trunk
CO-998	Black walnut	*Juglans nigra*	13	1	6.5	19.5	Good	A few vines
CO-999	Common hackberry	*Celtis occidentalis*	7	1	3.5	10.5	Good	
CO-1000	Boxelder	*Acer negundo*	5	1	2.5	7.5	Good	
CO-1001	Common hackberry	*Celtis occidentalis*	9	1	4.5	13.5	Fair	Heavy vines
CO-1002	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Lean, trunk wounds
CO-1003	Black walnut	*Juglans nigra*	13	1	6.5	19.5	Good	Few broken branches
CO-1004	Mockernut hickory	*Carya tomentosa*	6	1	3	9	Fair	Unusual growth form
CO-1005	Common hackberry	*Celtis occidentalis*	18	1	9	27	Good	
CO-1006	Black walnut	*Juglans nigra*	23	1	11.5	34.5	Good	
CO-1007	Black locust	*Robinia pseudoacacia*	17	1	8.5	25.5	Fair	Vines, thin canopy
CO-1008	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Vines, poor growth form
CO-1009*	Tuliptree	*Liriodendron tulipifera*	38	1	19	57	Good	Minor vines
CO-1010	Unknown		7	1	N/A	N/A	Standing Dead	
CO-1011	White oak	*Quercus alba*	10	1	5	15	Fair	Heavy vines
CO-1012	Black walnut	*Juglans nigra*	11	1	5.5	16.5	Fair	Twin trunk, heavy vines
CO-1013	American elm	*Ulmus americana*	12	1	6	18	Good	
CO-1014	Boxelder	*Acer negundo*	16	1	8	24	Poor	Many dead branches
CO-1015*	Tuliptree	*Liriodendron tulipifera*	44	1	22	66	Excellent	
CO-1016	American elm	*Ulmus americana*	7	1	3.5	10.5	Good	
CO-1017	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Poor growth form
CO-1018	Unknown		6	1	N/A	N/A	Standing Dead	
CO-1019	Common hackberry	*Celtis occidentalis*	12	1	6	18	Fair	Vines
CO-1020	Boxelder	*Acer negundo*	10	1	5	15	Good	
CO-1021	Green ash	*Fraxinus pennsylvanica*	10	1	N/A	N/A	Standing Dead	
CO-1022	Unknown		8	1	N/A	N/A	Standing Dead	
CO-1023	American sycamore	*Platanus occidentalis*	10	1	5	15	Fair	Heavy lean
CO-1024	Black walnut	*Juglans nigra*	12	1	6	18	Fair	Irregular trunk, lean
CO-1025	Common hackberry	*Celtis occidentalis*	10	1	5	15	Good	
CO-1026	Red maple	*Acer rubrum*	11	1	5.5	16.5	Fair	Irregular growth form, lean
CO-1027	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Water sprouts, slight lean
CO-1028	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Vines, water sprouts
CO-1029	Boxelder	*Acer negundo*	6	1	3	9	Fair	Many water sprouts
CO-1030	Black locust	*Robinia pseudoacacia*	9	1	4.5	13.5	Fair	Many vines
CO-1031	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
CO-1032	Slippery elm	*Ulmus rubra*	7	1	3.5	10.5	Fair	Vines
CO-1033	Green ash	*Fraxinus pennsylvanica*	9	1	N/A	N/A	Standing Dead	
CO-1034	American sycamore	*Platanus occidentalis*	21	1	10.5	31.5	Good	
CO-1035	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Lean, slight trunk wound
CO-1036	Mockernut hickory	*Carya tomentosa*	10	1	5	15	Good	Minor vines
CO-1037	Green ash	*Fraxinus pennsylvanica*	22	1	N/A	N/A	Standing Dead	
CO-1038	Black locust	*Robinia pseudoacacia*	12	1	6	18	Good	Minor vines
CO-1039	Green ash	*Fraxinus pennsylvanica*	13	1	N/A	N/A	Standing Dead	
CO-1040	Black locust	*Robinia pseudoacacia*	16	1	8	24	Poor	Dead crown, nearly dead
CO-1041	American sycamore	*Platanus occidentalis*	10	1	5	15	Good	
CO-1042	Willow oak	*Quercus phellos*	15	1	7.5	22.5	Good	Minor vines
CO-1043	Boxelder	*Acer negundo*	10	1	5	15	Good	
CO-1044	American elm	*Ulmus americana*	13	1	6.5	19.5	Fair	Heavy vines
CO-1045	American elm	*Ulmus americana*	8	1	N/A	N/A	Standing Dead	
CO-1046	Northern red oak	*Quercus rubra*	21	1	10.5	31.5	Good	
CO-1047	Boxelder	*Acer negundo*	12	1	6	18	Fair	Broken branches, vines on trunk
CO-1048	American elm	*Ulmus americana*	6	1	3	9	Good	
CO-1049	Boxelder	*Acer negundo*	8	1	4	12	Good	
CO-1050	Silver maple	*Acer saccharinum*	20	1	10	30	Fair	Many water sprouts, lean
CO-1051	American elm	*Ulmus americana*	5	1	2.5	7.5	Fair	With vines
CO-1052	Northern red oak	*Quercus rubra*	9	1	4.5	13.5	Fair	Few vines on trunk
CO-1053	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Good	Minor vines
CO-1054	Green ash	*Fraxinus pennsylvanica*	16	1	8	24	Poor	Dead top, some sprouts on trunk
CO-1055	Black walnut	*Juglans nigra*	10	1	5	15	Fair	Irregular trunk
CO-1056	Unknown		8	1	N/A	N/A	Standing Dead	
CO-1057	American sycamore	*Platanus occidentalis*	7	1	3.5	10.5	Fair	Vines on trunk, thin crown, overtopped

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-1058	American beech	*Fagus grandifolia*	13	1	6.5	19.5	Good	
CO-1059	American elm	*Ulmus americana*	7	1	3.5	10.5	Good	
CO-1060	Willow oak	*Quercus phellos*	16	1	8	24	Good	
CO-1061	Unknown		5	1	N/A	N/A	Standing Dead	
CO-1062	American hornbeam	*Carpinus caroliniana*	6	1	3	9	Poor	Broken branches, poor growth form
CO-1063	American sycamore	*Platanus occidentalis*	13	1	6.5	19.5	Good	
CO-1064*	American sycamore	*Platanus occidentalis*	34	1	17	51	Good	Minor vines
CO-1065	American sycamore	*Platanus occidentalis*	16	1	8	24	Good	
CO-1066	American elm	*Ulmus americana*	10	1	5	15	Fair	Lean, vines
CO-1067	Boxelder	*Acer negundo*	6	1	3	9	Fair	Lean, vines
CO-1068	Eastern redbud	*Cercis canadensis*	6	1	3	9	Poor	Heavy vines, lean
CO-1069	Boxelder	*Acer negundo*	9	1	4.5	13.5	Good	Minor vines
CO-1070	Green ash	*Fraxinus pennsylvanica*	6	1	3	9	Fair	Vines, thin canopy
CO-1071	Eastern redbud	*Cercis canadensis*	5	1	2.5	7.5	Poor	Heavy vines, broken branches, trunk cavity
CO-1072	Boxelder	*Acer negundo*	6	1	3	9	Fair	Dead branches, trunk rot
CO-1073	Bitternut hickory	*Carya cordiformis*	13	1	6.5	19.5	Fair	Heavy vines
CO-1074	Boxelder	*Acer negundo*	10	1	5	15	Fair	Water sprouts
CO-1075*	Tuliptree	*Liriodendron tulipifera*	33	1	16.5	49.5	Good	Minor dead branches
CO-1076	Northern red oak	*Quercus rubra*	6	1	3	9	Good	Vines
CO-1077	American sycamore	*Platanus occidentalis*	16	1	8	24	Good	
CO-1078	American elm	*Ulmus americana*	6	1	3	9	Poor	Broken leader
CO-1079	Northern red oak	*Quercus rubra*	7	1	3.5	10.5	Poor	Overtopped, many dead branches
CO-1080	Northern red oak	*Quercus rubra*	7	1	3.5	10.5	Poor	Dead leader, heavy vines
CO-1081	Black locust	*Robinia pseudoacacia*	9	1	4.5	13.5	Poor	Dead branches, thin crown
CO-1082	Green ash	*Fraxinus pennsylvanica*	6	1	N/A	N/A	Standing Dead	
CO-1083	Bitternut hickory	*Carya cordiformis*	6	1	3	9	Good	
CO-1084*	Tuliptree	*Liriodendron tulipifera*	31	1	15.5	46.5	Good	
CO-1085	Boxelder	*Acer negundo*	13	1	6.5	19.5	Fair	Trunk cavity
CO-1086	American sycamore	*Platanus occidentalis*	6	1	3	9	Good	
CO-1087	Black cherry	*Prunus serotina*	7	1	3.5	10.5	Fair	Dead branches
CO-1088	Northern red oak	*Quercus rubra*	13	1	6.5	19.5	Fair	Heavy vines
CO-1089	Black cherry	*Prunus serotina*	6	1	3	9	Fair	Dead branches
CO-1090	American elm	*Ulmus americana*	8	1	4	12	Fair	Unusual growth form
CO-1091*	Green ash	*Fraxinus pennsylvanica*	36	1	18	54	Fair	Lean. Very good looking for green ash
CO-1092	Boxelder	*Acer negundo*	6	1	3	9	Poor	Trunk wound, peeling bark
CO-1093	American elm	*Ulmus americana*	10	1	5	15	Fair	Water sprouts
CO-1094	Willow oak	*Quercus phellos*	9	1	4.5	13.5	Good	
CO-1095	Boxelder	*Acer negundo*	8	1	4	12	Fair	Dead branches
CO-1096	Silver maple	*Acer saccharinum*	16	1	8	24	Fair	Water sprouts
CO-1097*	Northern red oak	*Quercus rubra*	39	1	19.5	58.5	Good	Minor vines
CO-1098	Bitternut hickory	*Carya cordiformis*	12	1	6	18	Good	
CO-1099	Green ash	*Fraxinus pennsylvanica*	10	1	N/A	N/A	Standing Dead	
CO-1100	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Water sprouts, lean, dead branches
CO-1101	American elm	*Ulmus americana*	6	1	3	9	Fair	Lean, vines in canopy
CO-1102	Black walnut	*Juglans nigra*	17	1	8.5	25.5	Good	
CO-1103	American elm	*Ulmus americana*	8	1	4	12	Fair	Vines in canopy, on steep slope
CO-1104	American sycamore	*Platanus occidentalis*	16	1	8	24	Good	
CO-1105	Boxelder	*Acer negundo*	8	1	4	12	Fair	Lean, water sprouts
CO-1106	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Poor	Decay through bottom of trunk
CO-1107	Northern red oak	*Quercus rubra*	5	1	2.5	7.5	Fair	Heavy vines
CO-1108	Bitternut hickory	*Carya cordiformis*	12	1	6	18	Good	
CO-1109	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Water sprouts, trunk wounds
CO-1110	Unknown		52	1	N/A	N/A	Standing Dead	
CO-1111	Boxelder	*Acer negundo*	19	1	9.5	28.5	Poor	Significant trunk damage
CO-1112	American elm	*Ulmus americana*	12	1	6	18	Good	
CO-1113	Bitternut hickory	*Carya cordiformis*	5	1	2.5	7.5	Good	
CO-1114	Green ash	*Fraxinus pennsylvanica*	6	1	N/A	N/A	Standing Dead	
CO-1115	American sycamore	*Platanus occidentalis*	24	1	12	36	Fair	Heavy vines
CO-1116	American elm	*Ulmus americana*	7	1	3.5	10.5	Good	
CO-1117	American sycamore	*Platanus occidentalis*	22	1	11	33	Good	
CO-1118	American elm	*Ulmus americana*	8	1	4	12	Good	
CO-1119	Boxelder	*Acer negundo*	7	1	3.5	10.5	Poor	Lean, broken leader
CO-1120	Boxelder	*Acer negundo*	12	1	6	18	Fair	Many sprouts, vines
CO-1121	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Vines
CO-1122	White oak	*Quercus alba*	15	1	7.5	22.5	Fair	Heavy vines
CO-1123	American hornbeam	*Carpinus caroliniana*	7	1	3.5	10.5	Fair	Multi stem, dead wood
CO-1124	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Irregular trunk, water sprouts, vines on trunk
CO-1125	Green ash	*Fraxinus pennsylvanica*	8	1	N/A	N/A	Standing Dead	
CO-1126	Mockernut hickory	*Carya tomentosa*	6	1	3	9	Fair	Heavy vines
CO-1127	Boxelder	*Acer negundo*	7	1	3.5	10.5	Good	
CO-1128	American elm	*Ulmus americana*	6	1	3	9	Fair	Vines in canopy
CO-1129	American sycamore	*Platanus occidentalis*	5	1	2.5	7.5	Fair	Heavy vines
CO-1130	Green ash	*Fraxinus pennsylvanica*	8	1	4	12	Fair	Dead, healed over twin
CO-1131	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Vines in canopy
CO-1132	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Vines in canopy
CO-1133	Boxelder	*Acer negundo*	6	1	3	9	Fair	Water sprouts, lean
CO-1134	American sycamore	*Platanus occidentalis*	23	1	11.5	34.5	Good	Vines
CO-1135	Eastern redbud	*Cercis canadensis*	6	1	3	9	Fair	Heavy lean
CO-1136	Boxelder	*Acer negundo*	13	1	6.5	19.5	Poor	Water sprouts, vines, broken crown
CO-1137	American sycamore	*Platanus occidentalis*	24	1	12	36	Good	Minor vines
CO-1138	American sycamore	*Platanus occidentalis*	22	1	11	33	Fair	Lean, cavity under roots
CO-1139	American elm	*Ulmus americana*	6	1	3	9	Fair	Dead branches
CO-1140	Green ash	*Fraxinus pennsylvanica*	11	1	N/A	N/A	Standing Dead	
CO-1141	Eastern redbud	*Cercis canadensis*	5	1	2.5	7.5	Poor	Heavy vines, broken leader
CO-1142	American sycamore	*Platanus occidentalis*	15	1	7.5	22.5	Fair	Irregular trunk, thin canopy, water sprouts
CO-1143	Green ash	*Fraxinus pennsylvanica*	12	1	N/A	N/A	Standing Dead	
CO-1144	American sycamore	*Platanus occidentalis*	17	1	8.5	25.5	Good	
CO-1145	Green ash	*Fraxinus pennsylvanica*	18	1	N/A	N/A	Standing Dead	
CO-1146	Green ash	*Fraxinus pennsylvanica*	11	1	N/A	N/A	Standing Dead	
CO-1147*	American sycamore	*Platanus occidentalis*	32	1	16	48	Good	
CO-1148	Green ash	*Fraxinus pennsylvanica*	25	1	N/A	N/A	Standing Dead	
CO-1149	White mulberry	*Morus alba*	6	1	3	9	Fair	Dead branches
CO-1150	Unknown		21	1	N/A	N/A	Standing Dead	
CO-1151	American elm	*Ulmus americana*	14	1	7	21	Good	Minor vines
CO-1152	American elm	*Ulmus americana*	12	1	6	18	Fair	Lean canopy
CO-1153	Black walnut	*Juglans nigra*	6	1	3	9	Poor	Vines, dead branches
CO-1154	Mockernut hickory	*Carya tomentosa*	15	1	7.5	22.5	Good	Minor vines
CO-1155	Unknown		20	1	N/A	N/A	Standing Dead	
CO-1156	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Broken leader
CO-1157	Boxelder	*Acer negundo*	6	1	3	9	Fair	Dead branches , vines
CO-1158	American elm	*Ulmus americana*	8	1	4	12	Fair	Lean
CO-1159	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Poor	Major trunk wound, vines
CO-1160	American elm	*Ulmus americana*	6	1	3	9	Poor	Lean, spots on foliage, thin canopy, heavy vines
CO-1161	American elm	*Ulmus americana*	6	1	3	9	Fair	Leaning
CO-1162	Boxelder	*Acer negundo*	13	1	6.5	19.5	Fair	Heavy vines, lean
CO-1163	Common hackberry	*Celtis occidentalis*	10	1	5	15	Good	
CO-1164	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Water sprouts, lean
CO-1165	Mockernut hickory	*Carya tomentosa*	5	1	2.5	7.5	Fair	Heavy vines
CO-1166	American elm	*Ulmus americana*	6	1	3	9	Fair	Lean, spots on foliage, thin canopy
CO-1167	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Poor growth form, vines
CO-1168	Boxelder	*Acer negundo*	8	1	4	12	Poor	Broken leader
CO-1169	Unknown		15	1	N/A	N/A	Standing Dead	
CO-1170	Tuliptree	*Liriodendron tulipifera*	5	1	2.5	7.5	Fair	Heavy vines
CO-1171	Boxelder	*Acer negundo*	6	1	3	9	Fair	Water sprouts, vines on trunk
CO-1172	American sycamore	*Platanus occidentalis*	15	1	7.5	22.5	Good	
CO-1173*	Tuliptree	*Liriodendron tulipifera*	35	1	17.5	52.5	Good	Vines
CO-1174	Northern red oak	*Quercus rubra*	21, 13	2	10.5	31.5	Good	Minor vines, twin trunks 21 x 13
CO-1175	Boxelder	*Acer negundo*	5	1	2.5	7.5	Good	
CO-1176	Boxelder	*Acer negundo*	8	1	4	12	Poor	Dead leader, heavy vines
CO-1177	American elm	*Ulmus americana*	8	1	4	12	Fair	Lean
CO-1178	American elm	*Ulmus americana*	8	1	4	12	Poor	Many vines
CO-1179	Unknown		6	1	N/A	N/A	Standing Dead	
CO-1180	American sycamore	*Platanus occidentalis*	26	1	13	39	Good	Some vines
CO-1181	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Heavy vines, lean, broken branches
CO-1182	Black walnut	*Juglans nigra*	8	1	4	12	Fair	Many vines, dead branches
CO-1183	American elm	*Ulmus americana*	8	1	4	12	Poor	Vines and dead branches
CO-1184	Boxelder	*Acer negundo*	10	1	5	15	Poor	Dead leader and vines
CO-1185	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	With vines
CO-1186	Eastern redbud	*Cercis canadensis*	8	1	4	12	Poor	Trunk broken
CO-1187	Mockernut hickory	*Carya tomentosa*	5	1	2.5	7.5	Fair	Heavy vines
CO-1188	Black locust	*Robinia pseudoacacia*	6	1	3	9	Fair	Leaning
CO-1189	American sycamore	*Platanus occidentalis*	19	1	9.5	28.5	Good	
CO-1190	American elm	*Ulmus americana*	8	1	4	12	Fair	Irregular growth in

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-1191	Boxelder	*Acer negundo*	10	1	5	15	Poor	Dead leader, trunk cavities
CO-1192	Boxelder	*Acer negundo*	16	1	8	24	Poor	Dead leader
CO-1193	White oak	*Quercus alba*	6	1	3	9	Fair	With vines
CO-1194	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Heavy lean
CO-1195*	Tuliptree	*Liriodendron tulipifera*	34	1	17	51	Fair	Heavy vines
CO-1196	Black locust	*Robinia pseudoacacia*	16	1	N/A	N/A	Standing Dead	
CO-1197	Boxelder	*Acer negundo*	18, 8	2	9	27	Fair	Many water sprouts, heavy vines, twin trunks 18 x 8
CO-1198	American sycamore	*Platanus occidentalis*	18	1	9	27	Good	
CO-1199	American elm	*Ulmus americana*	7	1	3.5	10.5	Poor	More than half of trunk dead
CO-1200	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Dead leader, lean
CO-1201	Boxelder	*Acer negundo*	12	1	N/A	N/A	Standing Dead	
CO-1202	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Good	Minor vines
CO-1203	Black walnut	*Juglans nigra*	10	1	5	15	Fair	Many vines
CO-1204	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Heavy lean
CO-1205	American elm	*Ulmus americana*	11	1	5.5	16.5	Fair	Leans, vines
CO-1206	Black locust	*Robinia pseudoacacia*	16	1	N/A	N/A	Standing Dead	
CO-1207	Black locust	*Robinia pseudoacacia*	11, 10	2	5.5	16.5	Poor	Lean, dead leader, twin trunks 11 x 10
CO-1208*	Tuliptree	*Liriodendron tulipifera*	37	1	18.5	55.5	Good	Minor vines
CO-1209	Boxelder	*Acer negundo*	15, 9	2	7.5	22.5	Fair	Dying leader, twin trunks 15 x 9
CO-1210	Green ash	*Fraxinus pennsylvanica*	15	1	N/A	N/A	Standing Dead	
CO-1211	Boxelder	*Acer negundo*	14	1	7	21	Fair	Dead branches, water sprouts
CO-1212	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Fair	Heavy vines
CO-1213	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Heavy vines
CO-1214	Common hackberry	*Celtis occidentalis*	25	1	12.5	37.5	Fair	Twin trunk, heavy vines, lean
CO-1215*	Tuliptree	*Liriodendron tulipifera*	30	1	15	45	Good	
CO-1216	Boxelder	*Acer negundo*	5	1	2.5	7.5	Good	
CO-1217	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Heavy vines, thin crown
CO-1218	Boxelder	*Acer negundo*	7	1	3.5	10.5	Poor	Dead leader
CO-1219	Boxelder	*Acer negundo*	3	1	1.5	4.5	Poor	Major trunk decay
CO-1220	Boxelder	*Acer negundo*	8	1	4	12	Fair	Dead leader, vines
CO-1221	Black locust	*Robinia pseudoacacia*	21	1	10.5	31.5	Fair	Heavy vines
CO-1222	Boxelder	*Acer negundo*	9	1	4.5	13.5	Good	
CO-1223	Boxelder	*Acer negundo*	6	1	3	9	Good	
CO-1224	Boxelder	*Acer negundo*	10	1	5	15	Fair	Leaning
CO-1225	Northern red oak	*Quercus rubra*	8	1	4	12	Fair	Heavy vines
CO-1226	Boxelder	*Acer negundo*	7	1	3.5	10.5	Good	
CO-1227	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Many vines, dead branches
CO-1228	American sycamore	*Platanus occidentalis*	28	1	14	42	Fair	Heavy vines
CO-1229	Black walnut	*Juglans nigra*	17	1	8.5	25.5	Fair	Trunk cavity, lean
CO-1230	American elm	*Ulmus americana*	5	1	N/A	N/A	Standing Dead	Dead leader
CO-1231	Boxelder	*Acer negundo*	6	1	3	9	Good	
CO-1232	Boxelder	*Acer negundo*	7	1	3.5	10.5	Poor	Dead leader
CO-1233	Boxelder	*Acer negundo*	16	1	8	24	Poor	Dead leader
CO-1234	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Dead branches
CO-1235	Boxelder	*Acer negundo*	10	1	5	15	Fair	Trunk wound, some vines
CO-1236	Boxelder	*Acer negundo*	6	1	3	9	Fair	Vines and dead branches
CO-1237	Black walnut	*Juglans nigra*	10	1	5	15	Good	Minor vines
CO-1238	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Scorch marks on foliage
CO-1239	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Water sprouts, trunk wounds
CO-1240	Black locust	*Robinia pseudoacacia*	18	1	9	27	Poor	Dying leader, very heavy vines
CO-1241	Bitternut hickory	*Carya cordiformis*	13	1	6.5	19.5	Fair	Heavy vines
CO-1242	American elm	*Ulmus americana*	16	1	8	24	Fair	Heavy vines, lean
CO-1243	Unknown		28	1	N/A	N/A	Standing Dead	
CO-1244	American elm	*Ulmus americana*	13	1	6.5	19.5	Fair	Heavy vines on trunk
CO-1245	Common hackberry	*Celtis occidentalis*	11	1	5.5	16.5	Good	
CO-1246	Boxelder	*Acer negundo*	17	1	8.5	25.5	Good	
CO-1247	Black walnut	*Juglans nigra*	15	1	7.5	22.5	Fair	Vines and reduced canopy
CO-1248	American elm	*Ulmus americana*	7	1	3.5	10.5	Poor	Vines on trunk, dying crown
CO-1249	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Poor growth form
CO-1250	Northern red oak	*Quercus rubra*	6	1	3	9	Fair	Heavy vines
CO-1251	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Heavy vines, heavy lean, water sprouts
CO-1252*	Black walnut	*Juglans nigra*	36	1	18	54	Fair	Minor vines, dead wood
CO-1253	Unknown		10	1	N/A	N/A	Standing Dead	
CO-1254	Boxelder	*Acer negundo*	9	1	4.5	13.5	Good	
CO-1255	Boxelder	*Acer negundo*	6	1	3	9	Good	
CO-1256	Boxelder	*Acer negundo*	13	1	6.5	19.5	Good	
CO-1257	American elm	*Ulmus americana*	18	1	9	27	Fair	Dead branch
CO-1258	Black walnut	*Juglans nigra*	5	1	2.5	7.5	Fair	Lean, vines
CO-1259	Boxelder	*Acer negundo*	12	1	6	18	Fair	Lean
CO-1260	Boxelder	*Acer negundo*	5	1	2.5	7.5	Good	

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-1261*	Tuliptree	*Liriodendron tulipifera*	48	1	24	72	Poor	Large trunk cavity, heavy vines, trunk decay
CO-1262	Green ash	*Fraxinus pennsylvanica*	9	1	N/A	N/A	Standing Dead	
CO-1263	American sycamore	*Platanus occidentalis*	21	1	10.5	31.5	Poor	Heavy vines, heavy lean
CO-1264	Boxelder	*Acer negundo*	10	1	5	15	Fair	Lean
CO-1265	Boxelder	*Acer negundo*	8	1	4	12	Fair	Heavy lean
CO-1266	American elm	*Ulmus americana*	8	1	4	12	Poor	Large trunk wounds, lean
CO-1267	Black locust	*Robinia pseudoacacia*	7	1	N/A	N/A	Standing Dead	
CO-1268	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Water sprouts, irregular trunk
CO-1269	Boxelder	*Acer negundo*	5	1	2.5	7.5	Good	
CO-1270	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Dead branches, water sprouts, overtopped
CO-1271	Boxelder	*Acer negundo*	12	1	6	18	Poor	Major trunk decay
CO-1272	Black locust	*Robinia pseudoacacia*	8	1	4	12	Fair	Lean, vines on trunk
CO-1273	Black walnut	*Juglans nigra*	5	1	2.5	7.5	Fair	Dead leader
CO-1274	Eastern redbud	*Cercis canadensis*	6	1	3	9	Fair	Dead wood
CO-1275	Boxelder	*Acer negundo*	6	1	3	9	Fair	Dead leader
CO-1276	Green ash	*Fraxinus pennsylvanica*	6	1	3	9	Fair	Dead branches
CO-1277	Boxelder	*Acer negundo*	11	1	5.5	16.5	Good	
CO-1278*	White oak	*Quercus alba*	36	1	18	54	Good	
CO-1279	Boxelder	*Acer negundo*	5	1	2.5	7.5	Good	
CO-1280	Black locust	*Robinia pseudoacacia*	11, 8, 8	3	5.5	16.5	Poor	Dead leader, multistem 11 x 8 x 8
CO-1281	Bitternut hickory	*Carya cordiformis*	8	1	4	12	Fair	Heavy vines
CO-1282	Black walnut	*Juglans nigra*	18	1	9	27	Fair	Multi stem, lean, vines
CO-1283	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Stressed, dead branches
CO-1284	Boxelder	*Acer negundo*	15	1	7.5	22.5	Fair	Water sprouts, lean, heavy vines
CO-1285	Blackgum	*Nyssa sylvatica*	18, 16	2	9	27	Fair	Heavy vines, twins 18 x 16
CO-1286	Boxelder	*Acer negundo*	8	1	4	12	Fair	Water sprouts, irregular growth form
CO-1287	Boxelder	*Acer negundo*	14	1	7	21	Fair	Heavy vines
CO-1288	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Heavy lean, heavy vines
CO-1289	Boxelder	*Acer negundo*	29	1	14.5	43.5	Fair	Lean, vines
CO-1290	Eastern redbud	*Cercis canadensis*	5	1	2.5	7.5	Fair	Dead wood, vines cutting into trunk
CO-1291	Black walnut	*Juglans nigra*	20	1	10	30	Good	With vines
CO-1292	American elm	*Ulmus americana*	15	1	N/A	N/A	Standing Dead	
CO-1293	Boxelder	*Acer negundo*	18	1	9	27	Fair	Heavy lean
CO-1294	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Broken crown
CO-1295	Black walnut	*Juglans nigra*	7	1	3.5	10.5	Fair	Thin canopy, heavy lean
CO-1296	Green ash	*Fraxinus pennsylvanica*	12	1	6	18	Fair	Lean, irregular growth form
CO-1297	Boxelder	*Acer negundo*	7	1	3.5	10.5	Poor	Dead crown
CO-1298	American elm	*Ulmus americana*	8	1	4	12	Good	
CO-1299	Boxelder	*Acer negundo*	8	1	4	12	Fair	Heavy vines
CO-1300	American elm	*Ulmus americana*	7	1	3.5	10.5	Poor	Dying leader, very heavy vines
CO-1301	Black locust	*Robinia pseudoacacia*	6	1	N/A	N/A	Standing Dead	
CO-1302	American elm	*Ulmus americana*	7	1	3.5	10.5	Good	
CO-1303	Boxelder	*Acer negundo*	14	1	7	21	Poor	Dead leader
CO-1304	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Vines in canopy
CO-1305	American elm	*Ulmus americana*	6	1	3	9	Fair	Lean
CO-1306	American elm	*Ulmus americana*	10	1	5	15	Fair	Water sprouts, lean
CO-1307	Boxelder	*Acer negundo*	12	1	6	18	Good	
CO-1308	Boxelder	*Acer negundo*	8	1	4	12	Fair	Vines and dead branches
CO-1309	Boxelder	*Acer negundo*	12	1	6	18	Poor	Significant trunk decay
CO-1310	Boxelder	*Acer negundo*	6	1	3	9	Fair	Heavy vines
CO-1311	Black locust	*Robinia pseudoacacia*	6	1	3	9	Poor	Many vines, trunk rot
CO-1312	American elm	*Ulmus americana*	14, 4, 3	3	7	21	Fair	Vines in canopy, multistem 14 x 4 x 3
CO-1313	Slippery elm	*Ulmus rubra*	6	1	3	9	Fair	Reduced canopy
CO-1314	Boxelder	*Acer negundo*	9	1	4.5	13.5	Good	Minor vines
CO-1315	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Vines on lower trunk, lean
CO-1316	Black locust	*Robinia pseudoacacia*	8	1	4	12	Fair	Dead branches
CO-1317	American elm	*Ulmus americana*	8	1	4	12	Good	
CO-1318	American elm	*Ulmus americana*	15	1	7.5	22.5	Fair	Heavy vines on trunk
CO-1319	Black walnut	*Juglans nigra*	8	1	4	12	Fair	Vines on trunk
CO-1320	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Many vines, trunk rot
CO-1321	Unknown		15	1	N/A	N/A	Standing Dead	
CO-1322	American elm	*Ulmus americana*	15	1	7.5	22.5	Good	With vines
CO-1323	Black walnut	*Juglans nigra*	18	1	9	27	Fair	Reduced canopy and vines
CO-1324	Boxelder	*Acer negundo*	8	1	4	12	Poor	Irregular trunk, broken leader
CO-1325*	American sycamore	*Platanus occidentalis*	33	1	16.5	49.5	Good	
CO-1326	Boxelder	*Acer negundo*	12	1	6	18	Good	

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-1327	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Heavy vines
CO-1328	Boxelder	*Acer negundo*	10	1	5	15	Poor	Dead leader
CO-1329	Boxelder	*Acer negundo*	14	1	7	21	Fair	Water sprouts, vines
CO-1330	Black cherry	*Prunus serotina*	13	1	N/A	N/A	Standing Dead	
CO-1331	Boxelder	*Acer negundo*	20	1	10	30	Fair	Lean , vines
CO-1332	Boxelder	*Acer negundo*	8	1	4	12	Good	
CO-1333	American elm	*Ulmus americana*	23, 12	2	11.5	34.5	Fair	Vines, twins 23 x 12
CO-1334	Boxelder	*Acer negundo*	16	1	8	24	Good	
CO-1335	Boxelder	*Acer negundo*	20	1	10	30	Fair	Heavy lean
CO-1336	Common hackberry	*Celtis occidentalis*	10	1	5	15	Good	With vines
CO-1337	Boxelder	*Acer negundo*	13	1	6.5	19.5	Fair	Heavy lean
CO-1338	Green ash	*Fraxinus pennsylvanica*	22	1	N/A	N/A	Standing Dead	
CO-1339	American elm	*Ulmus americana*	10	1	5	15	Fair	Heavy vines on trunk
CO-1340	American elm	*Ulmus americana*	9	1	N/A	N/A	Standing Dead	
CO-1341	Green ash	*Fraxinus pennsylvanica*	20	1	N/A	N/A	Standing Dead	Multi stem
CO-1342	Black walnut	*Juglans nigra*	11	1	5.5	16.5	Fair	Lean, vines
CO-1343	Elm sp.	*Ulmus sp.*	7	1	N/A	N/A	Standing Dead	Unknown species
CO-1344	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Water sprouts
CO-1345	American elm	*Ulmus americana*	29	1	14.5	43.5	Fair	Vines in canopy
CO-1346	Green ash	*Fraxinus pennsylvanica*	7	1	3.5	10.5	Poor	Significant lean, thin crown
CO-1347	Unknown		18	1	N/A	N/A	Standing Dead	
CO-1348	American elm	*Ulmus americana*	8	1	4	12	Fair	Lean
CO-1349	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Good	
CO-1350	Eastern redcedar	*Juniperus virginiana*	13	1	6.5	19.5	Poor	Heavy vines, sparse canopy
CO-1351	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Water sprouts, lean
CO-1352	Boxelder	*Acer negundo*	20	1	10	30	Poor	Broken leader, vines
CO-1353	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Competing with adjacent trees
CO-1354	American elm	*Ulmus americana*	15	1	7.5	22.5	Fair	Many vines
CO-1355	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Lean
CO-1356	Eastern redbud	*Cercis canadensis*	5	1	2.5	7.5	Poor	Broken leader, trunk wound
CO-1357	Black locust	*Robinia pseudoacacia*	8	1	N/A	N/A	Standing Dead	
CO-1358	American elm	*Ulmus americana*	6	1	N/A	N/A	Standing Dead	
CO-1359	Boxelder	*Acer negundo*	6	1	3	9	Good	
CO-1360	American elm	*Ulmus americana*	12	1	6	18	Poor	Vines on trunk, thin crown
CO-1361	American elm	*Ulmus americana*	6	1	3	9	Good	With vines
CO-1362	Boxelder	*Acer negundo*	19	1	9.5	28.5	Poor	Heavy vines, heavy lean
CO-1363	Black locust	*Robinia pseudoacacia*	11	1	5.5	16.5	Poor	Trunk damage, heavy vines
CO-1364	American elm	*Ulmus americana*	6	1	3	9	Good	
CO-1366	Common hackberry	*Celtis occidentalis*	21	1	10.5	31.5	Fair	With vines
CO-1368	Boxelder	*Acer negundo*	17	1	8.5	25.5	Poor	Heavy vines, trunk damage
CO-1369	Black walnut	*Juglans nigra*	9	1	4.5	13.5	Fair	Vines in canopy, broken branches
CO-1370	American elm	*Ulmus americana*	10	1	5	15	Fair	Vines on trunk
CO-1371	Green ash	*Fraxinus pennsylvanica*	21	1	N/A	N/A	Standing Dead	
CO-1372	Boxelder	*Acer negundo*	13	1	6.5	19.5	Poor	Dead leader
CO-1373	Black walnut	*Juglans nigra*	25	1	12.5	37.5	Good	Few vines on trunk
CO-1374	Green ash	*Fraxinus pennsylvanica*	34	1	N/A	N/A	Standing Dead	
CO-1375	Black locust	*Robinia pseudoacacia*	9	1	N/A	N/A	Standing Dead	
CO-1376	Boxelder	*Acer negundo*	12	1	6	18	Fair	Dead branches, heavy vines
CO-1377	Black locust	*Robinia pseudoacacia*	9	1	N/A	N/A	Standing Dead	
CO-1378	Black locust	*Robinia pseudoacacia*	7	1	N/A	N/A	Standing Dead	
CO-1379	Common hackberry	*Celtis occidentalis*	11	1	5.5	16.5	Good	
CO-1380	Boxelder	*Acer negundo*	7	1	3.5	10.5	Good	
CO-1381	Black walnut	*Juglans nigra*	25	1	12.5	37.5	Good	
CO-1382	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Many vines in canopy
CO-1383	Black walnut	*Juglans nigra*	12	1	6	18	Fair	Reduced canopy
CO-1384	Boxelder	*Acer negundo*	15	1	7.5	22.5	Fair	Water sprouts, lean
CO-1385	Unknown		11	1	N/A	N/A	Standing Dead	
CO-1386	Black locust	*Robinia pseudoacacia*	7	1	3.5	10.5	Poor	Almost dead
CO-1388	Boxelder	*Acer negundo*	10	1	5	15	Poor	Dead leader, rotting bark
CO-1389	Unknown		17	1	N/A	N/A	Standing Dead	
CO-1390	Boxelder	*Acer negundo*	8	1	4	12	Fair	Lean
CO-1391	Boxelder	*Acer negundo*	8	1	4	12	Good	
CO-1392	Black locust	*Robinia pseudoacacia*	9	1	N/A	N/A	Standing Dead	
CO-1393	American elm	*Ulmus americana*	8	1	4	12	Poor	Almost dead
CO-1394	Black walnut	*Juglans nigra*	16	1	8	24	Fair	Heavy vines
CO-1395	American elm	*Ulmus americana*	24	1	12	36	Fair	Heavy vines, leaf spots
CO-1397	Black locust	*Robinia pseudoacacia*	10	1	N/A	N/A	Standing Dead	
CO-1398	Green ash	*Fraxinus pennsylvanica*	11	1	N/A	N/A	Standing Dead	
CO-1399	Eastern redcedar	*Juniperus virginiana*	12	1	6	18	Fair	Vines on trunk, thin canopy
CO-1400	American elm	*Ulmus americana*	6	1	3	9	Good	With vines
CO-1401	American elm	*Ulmus americana*	6	1	3	9	Fair	Water sprouts, vines
CO-1402	Unknown		19	1	N/A	N/A	Standing Dead	

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-1403*	American sycamore	*Platanus occidentalis*	52, 46	2	26	78	Fair	Some vines in canopy, leaning away from tow path. Twins 52 x 46
CO-1404	Unknown		11	1	N/A	N/A	Standing Dead	
CO-1405	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Water sprouts, lean
CO-1406	Boxelder	*Acer negundo*	12	1	6	18	Poor	Broken leader
CO-1408	Black locust	*Robinia pseudoacacia*	11	1	5.5	16.5	Poor	Reduced canopy
CO-1409	Common hackberry	*Celtis occidentalis*	12	1	6	18	Fair	Heavy vines, leaf spit
CO-1410	Black locust	*Robinia pseudoacacia*	9	1	N/A	N/A	Standing Dead	
CO-1411	American elm	*Ulmus americana*	6	1	3	9	Poor	Dying, lean
CO-1413	Boxelder	*Acer negundo*	12	1	6	18	Fair	Vines, lean
CO-1415	Black walnut	*Juglans nigra*	7	1	3.5	10.5	Fair	Vines on trunk, one sided
CO-1420	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Heavy vines, trunk wound
CO-1422	Green ash	*Fraxinus pennsylvanica*	26, 23, 22	3	N/A	N/A	Standing Dead	Multistem 26 x 22 x 23
CO-1423	Black walnut	*Juglans nigra*	26	1	13	39	Good	Some vines on trunk
CO-1425	Green ash	*Fraxinus pennsylvanica*	8	1	N/A	N/A	Standing Dead	
CO-1426	Boxelder	*Acer negundo*	10, 5	2	5	15	Good	Twin trunk 10 x 5
CO-1428	Black walnut	*Juglans nigra*	9	1	4.5	13.5	Fair	Heavy vines
CO-1430	Unknown		11	1	N/A	N/A	Standing Dead	
CO-1432	Boxelder	*Acer negundo*	17, 11	2	8.5	25.5	Poor	Dead leader, insect damage, peeling bark. Twin truns 17 x 11
CO-1433	Boxelder	*Acer negundo*	12	1	6	18	Fair	Many vines, dead leader
CO-1434	American elm	*Ulmus americana*	7	1	3.5	10.5	Poor	One sided, heavy vines, lean canopy
CO-1435	Bitternut hickory	*Carya cordiformis*	5	1	2.5	7.5	Fair	With vines
CO-1437	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Vines, dead branches
CO-1442	Black walnut	*Juglans nigra*	9	1	4.5	13.5	Fair	Heavy vines on trunk
CO-1445	Black walnut	*Juglans nigra*	13	1	6.5	19.5	Good	
CO-1447	Unknown		9	1	N/A	N/A	Standing Dead	
CO-1450	Boxelder	*Acer negundo*	18	1	9	27	Poor	Dead leader
CO-1451	Boxelder	*Acer negundo*	8	1	4	12	Fair	Vines in canopy
CO-1452	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Vines in canopy
CO-1453	Black walnut	*Juglans nigra*	19	1	9.5	28.5	Fair	Vines, lean
CO-1454	Black walnut	*Juglans nigra*	10	1	5	15	Fair	Heavy vines, lean
CO-1455	Green ash	*Fraxinus pennsylvanica*	9	1	N/A	N/A	Standing Dead	
CO-1458	American elm	*Ulmus americana*	6	1	3	9	Fair	Lean, vines
CO-1459	Bitternut hickory	*Carya cordiformis*	6	1	3	9	Good	
CO-1460	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	
CO-1462	Bitternut hickory	*Carya cordiformis*	20	1	10	30	Good	
CO-1463	American elm	*Ulmus americana*	13	1	6.5	19.5	Poor	Trunk damage
CO-1465	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Reduced canopy
CO-1468	American elm	*Ulmus americana*	15, 4	2	7.5	22.5	Fair	Lean, vines. Twins 15 x 4
CO-1469	Slippery elm	*Ulmus rubra*	5	1	2.5	7.5	Good	
CO-1473	Common hackberry	*Celtis occidentalis*	8	1	4	12	Fair	Many vines in canopy
CO-1476	Blackgum	*Nyssa sylvatica*	5	1	2.5	7.5	Good	
CO-1478	Common hackberry	*Celtis occidentalis*	21	1	10.5	31.5	Good	
CO-1479	American sycamore	*Platanus occidentalis*	12	1	6	18	Poor	Dead canopy
CO-1480	American elm	*Ulmus americana*	18, 6	2	9	27	Fair	Many vines, Twin trunk 18 x 6
CO-1481	Black walnut	*Juglans nigra*	6	1	3	9	Poor	Heavy vine, lean
CO-1483	Chestnut oak	*Quercus montana*	15	1	7.5	22.5	Good	
CO-1484	Eastern redcedar	*Juniperus virginiana*	6	1	3	9	Poor	Vines in crown, dying foliage
CO-1485	American elm	*Ulmus americana*	7	1	3.5	10.5	Good	
CO-1486	Black walnut	*Juglans nigra*	12	1	6	18	Fair	Vines in canopy
CO-1487	Boxelder	*Acer negundo*	18, 16	2	8	24	Poor	Twin trunk 18 x 16, 18" trunk dead, dead leader, vines
CO-1490	Common hackberry	*Celtis occidentalis*	8	1	4	12	Good	
CO-1491	Black cherry	*Prunus serotina*	12	1	6	18	Fair	Heavy vines, lean
CO-1492	Black walnut	*Juglans nigra*	13	1	6.5	19.5	Fair	Heavy vines
CO-1493	Black walnut	*Juglans nigra*	9	1	4.5	13.5	Poor	Topped
CO-1494	Black walnut	*Juglans nigra*	20	1	10	30	Good	
CO-1495	American elm	*Ulmus americana*	8	1	4	12	Poor	Heavy vines, lean
CO-1496	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Broken leader
CO-1497	Black walnut	*Juglans nigra*	21	1	10.5	31.5	Good	
CO-1499	Black walnut	*Juglans nigra*	29	1	14.5	43.5	Good	
CO-1500	Boxelder	*Acer negundo*	5	1	2.5	7.5	Good	
CO-1502	White oak	*Quercus alba*	15	1	7.5	22.5	Good	
CO-1503	Slippery elm	*Ulmus rubra*	14	1	7	21	Fair	Reduced crown
CO-1504	Slippery elm	*Ulmus rubra*	8	1	4	12	Good	
CO-1505	Boxelder	*Acer negundo*	18	1	9	27	Poor	Dead leader
CO-1506	Green ash	*Fraxinus pennsylvanica*	9	1	N/A	N/A	Standing Dead	
CO-1507	Boxelder	*Acer negundo*	7	1	3.5	10.5	Good	
CO-1508	Bitternut hickory	*Carya cordiformis*	9	1	4.5	13.5	Fair	Vines in canopy

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-1510	Chestnut oak	*Quercus montana*	25	1	12.5	37.5	Good	
CO-1511	Common hackberry	*Celtis occidentalis*	5	1	2.5	7.5	Good	
CO-1512	Black locust	*Robinia pseudoacacia*	8	1	N/A	N/A	Standing Dead	
CO-1515	White mulberry	*Morus alba*	12	1	6	18	Fair	Lean, dead wood
CO-1516	American elm	*Ulmus americana*	7	1	3.5	10.5	Poor	Lean, dead wood, water sprouts
CO-1517	Chestnut oak	*Quercus montana*	15, 14	2	7.5	22.5	Good	Twin trunk 15 x 14
CO-1518	Slippery elm	*Ulmus rubra*	12	1	6	18	Fair	With vines
CO-1519	White mulberry	*Morus alba*	8	1	4	12	Poor	Many dead branches
CO-1522	Boxelder	*Acer negundo*	8	1	4	12	Poor	Trunk rot at base
CO-1523	Chestnut oak	*Quercus montana*	10	1	5	15	Good	
CO-1524	Boxelder	*Acer negundo*	8	1	4	12	Good	
CO-1525	Boxelder	*Acer negundo*	9	1	4.5	13.5	Good	With vines
CO-1526*	Swamp white oak	*Quercus bicolor*	32	1	16	48	Fair	Vines in canopy
CO-1529	Boxelder	*Acer negundo*	15	1	7.5	22.5	Fair	Leaning
CO-1530	American sycamore	*Platanus occidentalis*	5	1	2.5	7.5	Good	
CO-1531	Boxelder	*Acer negundo*	12, 6	2	6	18	Poor	Twin trunk 12 x 6, dead leader
CO-1532	Bitternut hickory	*Carya cordiformis*	5	1	2.5	7.5	Good	
CO-1533	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Dying
CO-1534	Chestnut oak	*Quercus montana*	18	1	9	27	Good	
CO-1535	Bitternut hickory	*Carya cordiformis*	6	1	3	9	Good	
CO-1536	Boxelder	*Acer negundo*	12	1	6	18	Poor	Almost dead
CO-1537	Green ash	*Fraxinus pennsylvanica*	5	1	N/A	N/A	Standing Dead	
CO-1539	Bitternut hickory	*Carya cordiformis*	7	1	3.5	10.5	Fair	Vines in canopy
CO-1541	Boxelder	*Acer negundo*	9	1	4.5	13.5	Poor	Dying
CO-1542	Bitternut hickory	*Carya cordiformis*	7	1	3.5	10.5	Good	
CO-1543	Green ash	*Fraxinus pennsylvanica*	8	1	4	12	Fair	Dead branches
CO-1544	Black locust	*Robinia pseudoacacia*	17	1	N/A	N/A	Standing Dead	
CO-1545	Chestnut oak	*Quercus montana*	11	1	5.5	16.5	Fair	Leaning
CO-1546	Northern red oak	*Quercus rubra*	23	1	11.5	34.5	Good	
CO-1547	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Uprooted
CO-1548	Boxelder	*Acer negundo*	11	1	5.5	16.5	Good	Minor vines
CO-1549	Boxelder	*Acer negundo*	5	1	2.5	7.5	Good	
CO-1550*	American sycamore	*Platanus occidentalis*	32, 25	2	16	48	Fair	Trunk rot at base, vines, leaning, twin trunk 32 x 25
CO-1551	White oak	*Quercus alba*	25	1	12.5	37.5	Good	
CO-1552	Pignut hickory	*Carya glabra*	6	1	3	9	Good	
CO-1553	White oak	*Quercus alba*	27	1	13.5	40.5	Good	
CO-1555	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	With vines
CO-1556	Boxelder	*Acer negundo*	10	1	5	15	Fair	Leaning
CO-1557	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
CO-1558	Boxelder	*Acer negundo*	6	1	3	9	Good	
CO-1559	Boxelder	*Acer negundo*	6	1	3	9	Fair	Dead branches
CO-1560	Mockernut hickory	*Carya tomentosa*	8	1	4	12	Good	
CO-1561	Red maple	*Acer rubrum*	7	1	3.5	10.5	Poor	Trunk rot
CO-1562	Boxelder	*Acer negundo*	8	1	4	12	Good	
CO-1563	Red maple	*Acer rubrum*	6	1	3	9	Good	
CO-1564	Common hackberry	*Celtis occidentalis*	10	1	5	15	Fair	Vines, reduced canopy
CO-1565	Black locust	*Robinia pseudoacacia*	17	1	N/A	N/A	Standing Dead	
CO-1566	Green ash	*Fraxinus pennsylvanica*	25	1	N/A	N/A	Standing Dead	
CO-1567	Common hackberry	*Celtis occidentalis*	7	1	3.5	10.5	Fair	Vines in canopy
CO-1568	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Dead limbs
CO-1569	American elm	*Ulmus americana*	8	1	4	12	Poor	Vines, leaning
CO-1570	Common hackberry	*Celtis occidentalis*	20	1	10	30	Poor	Many vines, reduced canopy
CO-1571	Boxelder	*Acer negundo*	7	1	3.5	10.5	Good	
CO-1572	Green ash	*Fraxinus pennsylvanica*	5	1	N/A	N/A	Standing Dead	
CO-1573	Boxelder	*Acer negundo*	5	1	2.5	7.5	Good	
CO-1574	Boxelder	*Acer negundo*	10	1	5	15	Fair	Vines, broken branches
CO-1575	American beech	*Fagus grandifolia*	6	1	3	9	Good	
CO-1576	Boxelder	*Acer negundo*	8	1	4	12	Poor	Trunk misshapen, broken
CO-1577	White mulberry	*Morus alba*	5, 4	2	2.5	7.5	Poor	Vines and leaning , twin trunk 5 x 4
CO-1578	Red maple	*Acer rubrum*	23	1	11.5	34.5	Fair	Vines
CO-1579	Mockernut hickory	*Carya tomentosa*	23	1	11.5	34.5	Good	
CO-1580	Chestnut oak	*Quercus montana*	28, 18	2	14	42	Good	Twin trunk 28 x 18
CO-1581	Boxelder	*Acer negundo*	11	1	5.5	16.5	Poor	Trunk rot, dead branches
CO-1582	Sugar maple	*Acer saccharum*	14	1	7	21	Good	
CO-1583	American beech	*Fagus grandifolia*	15	1	7.5	22.5	Good	Vines
CO-1584	American elm	*Ulmus americana*	28	1	14	42	Good	Minor vines
CO-1585	Black walnut	*Juglans nigra*	14	1	7	21	Fair	Reduced canopy
CO-1586	Boxelder	*Acer negundo*	6	1	3	9	Fair	Many vines in canopy
CO-1587	Chestnut oak	*Quercus montana*	22	1	11	33	Good	

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-1588	Boxelder	*Acer negundo*	18, 11	2	9	27	Poor	Vines, twin trunk 18 x 11, second 11" trunk dying
CO-1589	Common hackberry	*Celtis occidentalis*	15	1	7.5	22.5	Fair	Many vines
CO-1590	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
CO-1591	Pignut hickory	*Carya glabra*	5	1	2.5	7.5	Good	
CO-1592	Common hackberry	*Celtis occidentalis*	8	1	4	12	Poor	Many vines, broken leader
CO-1593	Black walnut	*Juglans nigra*	19	1	9.5	28.5	Good	With vines
CO-1594	Red maple	*Acer rubrum*	28	1	14	42	Good	
CO-1595	White oak	*Quercus alba*	27	1	13.5	40.5	Good	
CO-1596	Boxelder	*Acer negundo*	14	1	7	21	Fair	Many vines in canopy
CO-1597	Boxelder	*Acer negundo*	12, 8	2	6	18	Poor	Many vine, trunk rot, twin trunk 12 x 8
CO-1598	Chestnut oak	*Quercus montana*	9	1	4.5	13.5	Good	
CO-1599	Unknown		5	1	N/A	N/A	Standing Dead	
CO-1600	American elm	*Ulmus americana*	5	1	2.5	7.5	Good	
CO-1601	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
CO-1602	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
CO-1603	Black locust	*Robinia pseudoacacia*	11	1	5.5	16.5	Fair	With vines
CO-1604	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Many vines
CO-1605	Boxelder	*Acer negundo*	5	1	2.5	7.5	Good	With vines
CO-1606	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Stressed
CO-1607	Mockernut hickory	*Carya tomentosa*	11	1	5.5	16.5	Good	Vines
CO-1608	Red maple	*Acer rubrum*	6	1	3	9	Good	
CO-1609	Blackgum	*Nyssa sylvatica*	6	1	3	9	Good	
CO-1610	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Broken vines
CO-1611	Blackgum	*Nyssa sylvatica*	13	1	6.5	19.5	Good	Vines
CO-1612	Mockernut hickory	*Carya tomentosa*	9	1	4.5	13.5	Good	
CO-1613	Black locust	*Robinia pseudoacacia*	9	1	N/A	N/A	Standing Dead	
CO-1614	Red maple	*Acer rubrum*	9	1	N/A	N/A	Standing Dead	
CO-1615	Black walnut	*Juglans nigra*	10	1	5	15	Fair	Vines in canopy
CO-1616	Mockernut hickory	*Carya tomentosa*	11	1	5.5	16.5	Good	
CO-1617	Black walnut	*Juglans nigra*	14	1	7	21	Good	With vines
CO-1618	Red maple	*Acer rubrum*	20	1	10	30	Fair	Many vines
CO-1619	Boxelder	*Acer negundo*	13	1	6.5	19.5	Poor	Cut leader, many vines
CO-1620	Black walnut	*Juglans nigra*	22	1	11	33	Good	
CO-1621	Red maple	*Acer rubrum*	16	1	8	24	Fair	Leaning, vines
CO-1622	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Fair	Trunk rot, vines
CO-1623	Green ash	*Fraxinus pennsylvanica*	22	1	N/A	N/A	Standing Dead	
CO-1624	Pignut hickory	*Carya glabra*	8	1	4	12	Good	
CO-1625	Blackgum	*Nyssa sylvatica*	9	1	4.5	13.5	Good	Vines
CO-1626	Boxelder	*Acer negundo*	20	1	10	30	Good	With vines
CO-1627	Red maple	*Acer rubrum*	20	1	10	30	Good	Vines
CO-1628	White oak	*Quercus alba*	12	1	6	18	Good	Vines
CO-1629	Red maple	*Acer rubrum*	17	1	8.5	25.5	Fair	Trunk rot at base
CO-1630	Green ash	*Fraxinus pennsylvanica*	10	1	N/A	N/A	Standing Dead	
CO-1631	Green ash	*Fraxinus pennsylvanica*	17	1	N/A	N/A	Standing Dead	
CO-1632	Green ash	*Fraxinus pennsylvanica*	6	1	N/A	N/A	Standing Dead	
CO-1633	American sycamore	*Platanus occidentalis*	17	1	8.5	25.5	Good	With vines
CO-1634	Common hackberry	*Celtis occidentalis*	14	1	7	21	Good	With vines
CO-1635	Black walnut	*Juglans nigra*	27	1	13.5	40.5	Good	
CO-1636	Red maple	*Acer rubrum*	16	1	8	24	Good	
CO-1637	American hornbeam	*Carpinus caroliniana*	5	1	2.5	7.5	Good	Vines
CO-1638*	White oak	*Quercus alba*	33	1	16.5	49.5	Good	
CO-1639	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Leaning, split in trunk
CO-1640	American elm	*Ulmus americana*	13	1	6.5	19.5	Good	
CO-1641	Red maple	*Acer rubrum*	15	1	7.5	22.5	Fair	Stressed, vines
CO-1642*	American sycamore	*Platanus occidentalis*	48	1	24	72	Good	With vines
CO-1643	Common hackberry	*Celtis occidentalis*	20	1	10	30	Fair	Vines, few dead branches
CO-1644	Mockernut hickory	*Carya tomentosa*	9	1	4.5	13.5	Good	
CO-1645	American sycamore	*Platanus occidentalis*	26	1	13	39	Good	With vines
CO-1646	Green ash	*Fraxinus pennsylvanica*	7	1	N/A	N/A	Standing Dead	
CO-1647	Chestnut oak	*Quercus montana*	13	1	6.5	19.5	Fair	Reduced canopy
CO-1648	Red maple	*Acer rubrum*	16	1	8	24	Fair	Split trunk, vines
CO-1649	Green ash	*Fraxinus pennsylvanica*	9	1	N/A	N/A	Standing Dead	
CO-1650	Boxelder	*Acer negundo*	13	1	6.5	19.5	Fair	Leaning, dead branches
CO-1651	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	With vines
CO-1652	Boxelder	*Acer negundo*	20	1	10	30	Fair	Few dead branches, vines
CO-1653	Mockernut hickory	*Carya tomentosa*	7	1	3.5	10.5	Good	
CO-1654	American hornbeam	*Carpinus caroliniana*	5	1	2.5	7.5	Good	
CO-1655	American sycamore	*Platanus occidentalis*	27	1	13.5	40.5	Good	With vines
CO-1656	Green ash	*Fraxinus pennsylvanica*	11	1	N/A	N/A	Standing Dead	
CO-1657	Chestnut oak	*Quercus montana*	9	1	4.5	13.5	Fair	Reduced canopy, fungus
CO-1658*	Tuliptree	*Liriodendron tulipifera*	43	1	21.5	64.5	Good	With vines

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-1659	Black locust	*Robinia pseudoacacia*	9	1	4.5	13.5	Fair	Vines in canopy
CO-1660	Bitternut hickory	*Carya cordiformis*	7	1	3.5	10.5	Good	Vines
CO-1661	Pin oak	*Quercus palustris*	13	1	6.5	19.5	Fair	Heavy vines on trunk, dead lower branches
CO-1662	White oak	*Quercus alba*	28	1	14	42	Good	
CO-1663	Blackgum	*Nyssa sylvatica*	6	1	3	9	Good	
CO-1664	Common hackberry	*Celtis occidentalis*	11, 9	2	5.5	16.5	Fair	With vines, twin trunk 11 x 9
CO-1665	Mockernut hickory	*Carya tomentosa*	17	1	8.5	25.5	Good	
CO-1666*	Northern red oak	*Quercus rubra*	32	1	16	48	Fair	Leaning, vines
CO-1667	Boxelder	*Acer negundo*	10	1	5	15	Fair	Significant lean, vines on trunk
CO-1668	Blackgum	*Nyssa sylvatica*	8	1	4	12	Good	
CO-1669	Boxelder	*Acer negundo*	8	1	4	12	Poor	Dead leader
CO-1670	Black walnut	*Juglans nigra*	6	1	3	9	Fair	Vines
CO-1671*	Boxelder	*Acer negundo*	31	1	15.5	46.5	Fair	Vines, stressed
CO-1672	Black walnut	*Juglans nigra*	17	1	8.5	25.5	Fair	Lean, vines on trunk
CO-1673	Chestnut oak	*Quercus montana*	19	1	9.5	28.5	Fair	Leaning
CO-1674	Black walnut	*Juglans nigra*	18	1	9	27	Good	
CO-1675	Pin oak	*Quercus palustris*	14	1	7	21	Poor	Many broken branches, dying canopy
CO-1676	Black walnut	*Juglans nigra*	21	1	10.5	31.5	Fair	Vines
CO-1677	Red maple	*Acer rubrum*	8	1	4	12	Fair	Broken branches
CO-1678	Boxelder	*Acer negundo*	14	1	7	21	Poor	Significant lean, vines on trunk, half of tree dead
CO-1679	Unknown		21	1	N/A	N/A	Standing Dead	
CO-1680	Black walnut	*Juglans nigra*	17	1	8.5	25.5	Good	Vines
CO-1681	American elm	*Ulmus americana*	8	1	4	12	Poor	Dead leader, water sprouts
CO-1682	White mulberry	*Morus alba*	9, 5	2	4.5	13.5	Poor	Dying second leader, many dead branches, trunk decay. Twin trunks 9 x 5
CO-1683	American sycamore	*Platanus occidentalis*	12	1	6	18	Fair	Vines in canopy
CO-1684	American elm	*Ulmus americana*	19	1	9.5	28.5	Fair	Many vines
CO-1685	American elm	*Ulmus americana*	13	1	6.5	19.5	Fair	Some dead branches
CO-1686	American hornbeam	*Carpinus caroliniana*	6	1	3	9	Fair	Water sprouts, overtopped, bark atypical
CO-1687	Northern red oak	*Quercus rubra*	10	1	5	15	Fair	Vines in canopy, broken branches
CO-1688	Blackhaw	*Viburnum prunifolium*	5	1	2.5	7.5	Fair	Some healed over trunk wounds
CO-1689	Littleleaf linden	*Tilia cordata*	6	1	3	9	Fair	Significant lean, healed trunk wound
CO-1690	Northern red oak	*Quercus rubra*	11	1	5.5	16.5	Good	
CO-1691	American elm	*Ulmus americana*	17	1	8.5	25.5	Fair	Dead twin, healed over
CO-1692	Black walnut	*Juglans nigra*	10	1	5	15	Fair	Few vines on trunk, thin canopy
CO-1693	American elm	*Ulmus americana*	11	1	5.5	16.5	Poor	Significant lean, many water sprouts, heavy vines
CO-1694	American hornbeam	*Carpinus caroliniana*	25	1	12.5	37.5	Fair	Heavy vines
CO-1695	American elm	*Ulmus americana*	24	1	12	36	Good	
CO-1696	Black walnut	*Juglans nigra*	19	1	9.5	28.5	Good	Few vines on trunk
CO-1697	American elm	*Ulmus americana*	8	1	N/A	N/A	Standing Dead	
CO-1698	Green ash	*Fraxinus pennsylvanica*	19	1	N/A	N/A	Standing Dead	
CO-1699	Pin oak	*Quercus palustris*	14	1	7	21	Poor	Many broken branches, broken leader
CO-1700	American sycamore	*Platanus occidentalis*	8, 6	2	4	12	Poor	Dying leader, overtopped, vines, trunk cavity. Twins 8 x 6
CO-1701	Common persimmon	*Diospyros virginiana*	12	1	6	18	Fair	Vines, stressed
CO-1702	Northern red oak	*Quercus rubra*	11	1	5.5	16.5	Good	
CO-1703	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Trunk wound, some vines on trunk
CO-1704	American elm	*Ulmus americana*	6	1	3	9	Fair	With vines
CO-1705	Eastern redcedar	*Juniperus virginiana*	7	1	3.5	10.5	Poor	Vines in canopy, crown almost dead
CO-1706	Pin oak	*Quercus palustris*	21, 14	2	10.5	31.5	Poor	Twin trunk 21 x 14, crown missing
CO-1707	American sycamore	*Platanus occidentalis*	18	1	9	27	Fair	Heavy vines
CO-1708	Northern red oak	*Quercus rubra*	23	1	11.5	34.5	Fair	Broken lower branches
CO-1709	American elm	*Ulmus americana*	10	1	5	15	Fair	With vines
CO-1710	Boxelder	*Acer negundo*	13, 5	2	6.5	19.5	Fair	Twin trunk 13 x 5, leaning
CO-1711	Black locust	*Robinia pseudoacacia*	12	1	6	18	Fair	With vines
CO-1712	Boxelder	*Acer negundo*	20	1	10	30	Poor	Split trunk, leaning
CO-1713	Eastern redcedar	*Juniperus virginiana*	9	1	4.5	13.5	Fair	Irregular trunk
CO-1714	Black locust	*Robinia pseudoacacia*	7	1	3.5	10.5	Poor	Leaning
CO-1715	American sycamore	*Platanus occidentalis*	25, 19	2	12.5	37.5	Fair	Twin trunk 25 x 19, vines and exposed roots

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-1716	Littleleaf linden	*Tilia cordata*	25	1	12.5	37.5	Good	Some vines on lower branches
CO-1717	Littleleaf linden	*Tilia cordata*	14, 10, 6	3	7	21	Fair	Small leader dying. Multistem 14 x 10 x 6
CO-1718	Black walnut	*Juglans nigra*	7	1	3.5	10.5	Good	Vines on trunk
CO-1719	Black locust	*Robinia pseudoacacia*	13	1	6.5	19.5	Fair	With vines
CO-1720	Northern red oak	*Quercus rubra*	6	1	3	9	Fair	Lean, heavy vines
CO-1721	Slippery elm	*Ulmus rubra*	7	1	3.5	10.5	Fair	Missing canopy
CO-1722	American elm	*Ulmus americana*	16	1	8	24	Fair	With vines
CO-1723	Boxelder	*Acer negundo*	8	1	4	12	Poor	Large dead tree leaning on trunk, heavy vines
CO-1724	American elm	*Ulmus americana*	24	1	12	36	Fair	Vines in canopy
CO-1725	Boxelder	*Acer negundo*	9	1	N/A	N/A	Standing Dead	
CO-1726	Boxelder	*Acer negundo*	16	1	8	24	Fair	Some dead branches
CO-1727	Black walnut	*Juglans nigra*	8	1	4	12	Fair	Lean, irregular trunk
CO-1728	American elm	*Ulmus americana*	20, 7	2	10	30	Fair	Vines on trunk, twin trunks 20 x 7. 7" twin dead
CO-1729	Common hackberry	*Celtis occidentalis*	8	1	4	12	Good	
CO-1730	Unknown		17	1	N/A	N/A	Standing Dead	
CO-1731	Common hackberry	*Celtis occidentalis*	16	1	8	24	Good	
CO-1732	Boxelder	*Acer negundo*	8	1	4	12	Fair	Heavy vines
CO-1733	Black walnut	*Juglans nigra*	12	1	6	18	Fair	Vines, dead branches
CO-1734	Black walnut	*Juglans nigra*	7	1	3.5	10.5	Fair	Leaning
CO-1735	Black locust	*Robinia pseudoacacia*	6	1	3	9	Fair	Leaning, vines in canopy
CO-1736	Northern red oak	*Quercus rubra*	13	1	6.5	19.5	Fair	Heavy vines
CO-1737	Boxelder	*Acer negundo*	8	1	4	12	Fair	Included bark, vines
CO-1738	American elm	*Ulmus americana*	6	1	3	9	Fair	Reduced canopy
CO-1739	Unknown		11	1	N/A	N/A	Standing Dead	
CO-1740	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	With vines
CO-1741	Boxelder	*Acer negundo*	12	1	6	18	Fair	Heavy lean, vines
CO-1742	White mulberry	*Morus alba*	10, 10	2	5	15	Poor	Twin trunk, broken leader, significant dead wood
CO-1743	White mulberry	*Morus alba*	11, 11	2	5.5	16.5	Poor	Twin trunk, broken leader, significant dead wood
CO-1744	Eastern redbud	*Cercis canadensis*	10	1	5	15	Good	Leaning
CO-1745	Black walnut	*Juglans nigra*	12	1	6	18	Poor	Extensive vines, reduced canopy
CO-1746	Black locust	*Robinia pseudoacacia*	5	1	2.5	7.5	Poor	Fallen
CO-1747	Black walnut	*Juglans nigra*	10	1	5	15	Fair	Extensive vines
CO-1748	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Dead branches, lean
CO-1749	Unknown		9	1	N/A	N/A	Standing Dead	
CO-1750	American elm	*Ulmus americana*	8	1	4	12	Fair	Vines, kink in trunk
CO-1751	American elm	*Ulmus americana*	14, 14	2	7	21	Fair	Twin trunk, vines, dead branches
CO-1752	Black walnut	*Juglans nigra*	16	1	8	24	Fair	Vines in canopy
CO-1753	American elm	*Ulmus americana*	6	1	3	9	Good	
CO-1754	Eastern redcedar	*Juniperus virginiana*	9	1	4.5	13.5	Poor	Dead leader, vines
CO-1755	American elm	*Ulmus americana*	8	1	4	12	Fair	Heavy vines
CO-1756	Common hackberry	*Celtis occidentalis*	5	1	2.5	7.5	Fair	Heavy lean
CO-1757	Red maple	*Acer rubrum*	22, 15	2	11	33	Poor	Extensive vines, trunk rot, twin trunk 22 x 15
CO-1758	Eastern redbud	*Cercis canadensis*	7	1	3.5	10.5	Poor	Dead leader
CO-1759	American elm	*Ulmus americana*	11	1	5.5	16.5	Poor	With vines
CO-1760	Unknown		8	1	N/A	N/A	Standing Dead	
CO-1761	Eastern redbud	*Cercis canadensis*	7, 5	2	3.5	10.5	Fair	Dead branches, vines, twin trunk 7 x 5
CO-1762	Northern red oak	*Quercus rubra*	23	1	11.5	34.5	Fair	Trimmed limbs
CO-1763	Black walnut	*Juglans nigra*	9	1	4.5	13.5	Poor	Dead leader, lean
CO-1764	Black walnut	*Juglans nigra*	8	1	4	12	Good	Minor vines
CO-1765	Unknown		8	1	N/A	N/A	Standing Dead	
CO-1766	American elm	*Ulmus americana*	15	1	7.5	22.5	Poor	Canopy trimmed
CO-1767	Eastern redbud	*Cercis canadensis*	5	1	2.5	7.5	Fair	Dead leader, broken branches
CO-1768	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Exposed roots, dead branches
CO-1769	Eastern redcedar	*Juniperus virginiana*	9	1	4.5	13.5	Good	Minor vines
CO-1770	Common hackberry	*Celtis occidentalis*	6	1	3	9	Fair	Lean, dead branches
CO-1771	American sycamore	*Platanus occidentalis*	8	1	4	12	Poor	Extensive vines in canopy, leaning
CO-1772	Black walnut	*Juglans nigra*	9	1	4.5	13.5	Fair	Heavy vines
CO-1773	Northern red oak	*Quercus rubra*	19	1	9.5	28.5	Good	
CO-1774	Pin oak	*Quercus palustris*	17	1	8.5	25.5	Good	
CO-1775	American sycamore	*Platanus occidentalis*	15	1	7.5	22.5	Fair	Vines in canopy
CO-1776	American sycamore	*Platanus occidentalis*	6	1	3	9	Poor	Overgrown with vines, leaning
CO-1777	Northern red oak	*Quercus rubra*	19	1	9.5	28.5	Good	Minor vines
CO-1778	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Lean

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CO-1779	Northern red oak	*Quercus rubra*	16	1	8	24	Good	Minor vines
CO-1780	American sycamore	*Platanus occidentalis*	13	1	6.5	19.5	Fair	Significant lean, heavy vines
CO-1781*	Northern red oak	*Quercus rubra*	30	1	15	45	Good	
CO-1782	Red maple	*Acer rubrum*	6	1	3	9	Fair	Undercut roots
CO-1784	Tuliptree	*Liriodendron tulipifera*	7	1	3.5	10.5	Fair	Extensive vines
CO-1786	Northern red oak	*Quercus rubra*	9	1	4.5	13.5	Good	
CO-1789	American sycamore	*Platanus occidentalis*	16	1	8	24	Good	
CO-1793	Eastern redcedar	*Juniperus virginiana*	8	1	4	12	Fair	Many vines in canopy
CO-1794	Eastern redcedar	*Juniperus virginiana*	10	1	5	15	Poor	Broken trunk, extensive vines
CO-1800	American elm	*Ulmus americana*	22	1	11	33	Fair	Water sprouts, vines on trunk, lean
CO-1802	Green ash	*Fraxinus pennsylvanica*	10, 9, 7	3	N/A	N/A	Standing Dead	Multistem trunk 10 x 9 x 7
CO-1803	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	One sided, lean, vines on trunk
CO-1829	American sycamore	*Platanus occidentalis*	16	1	8	24	Fair	Extensive vines
CO-1831	Black locust	*Robinia pseudoacacia*	8	1	4	12	Poor	Heavy vines, dead wood
CO-1839	American sycamore	*Platanus occidentalis*	6	1	3	9	Good	
CO-1842	American sycamore	*Platanus occidentalis*	9	1	4.5	13.5	Good	
CO-1855	Eastern redcedar	*Juniperus virginiana*	14	1	7	21	Fair	Many vines in canopy
CO-1861	Swamp white oak	*Quercus bicolor*	7	1	3.5	10.5	Good	
CO-1875	Swamp white oak	*Quercus bicolor*	7	1	3.5	10.5	Good	
CO-1896	American sycamore	*Platanus occidentalis*	5	1	2.5	7.5	Good	
CO-1916	Eastern redcedar	*Juniperus virginiana*	8	1	4	12	Fair	Vines, dead branches
CO-1918	Unknown		15	1	N/A	N/A	Standing Dead	
CO-1935	American elm	*Ulmus americana*	11	1	5.5	16.5	Poor	Heavy vines, lean
CO-1936	American elm	*Ulmus americana*	17	1	8.5	25.5	Poor	Heavy vines, heavy lean
CO-1939	American elm	*Ulmus americana*	6	1	3	9	Poor	Heavy vines, lean
CO-1940	American elm	*Ulmus americana*	9	1	4.5	13.5	Poor	Heavy vines, heavy lean
CO-1948	American elm	*Ulmus americana*	15, 15	2	7.5	22.5	Fair	Twin trunk, heavy vines
CO-1949	American elm	*Ulmus americana*	10	1	5	15	Fair	Vines, lean
CO-1951	American elm	*Ulmus americana*	8	1	4	12	Good	Minor vines
CO-1952	American elm	*Ulmus americana*	6	1	3	9	Good	Minor vines
CO-1954	Amur honeysuckle	*Lonicera maackii*	5	1	2.5	7.5	Fair	Heavy lean
CO-1957	American elm	*Ulmus americana*	21	1	10.5	31.5	Fair	Vines, lean
CO-1961	Eastern redcedar	*Juniperus virginiana*	9	1	4.5	13.5	Poor	Heavy vines on trunk, broken crown
CO-1963	American elm	*Ulmus americana*	10	1	5	15	Fair	Heavy vines
CO-1970	Eastern redcedar	*Juniperus virginiana*	17	1	8.5	25.5	Poor	Heavy vines on trunk
CO-1971	Eastern redcedar	*Juniperus virginiana*	7	1	3.5	10.5	Poor	Overtopped, vines in canopy
CO-1973	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Heavy vines, lean
CO-1974	Eastern redcedar	*Juniperus virginiana*	12	1	6	18	Fair	One sided, broken branches
CO-1975	American elm	*Ulmus americana*	6	1	3	9	Poor	Heavy vines, heavy lean
CO-1976	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Vines, heavy lean
CO-1977	Unknown		6	1	N/A	N/A	Standing Dead	
CO-1979	Eastern redcedar	*Juniperus virginiana*	8	1	4	12	Poor	Overtopped by vines, broken branches
CO-1980	Eastern redcedar	*Juniperus virginiana*	5, 4	2	2.5	7.5	Poor	Vines in crown, significant lean. Twins 5 x 4
CO-1981	Eastern redcedar	*Juniperus virginiana*	5	1	2.5	7.5	Poor	Dying crown
CO-1982	Blackgum	*Nyssa sylvatica*	8	1	4	12	Fair	Heavy vines
CO-1983	Northern red oak	*Quercus rubra*	16	1	8	24	Fair	Heavy vines
CO-1985	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Lean, trunk wound
CO-1986	Slippery elm	*Ulmus rubra*	18, 7	2	9	27	Good	Some vines on trunk. Twins 18 x 7
CO-1993	Black walnut	*Juglans nigra*	18	1	9	27	Fair	Vines on trunk, lean
CO-1997	American elm	*Ulmus americana*	9	1	4.5	13.5	Poor	Heavy vines, thin crown
CO-1998	Eastern redbud	*Cercis canadensis*	7	1	3.5	10.5	Poor	Significant trunk decay
CO-2002	American elm	*Ulmus americana*	13	1	6.5	19.5	Fair	Vines on trunk, broken branches
CO-2004	American elm	*Ulmus americana*	10	1	5	15	Fair	Heavy vines, heavy lean
CO-2005	American elm	*Ulmus americana*	7	1	3.5	10.5	Poor	Water sprouts, broken leader
CO-2007	Eastern redcedar	*Juniperus virginiana*	6	1	3	9	Poor	Vines in crown
CO-2008	American elm	*Ulmus americana*	8	1	4	12	Poor	Broken leader, water sprouts
CO-2009*	Eastern redcedar	*Juniperus virginiana*	31	1	15.5	46.5	Fair	Vines on lower branches
CO-2011	White oak	*Quercus alba*	9	1	4.5	13.5	Fair	Heavy vines on crown, overtopped
CO-2012	Green ash	*Fraxinus pennsylvanica*	7	1	N/A	N/A	Standing Dead	
CO-2015	Slippery elm	*Ulmus rubra*	21	1	10.5	31.5	Fair	Lean, vines in crown
CO-2016	American elm	*Ulmus americana*	8	1	4	12	Fair	Kink in trunk
CO-2017	Green ash	*Fraxinus pennsylvanica*	14	1	7	21	Fair	Vines on trunk, trunk wound at base
CO-2018	Black walnut	*Juglans nigra*	7	1	3.5	10.5	Fair	Vines on trunk, dead wood

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
Clara Barton Parkway								
CB-1365	American elm	*Ulmus americana*	11	1	5.5	16.5	Good	
CB-1367*	Tuliptree	*Liriodendron tulipifera*	31	1	15.5	46.5	Fair	Heavy vines
CB-1387	American sycamore	*Platanus occidentalis*	18	1	9	27	Fair	Vines
CB-1396	Boxelder	*Acer negundo*	6	1	3	9	Fair	Heavy vines
CB-1407	Unknown		6	1	N/A	N/A	Standing Dead	
CB-1412	Boxelder	*Acer negundo*	8	1	4	12	Fair	Heavy vines
CB-1414	American elm	*Ulmus americana*	6	1	3	9	Fair	Heavy vines
CB-1416	Boxelder	*Acer negundo*	6	1	3	9	Poor	Heavy lean, vines
CB-1417	American elm	*Ulmus americana*	6	1	3	9	Fair	Heavy vines
CB-1418	Unknown		19	1	N/A	N/A	Standing Dead	
CB-1419	Boxelder	*Acer negundo*	12	1	6	18	Fair	Heavy vines
CB-1421	American elm	*Ulmus americana*	6	1	3	9	Good	
CB-1424	Unknown		9	1	N/A	N/A	Standing Dead	
CB-1427	Boxelder	*Acer negundo*	13	1	6.5	19.5	Fair	Lean, vines
CB-1429	Unknown		32	1	N/A	N/A	Standing Dead	
CB-1431	American elm	*Ulmus americana*	11	1	5.5	16.5	Fair	Vines
CB-1436	Boxelder	*Acer negundo*	10	1	5	15	Poor	Heavy vines, heavy lean
CB-1438	Boxelder	*Acer negundo*	9	1	4.5	13.5	Poor	Missing leader, vines
CB-1439	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Lean, vines
CB-1440	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Lean, competing with Ailanthus
CB-1441	Boxelder	*Acer negundo*	8	1	4	12	Fair	Heavy vines
CB-1443	Tree of heaven	*Ailanthus altissima*	16	1	8	24	Good	Minor vines
CB-1444	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Decaying trunk
CB-1446	Boxelder	*Acer negundo*	8	1	4	12	Poor	Poor canopy
CB-1448	American elm	*Ulmus americana*	6	1	3	9	Good	Minor vines
CB-1449	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Heavy vines
CB-1456	American elm	*Ulmus americana*	8	1	4	12	Good	
CB-1457	American elm	*Ulmus americana*	25	1	12.5	37.5	Fair	Heavy vines, dead branches
CB-1461	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Heavy lean
CB-1464	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Thin crown, vines
CB-1466	Boxelder	*Acer negundo*	20	1	10	30	Poor	Dead leader, vines
CB-1467	Unknown		12	1	N/A	N/A	Standing Dead	
CB-1470	Boxelder	*Acer negundo*	9	1	4.5	13.5	Good	
CB-1471	Boxelder	*Acer negundo*	8	1	4	12	Fair	Water sprouts, vines
CB-1472	American elm	*Ulmus americana*	10	1	5	15	Fair	Lean, heavy vines
CB-1474	American elm	*Ulmus americana*	18	1	9	27	Good	
CB-1475	American elm	*Ulmus americana*	10	1	5	15	Fair	Heavy vines
CB-1477	American elm	*Ulmus americana*	10	1	5	15	Fair	Heavy vines
CB-1482	American elm	*Ulmus americana*	3	1	N/A	N/A	Standing Dead	
CB-1488	Eastern cottonwood	*Populus deltoides*	25	1	12.5	37.5	Good	Vines
CB-1489	American elm	*Ulmus americana*	14	1	N/A	N/A	Standing Dead	
CB-1498	Boxelder	*Acer negundo*	13	1	6.5	19.5	Fair	Lean vines
CB-1501	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Heavy lean, heavy vines
CB-1509	Boxelder	*Acer negundo*	7	1	3.5	10.5	Good	
CB-1513	Boxelder	*Acer negundo*	10	1	5	15	Fair	Lean, vines
CB-1514	Boxelder	*Acer negundo*	15	1	7.5	22.5	Good	
CB-1520	Boxelder	*Acer negundo*	13	1	6.5	19.5	Fair	Heavy vines, lean
CB-1521	Boxelder	*Acer negundo*	15	1	7.5	22.5	Fair	Heavy lean
CB-1527	Boxelder	*Acer negundo*	17	1	8.5	25.5	Poor	Trunk decay, missing leader
CB-1528	Boxelder	*Acer negundo*	11	1	5.5	16.5	Poor	Twin trunk, trunk cavity, vines
CB-1538	Boxelder	*Acer negundo*	19	1	9.5	28.5	Fair	Heavy lean, heavy vines
CB-1540	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Heavy vines
CB-1554	Boxelder	*Acer negundo*	21	1	10.5	31.5	Good	
CB-1783	American elm	*Ulmus americana*	5	1	N/A	N/A	Standing Dead	
CB-1785	American elm	*Ulmus americana*	8	1	4	12	Fair	Water sprouts, tree leaning on trunk
CB-1787	American sycamore	*Platanus occidentalis*	21	1	10.5	31.5	Fair	Vines on trunk
CB-1788	American sycamore	*Platanus occidentalis*	13	1	6.5	19.5	Fair	Vines in lower canopy, thin crown
CB-1790	American elm	*Ulmus americana*	14	1	7	21	Poor	Broken leader, lean, heavy vines
CB-1791	Green ash	*Fraxinus pennsylvanica*	21	1	N/A	N/A	Standing Dead	
CB-1792	American elm	*Ulmus americana*	8	1	4	12	Poor	Overtopped by vines
CB-1795	American elm	*Ulmus americana*	7	1	N/A	N/A	Standing Dead	
CB-1796	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Trunk wound
CB-1797	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Vines on upper trunk
CB-1798	American elm	*Ulmus americana*	8	1	4	12	Fair	Heavy vines, lean, thin canopy
CB-1799	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Thin canopy
CB-1801	Red maple	*Acer rubrum*	13, 12, 12	3	6.5	19.5	Good	Some included bark. Multistem 13 x 12 x 12
CB-1804	American elm	*Ulmus americana*	6	1	3	9	Fair	Lean
CB-1805	American elm	*Ulmus americana*	6	1	3	9	Fair	Thin canopy

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CB-1806	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Splits above DBH, included bark, thin crown
CB-1807	American elm	*Ulmus americana*	13, 6	2	6.5	19.5	Fair	Thin crown, dead 6" twin trunk
CB-1808	Red maple	*Acer rubrum*	17, 11, 11	3	8.5	25.5	Fair	Vines on upper trunk, included bark. Multistem 17 x 11 x 11
CB-1809	Eastern white pine	*Pinus strobus*	14	1	7	21	Fair	Dead wood, thin canopy
CB-1810	American sycamore	*Platanus occidentalis*	19	1	9.5	28.5	Fair	Vines on trunk
CB-1811	Red maple	*Acer rubrum*	12	1	6	18	Good	
CB-1812	American elm	*Ulmus americana*	11	1	5.5	16.5	Fair	Interfering crowns, dead wood
CB-1813	American elm	*Ulmus americana*	6	1	3	9	Poor	Dying crown, lean
CB-1814	American elm	*Ulmus americana*	10	1	5	15	Fair	Large vine in canopy
CB-1815	Green ash	*Fraxinus pennsylvanica*	5	1	N/A	N/A	Standing Dead	
CB-1816*	Swamp chestnut oak	*Quercus michauxii*	38	1	19	57	Good	Few vines
CB-1817	American elm	*Ulmus americana*	9	1	4.5	13.5	Poor	Vines on trunk, lean, dead lower branches
CB-1818	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Lean, water sprouts
CB-1819	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Vines on trunk, overtopped canopy
CB-1820	Red maple	*Acer rubrum*	12, 4	2	6	18	Fair	Vines on upper trunk, lean, dead 4" trunk. Twins 12 x 4
CB-1821	Red maple	*Acer rubrum*	20, 14	2	10	30	Good	Twins 20 x 14, some included bark
CB-1822	Red maple	*Acer rubrum*	10	1	5	15	Fair	Irregular trunk
CB-1823	Red maple	*Acer rubrum*	28	1	14	42	Fair	Vines on trunk, included bark, splits above DBH
CB-1824	American elm	*Ulmus americana*	23	1	11.5	34.5	Fair	Vines, lean
CB-1825	Red maple	*Acer rubrum*	22	1	11	33	Fair	Heavy vines on trunk
CB-1826	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Significant lean
CB-1827	American elm	*Ulmus americana*	8	1	4	12	Poor	Vines in crown, lean
CB-1828	American elm	*Ulmus americana*	13	1	6.5	19.5	Good	
CB-1830	American elm	*Ulmus americana*	10, 4	2	5	15	Fair	Large vine in canopy. Dead 4" twin trunk
CB-1832	American elm	*Ulmus americana*	7	1	3.5	10.5	Good	
CB-1833	Red maple	*Acer rubrum*	16, 3	2	8	24	Good	Twin trunks 16 x 3
CB-1834	Swamp chestnut oak	*Quercus michauxii*	6	1	3	9	Good	
CB-1835	Red maple	*Acer rubrum*	8	1	4	12	Good	
CB-1836	Red maple	*Acer rubrum*	15	1	7.5	22.5	Good	
CB-1837	American elm	*Ulmus americana*	12	1	6	18	Fair	Vines on trunk
CB-1838	American elm	*Ulmus americana*	12	1	6	18	Poor	Heavy vines, thin crown
CB-1840	American elm	*Ulmus americana*	11, 2	2	5.5	16.5	Fair	Vines on trunk, dying twin trunk. Twin trunks 11 x 2
CB-1841	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Thin crown, vines on trunk
CB-1843	American elm	*Ulmus americana*	5	1	2.5	7.5	Fair	Thin canopy
CB-1844	Boxelder	*Acer negundo*	14, 10	2	7	21	Poor	Large vines in canopy, broken leader, lean. Twin trunks 14 x 10
CB-1845	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Lean, water sprouts
CB-1846	American elm	*Ulmus americana*	19	1	9.5	28.5	Poor	Very heavy vines, dying branches
CB-1847	Northern red oak	*Quercus rubra*	7	1	3.5	10.5	Good	
CB-1848	Red maple	*Acer rubrum*	13	1	6.5	19.5	Fair	Many water sprouts
CB-1849	American elm	*Ulmus americana*	13	1	6.5	19.5	Fair	Vines on trunk
CB-1850	American elm	*Ulmus americana*	6	1	3	9	Fair	Interfering branches, vines on trunk
CB-1851	Red maple	*Acer rubrum*	11	1	5.5	16.5	Good	
CB-1852	Red maple	*Acer rubrum*	8	1	4	12	Poor	Dead crown, trunk sprouts
CB-1853	American elm	*Ulmus americana*	11	1	5.5	16.5	Poor	Heavy vines, thin canopy
CB-1854	Red maple	*Acer rubrum*	13	1	6.5	19.5	Fair	Lean, some vines in crown
CB-1856	American elm	*Ulmus americana*	12	1	6	18	Poor	Heavy vines, thin crown
CB-1857	Unknown		6	1	N/A	N/A	Standing Dead	
CB-1858	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Vines on trunk, thin crown
CB-1859	Black locust	*Robinia pseudoacacia*	19	1	N/A	N/A	Standing Dead	
CB-1860	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Heavy vines on trunk
CB-1862	Red maple	*Acer rubrum*	22	1	11	33	Fair	Heavy vines on trunk
CB-1863	Red maple	*Acer rubrum*	10	1	5	15	Fair	Lean
CB-1864	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
CB-1865	Red maple	*Acer rubrum*	8	1	4	12	Fair	Irregular trunk
CB-1866	Red maple	*Acer rubrum*	13	1	6.5	19.5	Poor	Very heavy vines in canopy
CB-1867	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Vines on trunk, trunk wound
CB-1868	Black locust	*Robinia pseudoacacia*	22, 13	2	N/A	N/A	Standing Dead	Twins 22 x 13
CB-1869	Red maple	*Acer rubrum*	15, 3	2	7.5	22.5	Fair	Vines on trunk. Twin trunks 15 x 3
CB-1870	Red maple	*Acer rubrum*	11	1	5.5	16.5	Fair	Vines on trunk

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CB-1871	Red maple	*Acer rubrum*	10	1	5	15	Fair	Vines on trunk
CB-1872	Red maple	*Acer rubrum*	20, 8, 7	3	10	30	Fair	Vines on trunk, dead 7" leader. Multistem 20 x 8 x 7
CB-1873	American elm	*Ulmus americana*	13	1	6.5	19.5	Fair	Lean, dead branches
CB-1874*	American sycamore	*Platanus occidentalis*	30	1	15	45	Good	
CB-1876	Red maple	*Acer rubrum*	16	1	8	24	Poor	Significant lean, roots coming out of ground
CB-1877	Red maple	*Acer rubrum*	9, 7	2	4.5	13.5	Fair	Vines on trunk. Twin trunks 9 x 7
CB-1878	Red maple	*Acer rubrum*	8	1	4	12	Fair	Some broken branches
CB-1879	American elm	*Ulmus americana*	14	1	7	21	Fair	Trunk wounds
CB-1880	American elm	*Ulmus americana*	12, 4	2	6	18	Poor	Heavy vines, significant lean. Twin trunks 12 x 4
CB-1881	Pin oak	*Quercus palustris*	9	1	4.5	13.5	Fair	Dead branches
CB-1882	Red maple	*Acer rubrum*	10	1	5	15	Good	Few vines
CB-1883	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Trunk wound, dead wood
CB-1884	Green ash	*Fraxinus pennsylvanica*	15	1	N/A	N/A	Standing Dead	
CB-1885	Unknown		15	1	N/A	N/A	Standing Dead	
CB-1886	Unknown		5	1	N/A	N/A	Standing Dead	
CB-1887	Red maple	*Acer rubrum*	16	1	8	24	Good	Vines on trunk, irregular trunk
CB-1888	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Vines on trunk, dead stump spout
CB-1889	Red maple	*Acer rubrum*	9, 7, 4	3	4.5	13.5	Fair	Vines on trunk, dead branches. Multistem 9 x 7 x 4
CB-1890	Black locust	*Robinia pseudoacacia*	9, 6	2	4.5	13.5	Fair	Included bark. Twins 9 x 6
CB-1891	American elm	*Ulmus americana*	17, 9	2	8.5	25.5	Poor	Crown almost dead. Twins 17 x 9
CB-1892	Red maple	*Acer rubrum*	11	1	5.5	16.5	Poor	Dead crown, water sprouts
CB-1893	Red maple	*Acer rubrum*	8, 8	2	4	12	Fair	Included bark, thin canopy. Twins 8 x 8
CB-1894	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Vines on trunk, small cavity at base
CB-1895	Red maple	*Acer rubrum*	11	1	5.5	16.5	Poor	Heavy vines, dead second trunk
CB-1897	Green ash	*Fraxinus pennsylvanica*	18, 17	2	N/A	N/A	Standing Dead	Twins 18 x 17
CB-1898	Black locust	*Robinia pseudoacacia*	9	1	4.5	13.5	Poor	Overtopped by vines, lean
CB-1899	American elm	*Ulmus americana*	5	1	2.5	7.5	Poor	Lean, heavy vines, overtopped
CB-1900	Red maple	*Acer rubrum*	17, 16, 11	3	5	15	Fair	Heavy vines. Multistem 17 x 16 x 11
CB-1901	Red maple	*Acer rubrum*	6	1	3	9	Fair	Vines on trunk
CB-1902	Unknown		21	1	N/A	N/A	Standing Dead	
CB-1903	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Good	
CB-1904	Black locust	*Robinia pseudoacacia*	11	1	5.5	16.5	Poor	Overtopped by vines
CB-1905	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Vines on trunk, water sprouts
CB-1906	Red maple	*Acer rubrum*	9, 8	2	4.5	13.5	Fair	Vines on trunk, included bark. Twins 9 x 8
CB-1907	Eastern redcedar	*Juniperus virginiana*	7	1	3.5	10.5	Poor	Overtopped by heavy vines
CB-1908	Red maple	*Acer rubrum*	16, 6, 5	3	5	15	Poor	Overtopped by vines. Multistem 10 x 6 x 5
CB-1909	Red maple	*Acer rubrum*	6	1	3	9	Fair	Vines on trunk
CB-1910	Black locust	*Robinia pseudoacacia*	12	1	6	18	Poor	Overtopped by vines
CB-1911	Red maple	*Acer rubrum*	7	1	N/A	N/A	Standing Dead	
CB-1912	Red maple	*Acer rubrum*	25, 7, 7, 6, 4	5	12.5	37.5	Fair	Vines on trunk, lean. Multistem 25 x 7 x 7 x 6 x 4
CB-1913	American elm	*Ulmus americana*	8	1	4	12	Fair	Vines on trunk
CB-1914	American elm	*Ulmus americana*	8	1	4	12	Fair	Dead branches, one sided
CB-1915	Eastern redbud	*Cercis canadensis*	8	1	4	12	Poor	Broken top
CB-1917	Unknown		6	1	N/A	N/A	Standing Dead	
CB-1919	American elm	*Ulmus americana*	5	1	2.5	7.5	Poor	Heavy vines in trunk, overtopped
CB-1920	Red maple	*Acer rubrum*	16, 6, 6, 5	4	8	24	Fair	Vines on trunk. Multistem 16 x 6 x 6 x 5
CB-1921	Red maple	*Acer rubrum*	8	1	4	12	Good	
CB-1922	American elm	*Ulmus americana*	6	1	3	9	Fair	Vines on trunk
CB-1923	Red maple	*Acer rubrum*	14	1	7	21	Good	Vine on lower trunk
CB-1924	Black locust	*Robinia pseudoacacia*	10	1	N/A	N/A	Standing Dead	
CB-1925	Black locust	*Robinia pseudoacacia*	15, 10	2	N/A	N/A	Standing Dead	Twins 15 x 10
CB-1926	Red maple	*Acer rubrum*	12	1	6	18	Fair	Vines on trunk
CB-1927	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Heavy vines on trunk, splits above DBH
CB-1928	Black locust	*Robinia pseudoacacia*	8	1	N/A	N/A	Standing Dead	
CB-1929	American elm	*Ulmus americana*	14	1	7	21	Fair	Vines on trunk
CB-1930	Red maple	*Acer rubrum*	8	1	4	12	Poor	Heavy vines in canopy

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CB-1931	American elm	*Ulmus americana*	17	1	8.5	25.5	Fair	Water sprouts, vines on trunk
CB-1932	White oak	*Quercus alba*	20	1	10	30	Good	Vines on trunk
CB-1933	American elm	*Ulmus americana*	6	1	3	9	Fair	vines on trunk
CB-1934	Cherry sp.	*Prunus sp.*	5	1	N/A	N/A	Standing Dead	
CB-1937	American sycamore	*Platanus occidentalis*	15	1	7.5	22.5	Poor	Large split in upper trunk
CB-1938	Red maple	*Acer rubrum*	14	1	7	21	Good	Vine on lower trunk
CB-1941	American elm	*Ulmus americana*	16	1	8	24	Poor	Very heavy vines
CB-1942	Red maple	*Acer rubrum*	9	1	4.5	13.5	Poor	Half of trunk dead
CB-1943	Black locust	*Robinia pseudoacacia*	8	1	4	12	Good	
CB-1944	Red maple	*Acer rubrum*	10	1	5	15	Good	
CB-1945	Red maple	*Acer rubrum*	7	1	3.5	10.5	Poor	One sided, overtopped, many dead branches
CB-1946	Boxelder	*Acer negundo*	10	1	5	15	Fair	Significant lean
CB-1947	American elm	*Ulmus americana*	10	1	5	15	Poor	Lean, overtopped by vines
CB-1950	Red maple	*Acer rubrum*	16	1	8	24	Fair	Vines on trunk, lean, one sided
CB-1953	American sycamore	*Platanus occidentalis*	13	1	6.5	19.5	Good	
CB-1955	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Some vines on trunk
CB-1956	American elm	*Ulmus americana*	18	1	N/A	N/A	Standing Dead	
CB-1958	Black locust	*Robinia pseudoacacia*	9	1	N/A	N/A	Standing Dead	
CB-1959	Black locust	*Robinia pseudoacacia*	15	1	7.5	22.5	Poor	Thin canopy, vines
CB-1960	Black cherry	*Prunus serotina*	14	1	7	21	Fair	Some vines on trunk
CB-1962	Red maple	*Acer rubrum*	12	1	6	18	Good	Slight lean
CB-1964	Black locust	*Robinia pseudoacacia*	9	1	N/A	N/A	Standing Dead	
CB-1965	American elm	*Ulmus americana*	5	1	2.5	7.5	Fair	Vines on lower branches
CB-1966	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Heavy vines on trunk
CB-1967	Unknown		6	1	N/A	N/A	Standing Dead	
CB-1968	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Scorched foliage, water sprouts
CB-1969	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Fair	Heavy vines on lower trunk
CB-1972	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	
CB-1978	Eastern redcedar	*Juniperus virginiana*	8	1	4	12	Fair	Vines on lower trunk
CB-1984	Black locust	*Robinia pseudoacacia*	28	1	14	42	Fair	Large broken branches
CB-1987	American elm	*Ulmus americana*	10	1	5	15	Fair	Heavy vines, lean
CB-1988	American elm	*Ulmus americana*	5	1	N/A	N/A	Standing Dead	
CB-1989	American elm	*Ulmus americana*	16	1	8	24	Fair	Twin trunk, heavy vines
CB-1990	Northern red oak	*Quercus rubra*	28	1	14	42	Good	Vine on trunk
CB-1991	Unknown		7	1	N/A	N/A	Standing Dead	
CB-1992	American elm	*Ulmus americana*	13	1	6.5	19.5	Poor	Very heavy vines in canopy
CB-1994	American elm	*Ulmus americana*	5	1	2.5	7.5	Poor	Overtopped by vines
CB-1995	Unknown		5	1	N/A	N/A	Standing Dead	
CB-1996	Unknown		10	1	N/A	N/A	Standing Dead	
CB-1999	Black cherry	*Prunus serotina*	6	1	3	9	Poor	Heavy lean, heavy vines
CB-2000	American elm	*Ulmus americana*	5	1	2.5	7.5	Poor	Heavy vines in canopy, significant lean
CB-2001	American sycamore	*Platanus occidentalis*	13	1	6.5	19.5	Fair	Water sprouts, vines on trunk
CB-2003	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Irregular growth form
CB-2006	American elm	*Ulmus americana*	11	1	5.5	16.5	Fair	Vines on trunk
CB-2010	American sycamore	*Platanus occidentalis*	15	1	7.5	22.5	Poor	Bark decay, vines on trunk, dying leader
CB-2013	American elm	*Ulmus americana*	11	1	5.5	16.5	Fair	Vines on trunk
CB-2014	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Fair	Vines on lower trunk
CB-2019	Red maple	*Acer rubrum*	6	1	3	9	Poor	Broken crown, overtopped by vines
CB-2020	American elm	*Ulmus americana*	23	1	11.5	34.5	Poor	Very heavy vines
CB-2021	Unknown		8	1	N/A	N/A	Standing Dead	
CB-2022	American elm	*Ulmus americana*	8	1	4	12	Fair	Heavy vines, lean
CB-2023	Boxelder	*Acer negundo*	11	1	5.5	16.5	Good	Minor vines
CB-2024	Eastern redcedar	*Juniperus virginiana*	6	1	3	9	Fair	Vines, dead branches
CB-2025	Eastern white pine	*Pinus strobus*	25	1	12.5	37.5	Fair	Vines in crown
CB-2026	Eastern redcedar	*Juniperus virginiana*	17	1	8.5	25.5	Fair	Multi stem, dead branches, vines
CB-2027	American elm	*Ulmus americana*	13	1	N/A	N/A	Standing Dead	
CB-2028	American elm	*Ulmus americana*	13	1	6.5	19.5	Poor	Heavy vines on trunk, significant lean, dead tree leaning on trunk
CB-2029	Unknown		12	1	N/A	N/A	Standing Dead	
CB-2030	American elm	*Ulmus americana*	10	1	5	15	Fair	Vines in crown
CB-2031	Red maple	*Acer rubrum*	20	1	10	30	Good	Slightly one sided
CB-2032	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Multistem, lean, vines
CB-2033	Black walnut	*Juglans nigra*	15	1	7.5	22.5	Fair	Dead tree leaning on trunk
CB-2034	White mulberry	*Morus alba*	10	1	5	15	Poor	Heavy vines, lean
CB-2035	Red maple	*Acer rubrum*	15	1	7.5	22.5	Fair	Heavy vines
CB-2036	American elm	*Ulmus americana*	14	1	7	21	Poor	Very heavy vines, lean, one sided

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CB-2037	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Fair	Heavy vines on trunk
CB-2038	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Heavy lean, vines
CB-2039	American elm	*Ulmus americana*	10	1	5	15	Poor	Heavy vines in canopy lean
CB-2040	American sycamore	*Platanus occidentalis*	27	1	13.5	40.5	Fair	Heavy vines on trunk, growing into culvert below
CB-2041	Mockernut hickory	*Carya tomentosa*	5	1	2.5	7.5	Fair	Irregular growth form
CB-2042	Eastern redcedar	*Juniperus virginiana*	6	1	3	9	Poor	Heavy lean, vines, dead wood
CB-2043	American elm	*Ulmus americana*	11	1	5.5	16.5	Poor	Heavy vines on trunk, significant lean
CB-2044	Eastern redcedar	*Juniperus virginiana*	8, 8	2	4	12	Poor	Twin trunk, heavy vines, lean, dead branches
CB-2045	American sycamore	*Platanus occidentalis*	10	1	5	15	Poor	Decaying bark on trunk, heavy vines
CB-2046	American elm	*Ulmus americana*	9	1	4.5	13.5	Poor	Heavy vines, heavy lean
CB-2047	Red maple	*Acer rubrum*	10	1	5	15	Good	
CB-2048	American elm	*Ulmus americana*	17, 15	2	8.5	25.5	Fair	Some water sprouts, larger trunk has a lean. Twins 17 x 15
CB-2049	Red maple	*Acer rubrum*	5	1	2.5	7.5	Poor	Heavy vines, lean
CB-2050	American sycamore	*Platanus occidentalis*	23	1	11.5	34.5	Fair	Vines on trunk, lean
CB-2051	Common persimmon	*Diospyros virginiana*	5	1	2.5	7.5	Poor	Large vines on trunk
CB-2052	American elm	*Ulmus americana*	6	1	N/A	N/A	Standing Dead	
CB-2053	Black locust	*Robinia pseudoacacia*	12	1	N/A	N/A	Standing Dead	
CB-2054	American sycamore	*Platanus occidentalis*	15	1	7.5	22.5	Fair	Large vine in canopy
CB-2055	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Fair	Heavy vines on trunk
CB-2056	Black walnut	*Juglans nigra*	11	1	5.5	16.5	Good	
CB-2057	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Twin trunk, included bark
CB-2058	Black locust	*Robinia pseudoacacia*	14	1	7	21	Fair	Vines, significant dead branches
CB-2059	Black locust	*Robinia pseudoacacia*	6	1	3	9	Poor	Heavy vines, dead wood
CB-2060	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Fair	Irregular trunk
CB-2061	Unknown		7	1	N/A	N/A	Standing Dead	
CB-2062	American elm	*Ulmus americana*	8	1	4	12	Poor	Heavy lean, broken leader, vines
CB-2063	Black locust	*Robinia pseudoacacia*	11	1	5.5	16.5	Fair	Severe lean, heavy vines
CB-2064	American elm	*Ulmus americana*	14	1	7	21	Fair	Vines on trunk and lower canopy
CB-2065	Black walnut	*Juglans nigra*	5, 5	2	2.5	7.5	Poor	Heavy vines in canopy. Twins 5 x 5
CB-2066	Scarlet oak	*Quercus coccinea*	19	1	9.5	28.5	Good	Minor vines
CB-2067	Boxelder	*Acer negundo*	8	1	4	12	Fair	Heavy lean
CB-2068	American elm	*Ulmus americana*	25	1	12.5	37.5	Fair	Some dead wood, sapsucker holes, vines on trunk
CB-2069	Eastern redcedar	*Juniperus virginiana*	5	1	2.5	7.5	Poor	Dead wood, vines
CB-2070	Red maple	*Acer rubrum*	27, 18	2	13.5	40.5	Fair	Vines on trunk. Twins 27 x 18
CB-2071	American elm	*Ulmus americana*	6	1	3	9	Poor	Heavy vines in canopy, lean
CB-2072	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Good	Vines on lower trunk
CB-2073	White oak	*Quercus alba*	16	1	8	24	Good	Vines
CB-2074	Swamp chestnut oak	*Quercus michauxii*	14	1	7	21	Good	
CB-2075	Swamp chestnut oak	*Quercus michauxii*	26	1	13	39	Excellent	
CB-2076	Red maple	*Acer rubrum*	14	1	7	21	Fair	Irregular trunk
CB-2077	Black locust	*Robinia pseudoacacia*	11	1	5.5	16.5	Poor	Dying crown, decaying bark
CB-2078	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Fair	Irregular trunk
CB-2079	American elm	*Ulmus americana*	8	1	4	12	Fair	Heavy lean
CB-2080	American elm	*Ulmus americana*	18	1	9	27	Fair	Vines on trunk, one sided
CB-2081	American beech	*Fagus grandifolia*	28	1	14	42	Fair	Some trunk decay
CB-2082	Unknown		13	1	N/A	N/A	Standing Dead	
CB-2083	Red maple	*Acer rubrum*	13	1	6.5	19.5	Good	Twin trunk
CB-2084	American sycamore	*Platanus occidentalis*	6	1	3	9	Fair	Significant lean
CB-2085	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Heavy lean
CB-2086	Unknown		6	1	N/A	N/A	Standing Dead	
CB-2087	Unknown		19	1	N/A	N/A	Standing Dead	
CB-2088	American elm	*Ulmus americana*	8	1	N/A	N/A	Standing Dead	
CB-2089	Black locust	*Robinia pseudoacacia*	6	1	N/A	N/A	Standing Dead	
CB-2090	Eastern redbud	*Cercis canadensis*	9	1	4.5	13.5	Poor	Heavy vines, dead leader
CB-2091*	Red maple	*Acer rubrum*	49	1	24.5	73.5	Poor	Heavy vines, one trunk dead. Splits above DBH
CB-2092	American elm	*Ulmus americana*	15	1	7.5	22.5	Fair	Heavy vines
CB-2093	Green ash	*Fraxinus pennsylvanica*	12	1	N/A	N/A	Standing Dead	
CB-2094	Black walnut	*Juglans nigra*	15	1	7.5	22.5	Good	Minor vines
CB-2095*	Pin oak	*Quercus palustris*	37	1	18.5	55.5	Good	Few broken branches
CB-2096	Bitternut hickory	*Carya cordiformis*	6	1	3	9	Good	
CB-2097	Green ash	*Fraxinus pennsylvanica*	9	1	4.5	13.5	Fair	Dead branches
CB-2098	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Heavy vines

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CB-2099	American elm	*Ulmus americana*	12	1	6	18	Fair	Heavy vines
CB-2100	American sycamore	*Platanus occidentalis*	22	1	11	33	Good	One sided
CB-2101	American elm	*Ulmus americana*	6	1	3	9	Poor	Heavy lean, heavy vines
CB-2102	Black walnut	*Juglans nigra*	10	1	5	15	Fair	Lean, dead wood
CB-2103	Unknown		11	1	N/A	N/A	Standing Dead	
CB-2104	Red maple	*Acer rubrum*	11	1	5.5	16.5	Fair	Multi stem, included bark
CB-2105	Red maple	*Acer rubrum*	21	1	10.5	31.5	Poor	Trunk decay, dead second trunk
CB-2106	Hophornbeam	*Ostrya virginiana*	12, 10	2	6	18	Fair	Vines on trunk. Twins 12 x 10
CB-2107	American elm	*Ulmus americana*	15	1	7.5	22.5	Fair	Lean
CB-2108	American elm	*Ulmus americana*	12	1	6	18	Fair	Lean
CB-2109	Black locust	*Robinia pseudoacacia*	12	1	N/A	N/A	Standing Dead	
CB-2110	American elm	*Ulmus americana*	8	1	4	12	Poor	Heavy vines, lean
CB-2111	Green ash	*Fraxinus pennsylvanica*	9	1	4.5	13.5	Fair	EAB infestation, dead branches
CB-2112	Red maple	*Acer rubrum*	6	1	3	9	Good	
CB-2113	American sycamore	*Platanus occidentalis*	16	1	8	24	Fair	Heavy vines on trunk
CB-2114	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Dead wood, heavy vines
CB-2115	American sycamore	*Platanus occidentalis*	14	1	7	21	Good	
CB-2116	Red maple	*Acer rubrum*	18, 13	2	9	27	Fair	Heavy vines on trunk, growing into culvert below. Twins 18 x 13
CB-2117	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Trunk wound, lean
CB-2118*	American sycamore	*Platanus occidentalis*	32	1	16	48	Poor	Vines in crown, large broken branches
CB-2119*	Red maple	*Acer rubrum*	33	1	16.5	49.5	Fair	Vines on trunk
CB-2120	Boxelder	*Acer negundo*	6	1	3	9	Good	Lean
CB-2121	American sycamore	*Platanus occidentalis*	6	1	3	9	Good	
CB-2122	Eastern redcedar	*Juniperus virginiana*	8	1	4	12	Poor	Very few leaves, vines in canopy
CB-2123	Unknown		18	1	N/A	N/A	Standing Dead	
CB-2124	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Heavy lean
CB-2125	Eastern redcedar	*Juniperus virginiana*	7	1	3.5	10.5	Poor	Significant dead wood, vines
CB-2126	American elm	*Ulmus americana*	12, 11	2	6	18	Fair	Lean, vines on trunk. Twins 12 x 11
CB-2127	Eastern redcedar	*Juniperus virginiana*	5	1	2.5	7.5	Poor	Heavy vines, dead wood
CB-2128	American sycamore	*Platanus occidentalis*	12	1	6	18	Fair	Vines on trunk, heavy lean
CB-2129	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Heavy vines, included bark
CB-2130	American elm	*Ulmus americana*	11	1	N/A	N/A	Standing Dead	
CB-2131	American elm	*Ulmus americana*	10	1	5	15	Fair	Heavy vines
CB-2132	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Water sprouts, vines on trunk
CB-2133	Bitternut hickory	*Carya cordiformis*	6	1	3	9	Fair	Leaf spots, some vines on trunk
CB-2134	Red maple	*Acer rubrum*	17	1	8.5	25.5	Good	Minor vines
CB-2135	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	Few vines on trunk
CB-2136	American sycamore	*Platanus occidentalis*	7	1	3.5	10.5	Poor	Irregular growth form, heavy vines in canopy
CB-2137	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
CB-2138	Boxelder	*Acer negundo*	8	1	4	12	Good	Twin trunk, vines
CB-2139	Boxelder	*Acer negundo*	14	1	7	21	Fair	Water sprouts, thin canopy
CB-2140	American sycamore	*Platanus occidentalis*	10	1	5	15	Fair	Lean
CB-2141	American sycamore	*Platanus occidentalis*	23	1	11.5	34.5	Poor	Very heavy vines, lean, very thin canopy
CB-2142	American sycamore	*Platanus occidentalis*	16	1	8	24	Fair	Heavy vines
CB-2143	Mockernut hickory	*Carya tomentosa*	15	1	7.5	22.5	Good	
CB-2144	American elm	*Ulmus americana*	10	1	5	15	Fair	Lean, vines on trunk
CB-2145*	Northern red oak	*Quercus rubra*	34	1	17	51	Good	Some vines on trunk
CB-2146	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Fair	Vines on trunk
CB-2147	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
CB-2148	Eastern redcedar	*Juniperus virginiana*	9	1	4.5	13.5	Good	Vines
CB-2149	Black walnut	*Juglans nigra*	10	1	5	15	Fair	Heavy vines
CB-2150	Boxelder	*Acer negundo*	10	1	5	15	Poor	Large wound in trunk with decay
CB-2151	Red maple	*Acer rubrum*	10	1	5	15	Fair	Heavy vines
CB-2152	Southern red oak	*Quercus falcata*	17	1	8.5	25.5	Good	
CB-2153	American elm	*Ulmus americana*	10	1	5	15	Poor	Heavy vines, heavy lean
CB-2154	Unknown		6	1	N/A	N/A	Standing Dead	
CB-2155	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Poor	Peeling bark
CB-2156	American elm	*Ulmus americana*	7	1	3.5	10.5	Poor	Lean, overtopped by vines in canopy
CB-2157	Black walnut	*Juglans nigra*	16	1	8	24	Fair	Vines on trunk
CB-2158	Unknown		23	1	N/A	N/A	Standing Dead	
CB-2159	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Lean
CB-2160	Red maple	*Acer rubrum*	19	1	9.5	28.5	Good	Some vines on trunk

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CB-2161	Green ash	*Fraxinus pennsylvanica*	19	1	N/A	N/A	Standing Dead	
CB-2162	Black walnut	*Juglans nigra*	11	1	5.5	16.5	Good	Irregular trunk, otherwise good
CB-2163	Black locust	*Robinia pseudoacacia*	12	1	6	18	Poor	Significant lean, vines on trunk, thin canopy
CB-2164	Eastern redcedar	*Juniperus virginiana*	5	1	2.5	7.5	Poor	Heavy vines, dead wood
CB-2165	Southern red oak	*Quercus falcata*	16	1	8	24	Good	
CB-2166	Green ash	*Fraxinus pennsylvanica*	21	1	N/A	N/A	Standing Dead	
CB-2167	Red maple	*Acer rubrum*	20	1	10	30	Fair	Water sprouts, included bark
CB-2168	Black walnut	*Juglans nigra*	9	1	4.5	13.5	Fair	Dead leader
CB-2169	Unknown		16	1	N/A	N/A	Standing Dead	
CB-2170*	American sycamore	*Platanus occidentalis*	46, 21	2	23	69	Good	Few vines on trunk. Very good condition for its size. Twins 46 x 21
CB-2171	Boxelder	*Acer negundo*	10	1	5	15	Fair	Irregular trunk
CB-2172	Eastern redbud	*Cercis canadensis*	5	1	2.5	7.5	Fair	Lean, vines
CB-2173	American elm	*Ulmus americana*	8	1	4	12	Poor	Heavy lean, heavy vines
CB-2174	Red maple	*Acer rubrum*	15	1	7.5	22.5	Fair	Heavy vines
CB-2175	Bitternut hickory	*Carya cordiformis*	9	1	4.5	13.5	Fair	Insect damage to leaves
CB-2176	Northern red oak	*Quercus rubra*	22	1	11	33	Good	Some dead wood
CB-2177	Eastern redcedar	*Juniperus virginiana*	9	1	4.5	13.5	Poor	Heavy vines, dead wood
CB-2178	American elm	*Ulmus americana*	9	1	4.5	13.5	Poor	Heavy lean, heavy vines
CB-2179	Eastern redcedar	*Juniperus virginiana*	16	1	8	24	Fair	Minor vines, dead branches
CB-2180*	American sycamore	*Platanus occidentalis*	33	1	16.5	49.5	Fair	Vines on trunk
CB-2181	Eastern cottonwood	*Populus deltoides*	14	1	7	21	Poor	Very heavy vines
CB-2182*	Northern red oak	*Quercus rubra*	30	1	15	45	Fair	Some dead wood, one sided, vines on trunk
CB-2183	Boxelder	*Acer negundo*	6	1	3	9	Poor	Trunk decay, dead leader
CB-2184	Boxelder	*Acer negundo*	10	1	5	15	Poor	Significant trunk damage, lean
CB-2185	Boxelder	*Acer negundo*	15	1	7.5	22.5	Fair	Heavy lean, vines
CB-2186	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Good	
CB-2187	American sycamore	*Platanus occidentalis*	17	1	8.5	25.5	Fair	Lean, one sided, vines on trunk
CB-2188	Black locust	*Robinia pseudoacacia*	14, 11	2	N/A	N/A	Standing Dead	Twins 14 x 11
CB-2189	Red maple	*Acer rubrum*	6	1	3	9	Fair	Vines in crown
CB-2190	Eastern cottonwood	*Populus deltoides*	21	1	10.5	31.5	Poor	Significant trunk damage, heavy vines
CB-2191	Black walnut	*Juglans nigra*	11	1	5.5	16.5	Poor	Heavy vines, broken crown
CB-2192	American elm	*Ulmus americana*	5	1	2.5	7.5	Good	
CB-2193	Red maple	*Acer rubrum*	23, 8	2	11.5	34.5	Fair	Vines in trunk. Twins 23 x 8
CB-2194	Unknown		13	1	N/A	N/A	Standing Dead	
CB-2195	American elm	*Ulmus americana*	9	1	4.5	13.5	Poor	Heavy vines, lean
CB-2196	Black locust	*Robinia pseudoacacia*	7	1	3.5	10.5	Fair	Heavy vines
CB-2197	Unknown		7	1	N/A	N/A	Standing Dead	
CB-2198	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Twin trunk, vines
CB-2199	White mulberry	*Morus alba*	11	1	5.5	16.5	Poor	Broken branches, many water sprouts, one leader broken
CB-2200	Unknown		18	1	N/A	N/A	Standing Dead	
CB-2201	Eastern redcedar	*Juniperus virginiana*	5	1	2.5	7.5	Fair	Vines, dead branches
CB-2202	Black locust	*Robinia pseudoacacia*	7	1	N/A	N/A	Standing Dead	
CB-2203	Red maple	*Acer rubrum*	12	1	6	18	Fair	Lean, one sided
CB-2204	Black locust	*Robinia pseudoacacia*	14	1	7	21	Poor	Trunk wound, very thin canopy
CB-2205	Eastern redcedar	*Juniperus virginiana*	9	1	N/A	N/A	Standing Dead	
CB-2206	American holly	*Ilex opaca*	5	1	2.5	7.5	Good	Slightly irregular trunk
CB-2207	Red maple	*Acer rubrum*	8, 4	2	4	12	Poor	Dead leader. Twins 8 x 4
CB-2208	Red maple	*Acer rubrum*	20	1	10	30	Poor	Heavy vines, bark decay, dead leader
CB-2209	American elm	*Ulmus americana*	7	1	N/A	N/A	Standing Dead	
CB-2210	Unknown		10	1	N/A	N/A	Standing Dead	
CB-2211	American sycamore	*Platanus occidentalis*	13	1	6.5	19.5	Good	
CB-2212	Red maple	*Acer rubrum*	8	1	4	12	Fair	Vines on branches
CB-2213	Black locust	*Robinia pseudoacacia*	13	1	6.5	19.5	Fair	Vines on trunk, trunk wound
CB-2214	Tuliptree	*Liriodendron tulipifera*	17	1	N/A	N/A	Standing Dead	
CB-2215	Red maple	*Acer rubrum*	18, 4	2	9	27	Fair	On steep slope, large dead branch. Twins 18 x 4
CB-2216	Green ash	*Fraxinus pennsylvanica*	7	1	3.5	10.5	Poor	Severe lean, very heavy vines
CB-2217	American elm	*Ulmus americana*	15	1	7.5	22.5	Fair	Vines on trunk
CB-2218	Eastern redcedar	*Juniperus virginiana*	8	1	4	12	Poor	Heavy vines, dead wood
CB-2219	Unknown		16	1	N/A	N/A	Standing Dead	
CB-2220	Eastern redcedar	*Juniperus virginiana*	15	1	7.5	22.5	Fair	Dead branches, vines
CB-2221	Eastern redcedar	*Juniperus virginiana*	8	1	4	12	Fair	Vines, dead branches
CB-2222	Unknown		6	1	N/A	N/A	Standing Dead	
CB-2223	Bitternut hickory	*Carya cordiformis*	9	1	4.5	13.5	Good	
CB-2224	Unknown		8	1	N/A	N/A	Standing Dead	
CB-2225	Red maple	*Acer rubrum*	10	1	5	15	Fair	Dead leader

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CB-2226	Black locust	*Robinia pseudoacacia*	26, 26	2	13	39	Poor	Twin trunk, heavy vines, dead wood
CB-2227	Red maple	*Acer rubrum*	7	1	3.5	10.5	Poor	Trunk cavity at base, dead leader
CB-2228	Black locust	*Robinia pseudoacacia*	10	1	5	15	Fair	Lean, dead branches
CB-2229*	Northern red oak	*Quercus rubra*	36	1	18	54	Fair	Vines on trunk
CB-2230	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Water sprouts
CB-2231	Northern red oak	*Quercus rubra*	8	1	4	12	Fair	Heavy vines
CB-2232	Scarlet oak	*Quercus coccinea*	27	1	13.5	40.5	Good	Minor vines
CB-2233	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Vines
CB-2234	White oak	*Quercus alba*	7	1	3.5	10.5	Good	Minor vines
CB-2235	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Vines
CB-2236	American elm	*Ulmus americana*	5	1	2.5	7.5	Good	
CB-2237	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Lean, some vines in canopy
CB-2238	Black locust	*Robinia pseudoacacia*	11	1	5.5	16.5	Fair	Lean, vines on trunk
CB-2239	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Vines on trunk, lean
CB-2240	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Lean, leaf spots
CB-2241	Black locust	*Robinia pseudoacacia*	12	1	6	18	Fair	Heavy vines on trunk, but canopy good
CB-2242	American elm	*Ulmus americana*	11	1	5.5	16.5	Fair	Heavy vines, dead branches
CB-2243	Red maple	*Acer rubrum*	8	1	4	12	Fair	Vines
CB-2244	Unknown		8	1	N/A	N/A	Standing Dead	
CB-2245	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Irregular growth
CB-2246	American sycamore	*Platanus occidentalis*	16	1	8	24	Fair	Vines, lean
CB-2247	American elm	*Ulmus americana*	10	1	5	15	Poor	Heavy vines, missing leader
CB-2248	American hornbeam	*Carpinus caroliniana*	5	1	2.5	7.5	Fair	Irregular growth form
CB-2249	Black cherry	*Prunus serotina*	6	1	3	9	Poor	Significant lean, overtopped by vines
CB-2250	Bitternut hickory	*Carya cordiformis*	15	1	N/A	N/A	Standing Dead	
CB-2251	Unknown		23	1	N/A	N/A	Standing Dead	
CB-2252	Black locust	*Robinia pseudoacacia*	16	1	8	24	Fair	Few vines in canopy
CB-2253	American elm	*Ulmus americana*	9	1	4.5	13.5	Poor	Heavy lean, few leaves in canopy, overtopped by vines
CB-2254	Northern red oak	*Quercus rubra*	13	1	6.5	19.5	Good	Minor vines
CB-2255	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Heavy lean, vines
CB-2256	Bitternut hickory	*Carya cordiformis*	13	1	N/A	N/A	Standing Dead	
CB-2257	Common hackberry	*Celtis occidentalis*	8	1	4	12	Good	
CB-2258	Unknown		6	1	N/A	N/A	Standing Dead	
CB-2259	Eastern redcedar	*Juniperus virginiana*	11	1	5.5	16.5	Poor	Heavy vines, dead wood
CB-2260	Bitternut hickory	*Carya cordiformis*	8	1	4	12	Fair	Vines on trunk, significant lean
CB-2261	Red maple	*Acer rubrum*	8	1	4	12	Good	
CB-2262	Bitternut hickory	*Carya cordiformis*	13	1	6.5	19.5	Good	
CB-2263	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Good	
CB-2264	Red maple	*Acer rubrum*	11, 4	2	5.5	16.5	Fair	One sided, lean. Twins 11 x 4
CB-2265	Common hackberry	*Celtis occidentalis*	8	1	4	12	Good	
CB-2266	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	
CB-2267	Unknown		5	1	N/A	N/A	Standing Dead	
CB-2268	Black walnut	*Juglans nigra*	11	1	5.5	16.5	Good	
CB-2269	Red maple	*Acer rubrum*	11	1	5.5	16.5	Fair	Vines
CB-2270	American elm	*Ulmus americana*	11	1	5.5	16.5	Fair	Heavy vines
CB-2271	Eastern redcedar	*Juniperus virginiana*	10	1	5	15	Fair	Dead branches, vines
CB-2272	Red maple	*Acer rubrum*	15	1	7.5	22.5	Fair	Vines
CB-2273	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Irregular trunk
CB-2274	American elm	*Ulmus americana*	8	1	4	12	Fair	Heavy lean
CB-2275	American elm	*Ulmus americana*	11	1	5.5	16.5	Poor	Heavy vines, some dead branches
CB-2276	Red maple	*Acer rubrum*	14	1	7	21	Good	Minor vines
CB-2277	Bitternut hickory	*Carya cordiformis*	7	1	3.5	10.5	Fair	Vines on trunk
CB-2278	Bitternut hickory	*Carya cordiformis*	17	1	8.5	25.5	Fair	Vines in canopy
CB-2279	Red maple	*Acer rubrum*	7, 6	2	3.5	10.5	Fair	Vines on trunk, lean. Twins 7 x 6
CB-2280	Black walnut	*Juglans nigra*	12	1	6	18	Fair	Heavy vines
CB-2281	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Fair	Vines on trunk, broken branches
CB-2282	Tuliptree	*Liriodendron tulipifera*	28	1	14	42	Good	Some vines on trunk
CB-2283	Bitternut hickory	*Carya cordiformis*	8	1	4	12	Fair	Vines on trunk, lean
CB-2284	Red maple	*Acer rubrum*	10	1	5	15	Fair	Multistem, included bark, dead wood
CB-2285	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Fair	Vines in crown
CB-2286	Bitternut hickory	*Carya cordiformis*	14	1	7	21	Good	
CB-2287	American sycamore	*Platanus occidentalis*	15	1	7.5	22.5	Good	
CB-2288	Black walnut	*Juglans nigra*	7	1	3.5	10.5	Fair	Thin canopy
CB-2289	Bitternut hickory	*Carya cordiformis*	11	1	5.5	16.5	Good	Interfering branches

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CB-2290	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	Thin canopy
CB-2291	Black locust	*Robinia pseudoacacia*	16	1	8	24	Poor	Heavy vines, scraggly
CB-2292	Tuliptree	*Liriodendron tulipifera*	7	1	3.5	10.5	Fair	Significant lean
CB-2293	Red maple	*Acer rubrum*	10	1	5	15	Good	
CB-2294	Red maple	*Acer rubrum*	17, 17	2	8.5	25.5	Fair	Twin trunk, minor vines, included bark
CB-2295	American sycamore	*Platanus occidentalis*	15	1	7.5	22.5	Good	
CB-2296	Eastern redcedar	*Juniperus virginiana*	11	1	5.5	16.5	Fair	Vines, dead branches
CB-2297	Red maple	*Acer rubrum*	12	1	6	18	Fair	Trunk wound
CB-2298	Scarlet oak	*Quercus coccinea*	19	1	9.5	28.5	Fair	Vines, dead branches
CB-2299	American elm	*Ulmus americana*	12	1	6	18	Fair	Heavy vines
CB-2300	Boxelder	*Acer negundo*	6	1	3	9	Poor	Overtopped by vines, broken leader
CB-2301	Unknown		21	1	N/A	N/A	Standing Dead	
CB-2302	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Good	
CB-2303	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Fair	Kink in trunk, vines
CB-2304	Black cherry	*Prunus serotina*	14, 14	2	7	21	Poor	Heavy vines, heavy lean, twin trunk
CB-2305	Bitternut hickory	*Carya cordiformis*	7	1	3.5	10.5	Good	
CB-2306	Green ash	*Fraxinus pennsylvanica*	14	1	N/A	N/A	Standing Dead	
CB-2307	Bitternut hickory	*Carya cordiformis*	11	1	5.5	16.5	Good	
CB-2308	American elm	*Ulmus americana*	14	1	7	21	Poor	Very heavy vines in canopy
CB-2309	Unknown		8	1	N/A	N/A	Standing Dead	Multistem
CB-2310	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Poor	Peeling and decaying bark
CB-2311	Unknown		20	1	N/A	N/A	Standing Dead	
CB-2312	American elm	*Ulmus americana*	11	1	5.5	16.5	Poor	Heavy vines, lean
CB-2313	Red maple	*Acer rubrum*	9	1	4.5	13.5	Poor	Heavy vines
CB-2314	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	Minor vines
CB-2315	American elm	*Ulmus americana*	6	1	3	9	Good	Minor vines
CB-2316	Unknown		6	1	N/A	N/A	Standing Dead	
CB-2317	Red maple	*Acer rubrum*	19, 14	2	9.5	28.5	Fair	Heavy vines on trunk, interfering branches. Twins 19 x 14
CB-2318	Tuliptree	*Liriodendron tulipifera*	28	1	14	42	Fair	Heavy vines
CB-2319	Bitternut hickory	*Carya cordiformis*	7	1	3.5	10.5	Poor	Overtopped by vines, dead leader
CB-2320	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	
CB-2321	Red maple	*Acer rubrum*	9	1	4.5	13.5	Poor	Heavy vines
CB-2322	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	
CB-2323	Tuliptree	*Liriodendron tulipifera*	21, 14, 8	3	10.5	31.5	Poor	Large trunk wound, weeping bark, heavy vines. Multistem 21 x 14 x 8
CB-2324	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Heavy vines
CB-2325	Unknown		12	1	N/A	N/A	Standing Dead	
CB-2326	American elm	*Ulmus americana*	11, 11	2	5.5	16.5	Fair	Vines on trunk. Twins 11 x 11
CB-2327	Tuliptree	*Liriodendron tulipifera*	27	1	13.5	40.5	Fair	Heavy vines on trunk
CB-2328	American sycamore	*Platanus occidentalis*	16	1	8	24	Fair	Heavy vines
CB-2329	Unknown		5	1	N/A	N/A	Standing Dead	
CB-2330	American elm	*Ulmus americana*	6	1	3	9	Fair	Some vines on trunk
CB-2331	American elm	*Ulmus americana*	18	1	9	27	Fair	Heavy vines
CB-2332	Black walnut	*Juglans nigra*	13	1	6.5	19.5	Fair	Thin canopy, lean
CB-2333	Red maple	*Acer rubrum*	14, 14	2	7	21	Poor	Twin trunk, dead leader, vines
CB-2334	American sycamore	*Platanus occidentalis*	12	1	6	18	Fair	Thin canopy
CB-2335	Black cherry	*Prunus serotina*	12	1	6	18	Fair	Vines
CB-2336	American elm	*Ulmus americana*	17	1	8.5	25.5	Fair	Heavy vines
CB-2337	Eastern redcedar	*Juniperus virginiana*	9	1	4.5	13.5	Fair	Vines, dead branches
CB-2338	Red maple	*Acer rubrum*	10	1	5	15	Poor	Heavy vines
CB-2339	American elm	*Ulmus americana*	8	1	4	12	Poor	Overtopped by vines
CB-2340	Green ash	*Fraxinus pennsylvanica*	18	1	9	27	Poor	Dying crown, vines on trunk
CB-2341	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	
CB-2342	Red maple	*Acer rubrum*	17	1	8.5	25.5	Fair	Trunk wound, vines
CB-2343	Unknown		12	1	N/A	N/A	Standing Dead	
CB-2344	White oak	*Quercus alba*	25	1	12.5	37.5	Fair	Heavy vines on trunk
CB-2345	Red maple	*Acer rubrum*	14	1	7	21	Good	Vines
CB-2346	Red maple	*Acer rubrum*	16	1	8	24	Fair	Multi stem, vines
CB-2347	Red maple	*Acer rubrum*	8	1	4	12	Poor	Heavy lean
CB-2348	American hornbeam	*Carpinus caroliniana*	9, 9	2	4.5	13.5	Poor	Twin trunk, dead secondary leader, cavity, vines
CB-2349	American elm	*Ulmus americana*	15	1	7.5	22.5	Poor	Heavy vines, dead leader
CB-2350	Boxelder	*Acer negundo*	6	1	3	9	Poor	Overtopping by vines
CB-2351	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Good	
CB-2352	Red maple	*Acer rubrum*	10	1	5	15	Fair	Heavy vines
CB-2353	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Minor vines, lean

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CB-2354	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
CB-2355	Eastern redcedar	*Juniperus virginiana*	7	1	3.5	10.5	Poor	Very heavy vines, dying canopy
CB-2356	Unknown		6	1	N/A	N/A	Standing Dead	
CB-2357	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Good	Minor vines
CB-2358	American elm	*Ulmus americana*	8	1	4	12	Good	
CB-2359	Black cherry	*Prunus serotina*	13	1	6.5	19.5	Poor	Very heavy vines, large dead branch
CB-2360	Tuliptree	*Liriodendron tulipifera*	7	1	3.5	10.5	Good	Minor vines
CB-2361	American sycamore	*Platanus occidentalis*	16	1	8	24	Good	
CB-2362	Northern red oak	*Quercus rubra*	17	1	8.5	25.5	Good	Minor vines
CB-2363	Blackgum	*Nyssa sylvatica*	14	1	7	21	Fair	Vines
CB-2364*	Tuliptree	*Liriodendron tulipifera*	30	1	15	45	Fair	Heavy vines on trunk
CB-2365	American elm	*Ulmus americana*	5	1	2.5	7.5	Poor	Overtopped by vines
CB-2366	Unknown		7, 7	2	N/A	N/A	Standing Dead	Twin trunk
CB-2367	Red maple	*Acer rubrum*	24	1	12	36	Fair	Multi stem, vines
CB-2368	Unknown		10, 10	2	N/A	N/A	Standing Dead	Twin trunk
CB-2369	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	
CB-2370	Eastern redcedar	*Juniperus virginiana*	12	1	N/A	N/A	Standing Dead	
CB-2371	Red maple	*Acer rubrum*	16, 16	2	8	24	Fair	Twin trunk, heavy vines
CB-2372	American sycamore	*Platanus occidentalis*	5	1	2.5	7.5	Fair	Irregular growth form
CB-2373	American sycamore	*Platanus occidentalis*	16	1	8	24	Fair	Vines on trunk,
CB-2374	American sycamore	*Platanus occidentalis*	14	1	7	21	Fair	Thin crown
CB-2375	Black walnut	*Juglans nigra*	15	1	7.5	22.5	Fair	Vines on trunk
CB-2376	Tuliptree	*Liriodendron tulipifera*	6, 5	2	3	9	Poor	Heavy vines in crown, overtopped. Twin trunks 6 x 5
CB-2377	Red maple	*Acer rubrum*	11, 11	2	5.5	16.5	Poor	Twin trunk, vines, included bark
CB-2378	American elm	*Ulmus americana*	6	1	3	9	Fair	Vines on trunk
CB-2379	American elm	*Ulmus americana*	10	1	5	15	Fair	Heavy vines, leaf scorch
CB-2380	Green ash	*Fraxinus pennsylvanica*	19	1	N/A	N/A	Standing Dead	
CB-2381	Unknown		7	1	N/A	N/A	Standing Dead	
CB-2382	Eastern redcedar	*Juniperus virginiana*	11	1	5.5	16.5	Poor	Heavy vines in crown
CB-2383	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Broken leader, lean
CB-2384	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	Minor vines
CB-2385	Common hackberry	*Celtis occidentalis*	5	1	2.5	7.5	Good	
CB-2386	American elm	*Ulmus americana*	12	1	6	18	Fair	Water sprouts, vines on trunk
CB-2387	Green ash	*Fraxinus pennsylvanica*	22	1	N/A	N/A	Standing Dead	
CB-2388	Red maple	*Acer rubrum*	9, 9	2	4.5	13.5	Poor	Twin trunk, heavy vines
CB-2389	American elm	*Ulmus americana*	12	1	6	18	Fair	Heavy vines
CB-2390	American elm	*Ulmus americana*	6	1	N/A	N/A	Standing Dead	
CB-2391	Eastern redcedar	*Juniperus virginiana*	18	1	9	27	Fair	Vines
CB-2392	Red maple	*Acer rubrum*	9	1	4.5	13.5	Poor	Very heavy vines on trunk
CB-2393	Eastern redcedar	*Juniperus virginiana*	8	1	4	12	Fair	Vines in crown
CB-2394	Southern red oak	*Quercus falcata*	10	1	5	15	Good	Minor vines
CB-2395	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Fair	Heavy vines
CB-2396	Black walnut	*Juglans nigra*	8	1	4	12	Poor	Very heavy vines
CB-2397*	Tuliptree	*Liriodendron tulipifera*	32	1	16	48	Good	Vines on lower trunk
CB-2398	Red maple	*Acer rubrum*	21	1	10.5	31.5	Good	Vines
CB-2399	American elm	*Ulmus americana*	7	1	3.5	10.5	Poor	Heavy vines, lean
CB-2400	American elm	*Ulmus americana*	11	1	5.5	16.5	Fair	Heavy vines
CB-2401	Eastern redbud	*Cercis canadensis*	5	1	2.5	7.5	Fair	Large dead branch
CB-2402	Black walnut	*Juglans nigra*	6	1	3	9	Good	
CB-2403	Black walnut	*Juglans nigra*	14	1	7	21	Fair	Multi stem, heavy vines
CB-2404	American elm	*Ulmus americana*	14	1	7	21	Poor	Overtopped by vines
CB-2405	American elm	*Ulmus americana*	7	1	3.5	10.5	Poor	Overtopped by vines, lean
CB-2406	Tuliptree	*Liriodendron tulipifera*	28	1	14	42	Fair	Heavy vines
CB-2407	Unknown		16	1	N/A	N/A	Standing Dead	
CB-2408	Black walnut	*Juglans nigra*	7	1	3.5	10.5	Fair	Heavy vines, lean
CB-2409	Red maple	*Acer rubrum*	16	1	8	24	Fair	Heavy vines
CB-2410	American hornbeam	*Carpinus caroliniana*	6	1	3	9	Fair	Vines in lower crown
CB-2411	Black walnut	*Juglans nigra*	8	1	4	12	Fair	Vines on trunk, lean
CB-2412	American elm	*Ulmus americana*	25	1	N/A	N/A	Standing Dead	Multi stem
CB-2413	Red maple	*Acer rubrum*	12, 11	2	6	18	Fair	Vines on trunk, some bark damage. Twins 12 x 11
CB-2414	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Poor	Heavy vines, lean
CB-2415	American elm	*Ulmus americana*	10	1	5	15	Poor	Vines in crown, water sprouts, dead leader
CB-2416	Boxelder	*Acer negundo*	8	1	4	12	Poor	Heavy vines, broken leader
CB-2417	Eastern redcedar	*Juniperus virginiana*	7	1	3.5	10.5	Poor	Vines in crown
CB-2418	Green ash	*Fraxinus pennsylvanica*	15	1	N/A	N/A	Standing Dead	
CB-2419	Black locust	*Robinia pseudoacacia*	15	1	7.5	22.5	Fair	Lean, some vines on trunk
CB-2420*	Tuliptree	*Liriodendron tulipifera*	30	1	15	45	Fair	Vines on upper trunk
CB-2421	Eastern redcedar	*Juniperus virginiana*	10	1	5	15	Poor	Thin crown, vines in crown
CB-2422	Black walnut	*Juglans nigra*	15	1	7.5	22.5	Fair	Heavy vines

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CB-2423	Black locust	*Robinia pseudoacacia*	9	1	4.5	13.5	Poor	Heavy vines, dead leader
CB-2424	Black walnut	*Juglans nigra*	12	1	6	18	Fair	Vines on trunk, lean
CB-2425	Black walnut	*Juglans nigra*	13	1	6.5	19.5	Fair	Lean, some vines on trunk
CB-2426	American holly	*Ilex opaca*	5	1	2.5	7.5	Fair	Heavy vines, lean
CB-2427	Black locust	*Robinia pseudoacacia*	9	1	4.5	13.5	Poor	Heavy vines
CB-2428	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Fair	Heavy vines
CB-2429	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Good	Minor vines
CB-2430	Unknown		13	1	N/A	N/A	Standing Dead	
CB-2431	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Vines, lean
CB-2432	Unknown		13	1	N/A	N/A	Standing Dead	
CB-2433	Red maple	*Acer rubrum*	16	1	8	24	Fair	Heavy vines
CB-2434	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Heavy vines
CB-2435	White mulberry	*Morus alba*	5	1	2.5	7.5	Poor	Heavy vines, heavy lean
CB-2436	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Fair	Heavy vines
CB-2437	Red maple	*Acer rubrum*	11	1	5.5	16.5	Fair	Lean, vines
CB-2438	Black locust	*Robinia pseudoacacia*	8	1	4	12	Poor	Heavy vines
CB-2439	Unknown		5	1	N/A	N/A	Standing Dead	
CB-2440	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Heavy vines
CB-2441	Boxelder	*Acer negundo*	7	1	3.5	10.5	Poor	Dead leader, heavy vines
CB-2442	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Heavy vines
CB-2443	American elm	*Ulmus americana*	8	1	4	12	Poor	Heavy vines, heavy lean
CB-2444	Pin oak	*Quercus palustris*	15	1	7.5	22.5	Good	Pruning
CB-2445	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Poor	Heavy vines, dying crown
CB-2446	Red maple	*Acer rubrum*	16	1	8	24	Poor	Significant trunk wounds, vines
CB-2447	Black locust	*Robinia pseudoacacia*	10	1	5	15	Poor	Dead leader, heavy vines
CB-2448	Black locust	*Robinia pseudoacacia*	13	1	6.5	19.5	Poor	Heavy vines, lean
CB-2449	Unknown		10	1	N/A	N/A	Standing Dead	
CB-2450	Black locust	*Robinia pseudoacacia*	12	1	6	18	Poor	Heavy vine, heavy lean
CB-2451	Black locust	*Robinia pseudoacacia*	15	1	7.5	22.5	Poor	Heavy vines, heavy lean
CB-2452	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Fair	Heavy vines
CB-2453	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Good	
CB-2454	Red maple	*Acer rubrum*	17	1	8.5	25.5	Fair	Splits above DBH, vines
CB-2455	Red maple	*Acer rubrum*	12	1	6	18	Fair	Poor growth form
CB-2456	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Heavy vines
CB-2457	American elm	*Ulmus americana*	11	1	5.5	16.5	Poor	Heavy vines, lean
CB-2458	Red maple	*Acer rubrum*	14	1	7	21	Fair	Heavy vines
CB-2459	Red maple	*Acer rubrum*	15	1	7.5	22.5	Good	
CB-2460	Unknown		9	1	N/A	N/A	Standing Dead	
CB-2461	Southern red oak	*Quercus falcata*	28	1	14	42	Fair	Heavy lean, vines
CB-2462	Red maple	*Acer rubrum*	9	1	4.5	13.5	Poor	Dead secondary leader, poor growth form
CB-2463	Red maple	*Acer rubrum*	10	1	5	15	Fair	Vines
CB-2464	Red maple	*Acer rubrum*	15	1	7.5	22.5	Fair	Heavy vines
CB-2465	Red maple	*Acer rubrum*	12	1	6	18	Fair	Vines
CB-2466	Southern red oak	*Quercus falcata*	19	1	9.5	28.5	Fair	Vines
CB-2467	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Heavy vines
CB-2468	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Heavy vines, dead leader
CB-2469	Unknown		6	1	N/A	N/A	Standing Dead	
CB-2470	Red maple	*Acer rubrum*	9, 9	2	4.5	13.5	Fair	Twin trunk, included bark
CB-2471	American hornbeam	*Carpinus caroliniana*	7, 7	2	3.5	10.5	Fair	Twin trunk, vines, trunk wound
CB-2472	Black locust	*Robinia pseudoacacia*	14	1	7	21	Poor	Heavy vines, dead wood
CB-2473	Black locust	*Robinia pseudoacacia*	18	1	9	27	Poor	Heavy lean, heavy vines
CB-2474	Red maple	*Acer rubrum*	13	1	6.5	19.5	Fair	Multistem, vines
CB-2475	Red maple	*Acer rubrum*	14	1	7	21	Poor	Vines, significant trunk wound
CB-2476	Red maple	*Acer rubrum*	13	1	6.5	19.5	Poor	Heavy vines, thin crown
CB-2477	Red maple	*Acer rubrum*	11	1	5.5	16.5	Fair	Heavy vines
CB-2478	Black locust	*Robinia pseudoacacia*	15	1	7.5	22.5	Poor	Heavy vines, dead leader
CB-2479	Unknown		16	1	N/A	N/A	Standing Dead	
CB-2480*	Tuliptree	*Liriodendron tulipifera*	34	1	17	51	Poor	Significant trunk cavity, decay
CB-2481	Unknown		10	1	N/A	N/A	Standing Dead	
CB-2482	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Good	
CB-2483	Red maple	*Acer rubrum*	6	1	3	9	Fair	Vines, lean
CB-2484	Unknown		13	1	N/A	N/A	Standing Dead	
CB-2485	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	Minor vines
CB-2486	Unknown		10	1	N/A	N/A	Standing Dead	
CB-2487	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Fair	Vines
CB-2488	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
CB-2489	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Fair	Heavy vines
CB-2490	Swamp chestnut oak	*Quercus michauxii*	6	1	3	9	Poor	Trunk decay, heavy vines
CB-2491	Black locust	*Robinia pseudoacacia*	16	1	8	24	Poor	Heavy vines, dead wood
CB-2492	Black cherry	*Prunus serotina*	5	1	2.5	7.5	Fair	Heavy vines, heavy lean
CB-2493	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Lean, vines
CB-2494	Red maple	*Acer rubrum*	10	1	5	15	Fair	Vines

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CB-2495	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
CB-2496	American sycamore	*Platanus occidentalis*	23	1	11.5	34.5	Good	
CB-2497*	Willow oak	*Quercus phellos*	30	1	15	45	Fair	Heavy vines
CB-2498	White oak	*Quercus alba*	19	1	9.5	28.5	Fair	Vines
CB-2499	Black locust	*Robinia pseudoacacia*	6	1	3	9	Poor	Lean, dead leader
CB-2500	Unknown		20	1	N/A	N/A	Standing Dead	
CB-2501	American elm	*Ulmus americana*	15	1	7.5	22.5	Good	Minor vines
CB-2502	American elm	*Ulmus americana*	7	1	3.5	10.5	Poor	Lean, vines
CB-2503	Red maple	*Acer rubrum*	15, 15	2	7.5	22.5	Good	Twin trunk, included bark
CB-2504	Black locust	*Robinia pseudoacacia*	9	1	4.5	13.5	Poor	Heavy vines, dead wood
CB-2505	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Vines
CB-2506	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Vines
CB-2507	American hornbeam	*Carpinus caroliniana*	7	1	3.5	10.5	Fair	Trunk wound
CB-2508	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	Twin trunk
CB-2509	American sycamore	*Platanus occidentalis*	8	1	4	12	Fair	Heavy vines
CB-2510*	Tuliptree	*Liriodendron tulipifera*	36	1	18	54	Fair	Vines, dead branches
CB-2511	Red maple	*Acer rubrum*	8, 8	2	4	12	Good	Twin trunk
CB-2512	Red maple	*Acer rubrum*	11	1	5.5	16.5	Good	Minor vines
CB-2513	Unknown		17	1	N/A	N/A	Standing Dead	
CB-2514*	Eastern white pine	*Pinus strobus*	32	1	16	48	Good	Minor vines
CB-2515	Unknown		7	1	N/A	N/A	Standing Dead	
CB-2516	Red maple	*Acer rubrum*	15	1	7.5	22.5	Good	Minor vines
CB-2517	Black cherry	*Prunus serotina*	14	1	7	21	Fair	Lean, heavy vines
CB-2518	Red maple	*Acer rubrum*	11	1	5.5	16.5	Fair	Heavy vines
CB-2519	American sycamore	*Platanus occidentalis*	11	1	5.5	16.5	Good	Vines
CB-2520	American sycamore	*Platanus occidentalis*	8	1	4	12	Good	
CB-2521	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Good	
CB-2522	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
CB-2523	American sycamore	*Platanus occidentalis*	10	1	N/A	N/A	Standing Dead	
CB-2524	Red maple	*Acer rubrum*	14	1	7	21	Good	
CB-2525	Red maple	*Acer rubrum*	15	1	7.5	22.5	Good	
CB-2526	Red maple	*Acer rubrum*	17	1	8.5	25.5	Good	Multistem
CB-2527	American sycamore	*Platanus occidentalis*	14	1	7	21	Good	
CB-2528	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Fair	Minor vines, dead branches
CB-2529	Red maple	*Acer rubrum*	16	1	8	24	Good	
CB-2530	Red maple	*Acer rubrum*	12	1	6	18	Good	
CB-2531	Red maple	*Acer rubrum*	11	1	5.5	16.5	Fair	Vines, twin trunk
CB-2532	Red maple	*Acer rubrum*	14	1	7	21	Good	
CB-2533	American elm	*Ulmus americana*	11	1	5.5	16.5	Fair	Vines, lean
CB-2534	Red maple	*Acer rubrum*	14	1	7	21	Good	Minor vines
CB-2535	White oak	*Quercus alba*	24	1	12	36	Fair	Heavy vines
CB-2536	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	Minor vines
CB-2537	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	Minor vines
CB-2538	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
CB-2539	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Heavy lean
CB-2540	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Heavy vines
CB-2541	Black oak	*Quercus velutina*	9	1	4.5	13.5	Good	
CB-2542	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Fair	Vines
CB-2543	Unknown		6	1	N/A	N/A	Standing Dead	
CB-2544	Red maple	*Acer rubrum*	6	1	3	9	Poor	Heavy vines, dead leader
CB-2545	Red maple	*Acer rubrum*	17	1	8.5	25.5	Good	Minor vines
CB-2546	Eastern white pine	*Pinus strobus*	27	1	13.5	40.5	Fair	Significant dead branches, vines
CB-2547	Red maple	*Acer rubrum*	13	1	6.5	19.5	Good	
CB-2548	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Good	
CB-2549	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	
CB-2550	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Fair	Heavy vines
CB-2551	Black locust	*Robinia pseudoacacia*	16	1	8	24	Poor	Heavy vines, lean
CB-2552	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Heavy vines
CB-2553	Unknown		15	1	N/A	N/A	Standing Dead	
CB-2554	Unknown		14	1	N/A	N/A	Standing Dead	
CB-2555	Red maple	*Acer rubrum*	21	1	10.5	31.5	Good	
CB-2556	American elm	*Ulmus americana*	13	1	6.5	19.5	Fair	Heavy vines
CB-2557	American elm	*Ulmus americana*	6	1	3	9	Fair	Vines
CB-2558	American elm	*Ulmus americana*	6	1	3	9	Fair	Vines
CB-2559	American sycamore	*Platanus occidentalis*	14	1	7	21	Fair	Heavy vines
CB-2560	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Dead branches
CB-2561	Red maple	*Acer rubrum*	14	1	7	21	Fair	Dead secondary leader
CB-2562	American elm	*Ulmus americana*	18	1	9	27	Fair	Heavy vines
CB-2563	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Fair	Heavy lean
CB-2564	Red maple	*Acer rubrum*	13	1	6.5	19.5	Good	
CB-2565	Red maple	*Acer rubrum*	13	1	6.5	19.5	Good	
CB-2566	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CB-2567	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	Minor vines
CB-2568	Red maple	*Acer rubrum*	10	1	5	15	Good	
CB-2569	Eastern redcedar	*Juniperus virginiana*	11	1	5.5	16.5	Good	
CB-2570	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Dead leader
CB-2571	American elm	*Ulmus americana*	14	1	7	21	Fair	Heavy vines, lean
CB-2572	American beech	*Fagus grandifolia*	18	1	9	27	Fair	Large trunk wound
CB-2573	Red maple	*Acer rubrum*	18	1	9	27	Good	
CB-2574	Red maple	*Acer rubrum*	8	1	4	12	Fair	Heavy vines
CB-2575	American beech	*Fagus grandifolia*	22	1	11	33	Good	
CB-2576	Black locust	*Robinia pseudoacacia*	9	1	4.5	13.5	Fair	Heavy vines, lean
CB-2577	Tuliptree	*Liriodendron tulipifera*	28	1	14	42	Fair	Heavy vines
CB-2578	Black walnut	*Juglans nigra*	5	1	2.5	7.5	Fair	Heavy lean, heavy vines
CB-2579	Red maple	*Acer rubrum*	8	1	4	12	Poor	Severe trunk decay
CB-2580	Red maple	*Acer rubrum*	11, 11	2	5.5	16.5	Fair	Twin trunk, dead wood
CB-2581	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	
CB-2582*	Tuliptree	*Liriodendron tulipifera*	36	1	18	54	Fair	Heavy vines, poor growth form
CB-2583	Boxelder	*Acer negundo*	9	1	4.5	13.5	Poor	Heavy vines, lean
CB-2584	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Good	
CB-2585	Common hackberry	*Celtis occidentalis*	7	1	3.5	10.5	Fair	Vines, lean
CB-2586	Red maple	*Acer rubrum*	13	1	6.5	19.5	Fair	Heavy vines
CB-2587	Red maple	*Acer rubrum*	16	1	8	24	Fair	Heavy vines
CB-2588	Common hackberry	*Celtis occidentalis*	7	1	3.5	10.5	Fair	Vines, lean
CB-2589	Unknown		9	1	N/A	N/A	Standing Dead	
CB-2590	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Poor	Poor growth form
CB-2591	Red maple	*Acer rubrum*	5	1	2.5	7.5	Poor	Heavy vines, undercut roots
CB-2592*	Tuliptree	*Liriodendron tulipifera*	35	1	17.5	52.5	Good	Minor vines
CB-2593	Black walnut	*Juglans nigra*	6	1	3	9	Fair	Heavy vines
CB-2594	Red maple	*Acer rubrum*	17	1	8.5	25.5	Fair	Heavy vines
CB-2595	Red maple	*Acer rubrum*	18	1	9	27	Fair	Heavy vines
CB-2596	Boxelder	*Acer negundo*	13	1	6.5	19.5	Poor	Dead leader
CB-2597	Black locust	*Robinia pseudoacacia*	9	1	4.5	13.5	Poor	Significant trunk decay
CB-2598	Black walnut	*Juglans nigra*	14	1	7	21	Fair	Heavy vines
CB-2599	American elm	*Ulmus americana*	9	1	4.5	13.5	Poor	Heavy vines, poor growth form
CB-2600	Boxelder	*Acer negundo*	16	1	8	24	Fair	Heavy vines
CB-2601*	American sycamore	*Platanus occidentalis*	31	1	15.5	46.5	Fair	Heavy vines
CB-2602	Eastern redcedar	*Juniperus virginiana*	6	1	3	9	Fair	Heavy vines
CB-2603	Black walnut	*Juglans nigra*	8	1	4	12	Poor	Heavy vines, dead wood, lean
CB-2604	Red maple	*Acer rubrum*	13	1	6.5	19.5	Fair	Heavy vines
CB-2605	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Fair	Heavy vines
CB-2606	Sassafras	*Sassafras albidum*	17	1	8.5	25.5	Poor	Heavy vines, poor growth form
CB-2607	Black walnut	*Juglans nigra*	8	1	4	12	Poor	Heavy vines, dead leader
CB-2608	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Vines
CB-2609	Unknown		15	1	N/A	N/A	Standing Dead	
CB-2610	Unknown		20	1	N/A	N/A	Standing Dead	
CB-2611	Sassafras	*Sassafras albidum*	10	1	5	15	Fair	Heavy vines
CB-2612	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Fair	Vines
CB-2613	Black locust	*Robinia pseudoacacia*	5	1	2.5	7.5	Poor	Unusual growth form, lean, dying
CB-2614	American sycamore	*Platanus occidentalis*	17	1	8.5	25.5	Fair	Heavy vines
CB-2615	Boxelder	*Acer negundo*	8	1	4	12	Fair	Lean
CB-2616	Red maple	*Acer rubrum*	16	1	8	24	Poor	Vines, minor trunk wound, dead leader
CB-2617	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Poor	Heavy vines into the canopy
CB-2618	Black locust	*Robinia pseudoacacia*	5	1	2.5	7.5	Fair	Heavy vines
CB-2619	Unknown		5	1	N/A	N/A	Standing Dead	
CB-2620	American elm	*Ulmus americana*	16	1	8	24	Poor	Heavy vines, heavy lean
CB-2621*	Pin oak	*Quercus palustris*	30	1	15	45	Good	
CB-2622	Black locust	*Robinia pseudoacacia*	5	1	2.5	7.5	Fair	Heavy vines
CB-2623	American sycamore	*Platanus occidentalis*	18	1	9	27	Fair	Heavy vines
CB-2624	Scarlet oak	*Quercus coccinea*	20	1	10	30	Good	
CB-2625	Red maple	*Acer rubrum*	10	1	5	15	Fair	Vines
CB-2626	American hornbeam	*Carpinus caroliniana*	6	1	3	9	Fair	Vines, lean
CB-2627	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Poor	Severe trunk decay
CB-2628	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Poor	Severe trunk decay
CB-2629	Tuliptree	*Liriodendron tulipifera*	5	1	2.5	7.5	Fair	Heavy vines
CB-2630	Eastern redcedar	*Juniperus virginiana*	8	1	4	12	Fair	Unusual growth form
CB-2631	White mulberry	*Morus alba*	6	1	3	9	Poor	Heavy vines, poor growth form
CB-2632	Black walnut	*Juglans nigra*	18	1	9	27	Fair	Heavy vines
CB-2633	American elm	*Ulmus americana*	27, 27	2	13.5	40.5	Fair	Twin trunk, heavy vines
CB-2634	Pin oak	*Quercus palustris*	28	1	14	42	Fair	Dead leader, recovering
CB-2635	American sycamore	*Platanus occidentalis*	17	1	8.5	25.5	Good	
CB-2636	American sycamore	*Platanus occidentalis*	17	1	8.5	25.5	Good	
CB-2637	Red maple	*Acer rubrum*	20	1	10	30	Good	

*INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
CB-2638	Red maple	*Acer rubrum*	20	1	10	30	Good	Multistem
CB-2639	American sycamore	*Platanus occidentalis*	14	1	7	21	Good	
CB-2640	Red maple	*Acer rubrum*	12	1	6	18	Fair	Multistem, included bark
CB-2641	American sycamore	*Platanus occidentalis*	9	1	4.5	13.5	Fair	Kink in trunk
CB-2642	Unknown		8	1	N/A	N/A	Standing Dead	Twin trunks
CB-2643	Eastern redcedar	*Juniperus virginiana*	13	1	6.5	19.5	Fair	One sided branching
CB-2644	Green ash	*Fraxinus pennsylvanica*	10	1	5	15	Poor	Main leader dead, water sprouting
CB-2645	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Fair	Vines
CB-2646	Boxelder	*Acer negundo*	12	1	6	18	Poor	Lean, heavy vines
CB-2647	American sycamore	*Platanus occidentalis*	15	1	7.5	22.5	Poor	Heavy vines, lean
CB-2648	Common hackberry	*Celtis occidentalis*	10	1	5	15	Fair	Heavy lean
CB-2649	Common hackberry	*Celtis occidentalis*	9	1	4.5	13.5	Fair	Heavy vines
CB-2650	Boxelder	*Acer negundo*	5	1	2.5	7.5	Good	
CB-2651	American elm	*Ulmus americana*	7	1	3.5	10.5	Fair	Vines
CB-2652	Common hackberry	*Celtis occidentalis*	20	1	10	30	Good	
CB-2653	Unknown		8	1	N/A	N/A	Standing Dead	
CB-2654	Common hackberry	*Celtis occidentalis*	13	1	6.5	19.5	Fair	Heavy vines
CB-2655	Common hackberry	*Celtis occidentalis*	13, 13	2	6.5	19.5	Fair	Twin trunk, heavy vines
CB-2656	Black walnut	*Juglans nigra*	15	1	7.5	22.5	Good	Minor vines
CB-2657	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Good	
CB-2658	Boxelder	*Acer negundo*	12	1	6	18	Fair	Heavy lean

*INDICATES SPECIMEN TREE

Supplemental Draft
Environmental Impact Statement and
Updated Draft Section 4(f) Evaluation

APPENDIX H

ATTACHMENT B: NATIONAL PARK SERVICE TREE INVENTORY MAPS AND TABLES, GEORGE WASHINGTON MEMORIAL PARKWAY

George Washington Memorial Parkway



PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


The information shown is for the purpose of determining cost estimates and environmental impacts and is subject to change during the final phase. Any reliance upon these plans is made with full understanding of its draft status. Environmental impacts are based on the proposed limits of disturbance.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 MANAGED LANES STUDY 270

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | KEY SHEET

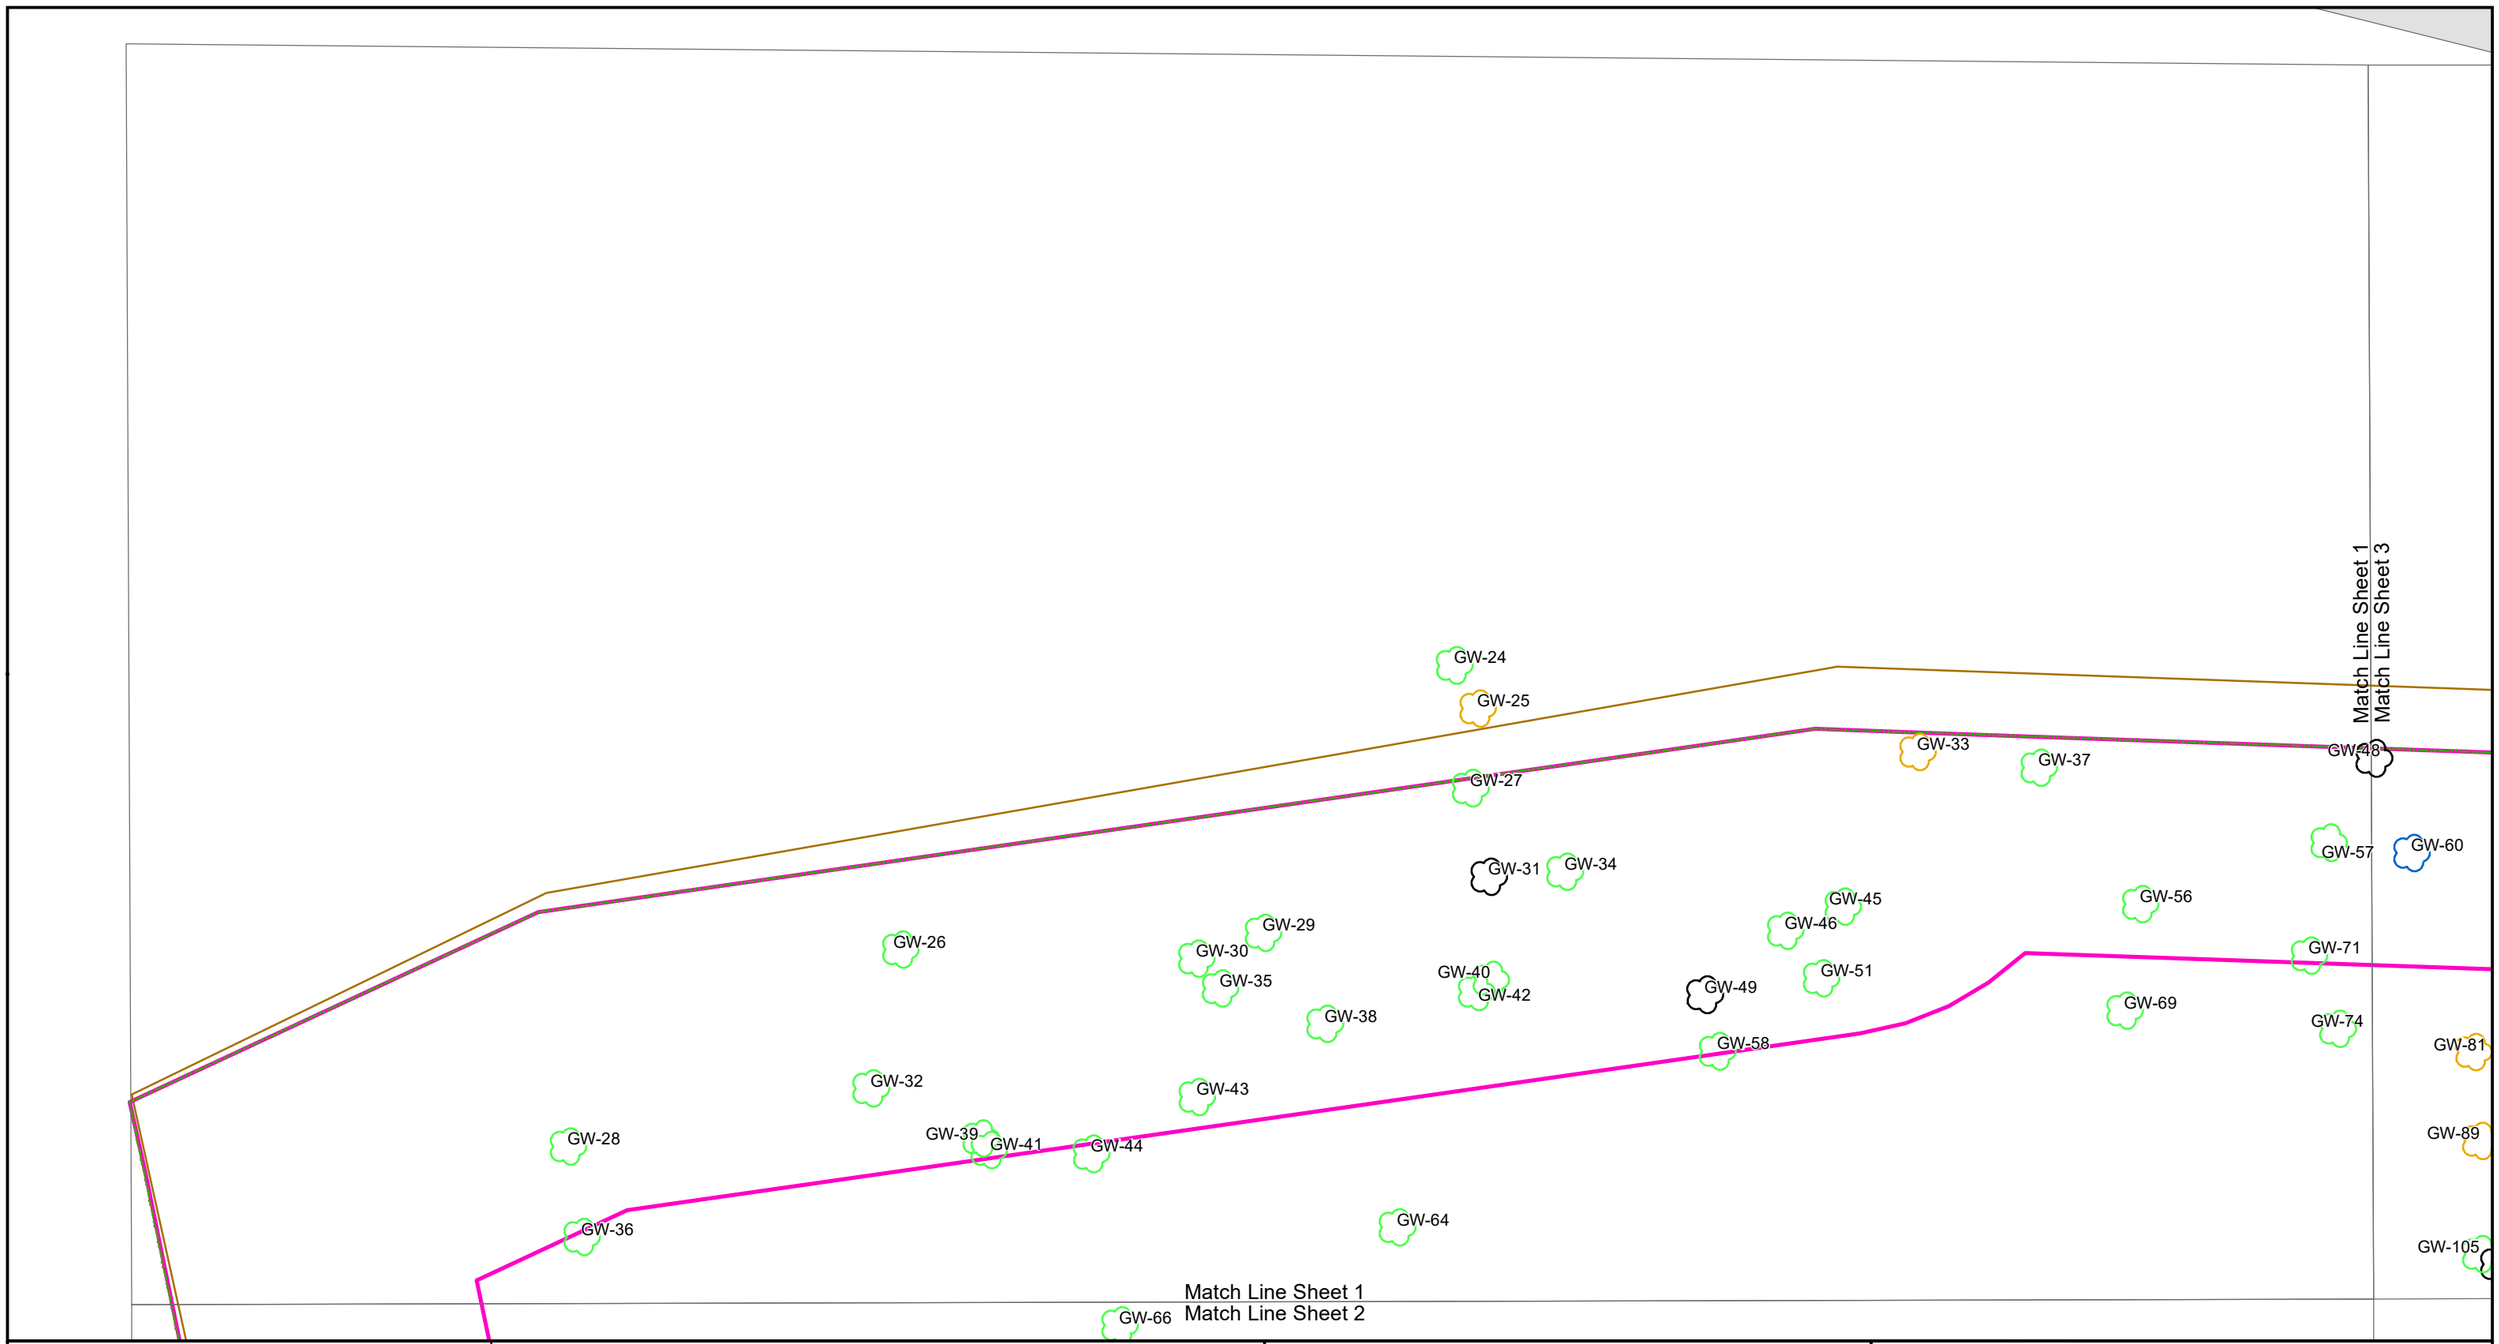

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 MANAGED LANES STUDY 270

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021

Match Line Sheet 1
Match Line Sheet 2

GW-105
GW-107
GW-66
GW-53
GW-104
GW-121
GW-151
GW-173
GW-185

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees

- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021

I-495 Capital Beltway

Match Line Sheet 1
Match Line Sheet 3

Match Line Sheet 3
Match Line Sheet 4

GW-50
GW-54
GW-48
GW-55
GW-62
GW-73
GW-83
GW-86
GW-106
GW-109
GW-111
GW-116
GW-130
GW-57
GW-60
GW-63
GW-68
GW-70
GW-78
GW-93
GW-97
GW-100
GW-102
GW-103
GW-117
GW-139
GW-92
GW-120
GW-84
GW-101
GW-138
GW-137
GW-71
GW-75
GW-76
GW-79
GW-91
GW-94
GW-108
GW-114
GW-115
GW-122
GW-125
GW-132
GW-129
GW-128
GW-123
GW-144
GW-148
GW-146
GW-74
GW-90
GW-99
GW-88
GW-98
GW-81
GW-95
GW-134
GW-142
GW-157
GW-89
GW-149
GW-200
GW-170
GW-105
GW-107

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees

- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | SHEET NO. 3 OF 51

I-495 Capital Beltway

Match Line Sheet 3
Match Line Sheet 4

Match Line Sheet 4
Match Line Sheet 5

Match Line Sheet 4
Match Line Sheet 6

GW-130 GW-139 GW-140 GW-150 GW-154 GW-160 GW-166 GW-168 GW-171 GW-175 GW-177 GW-178 GW-181 GW-182 GW-186 GW-188 GW-189 GW-191 GW-193 GW-195 GW-197 GW-198 GW-200 GW-202 GW-203 GW-204 GW-205 GW-208 GW-209 GW-210 GW-211 GW-215 GW-216 GW-217 GW-218 GW-219 GW-221 GW-225 GW-228 GW-229 GW-233 GW-234 GW-235 GW-236 GW-237 GW-240 GW-241 GW-242 GW-245 GW-247 GW-248 GW-249 GW-251 GW-254 GW-256 GW-257 GW-263 GW-267 GW-268 GW-274 GW-283 GW-286 GW-287 GW-289 GW-293 GW-295 GW-301 GW-303 GW-304 GW-305 GW-310 GW-311 GW-314 GW-315 GW-320 GW-325 GW-330 GW-335 GW-339 GW-340 GW-341 GW-342 GW-343 GW-344 GW-347 GW-348 GW-352 GW-355 GW-359 GW-364 GW-367 GW-375 GW-390 GW-391 GW-393 GW-394 GW-396 GW-398 GW-399 GW-402 GW-432 GW-437

GW-159 GW-165 GW-167 GW-169 GW-172 GW-183 GW-192 GW-194 GW-196 GW-201 GW-223 GW-230 GW-231 GW-232 GW-250 GW-273 GW-278

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees

- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021

Match Line Sheet 4
Match Line Sheet 5

Potomac River

GW-152 GW-164 GW-190 GW-199 GW-206 GW-224 GW-226 GW-255 GW-259 GW-258 GW-265 GW-269 GW-262 GW-279 GW-285 GW-298 GW-306 GW-294 GW-290 GW-292 GW-307 GW-300 GW-322 GW-332 GW-336 GW-169 GW-172 GW-183 GW-196 GW-222 GW-244 GW-253 GW-260 GW-270 GW-284 GW-280 GW-313 GW-319 GW-371 GW-381 GW-243 GW-266 GW-271 GW-252 GW-323 GW-326 GW-351 GW-361 GW-230 GW-261 GW-308 GW-324 GW-299 GW-272 GW-273 GW-278 GW-296 GW-350 GW-362 GW-380 GW-384 GW-302 GW-331 GW-295 GW-310 GW-334 GW-357 GW-404 GW-406 GW-410 GW-424 GW-320 GW-333 GW-327 GW-370 GW-377 GW-386 GW-407 GW-420 GW-443 GW-454 GW-339 GW-340 GW-348 GW-365 GW-368 GW-373 GW-385 GW-388 GW-468 GW-488 GW-460 GW-466 GW-489 GW-355 GW-359 GW-400 GW-423 GW-428 GW-431 GW-352 GW-367 GW-446 GW-453 GW-463 GW-412 GW-426 GW-440 GW-441 GW-442 GW-444 GW-449 GW-392 GW-512 GW-518 GW-405 GW-414 GW-417 GW-427 GW-434 GW-438 GW-456 GW-458 GW-469 GW-398 GW-522 GW-399 GW-452 GW-450 GW-462 GW-464 GW-474 GW-478 GW-479 GW-492 GW-493 GW-503 GW-510 GW-502 GW-541 GW-543 GW-549 GW-432 GW-437 GW-564 GW-563 GW-527 GW-600 GW-603

Match Line Sheet 5
Match Line Sheet 7

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | SHEET NO. 5 OF 51

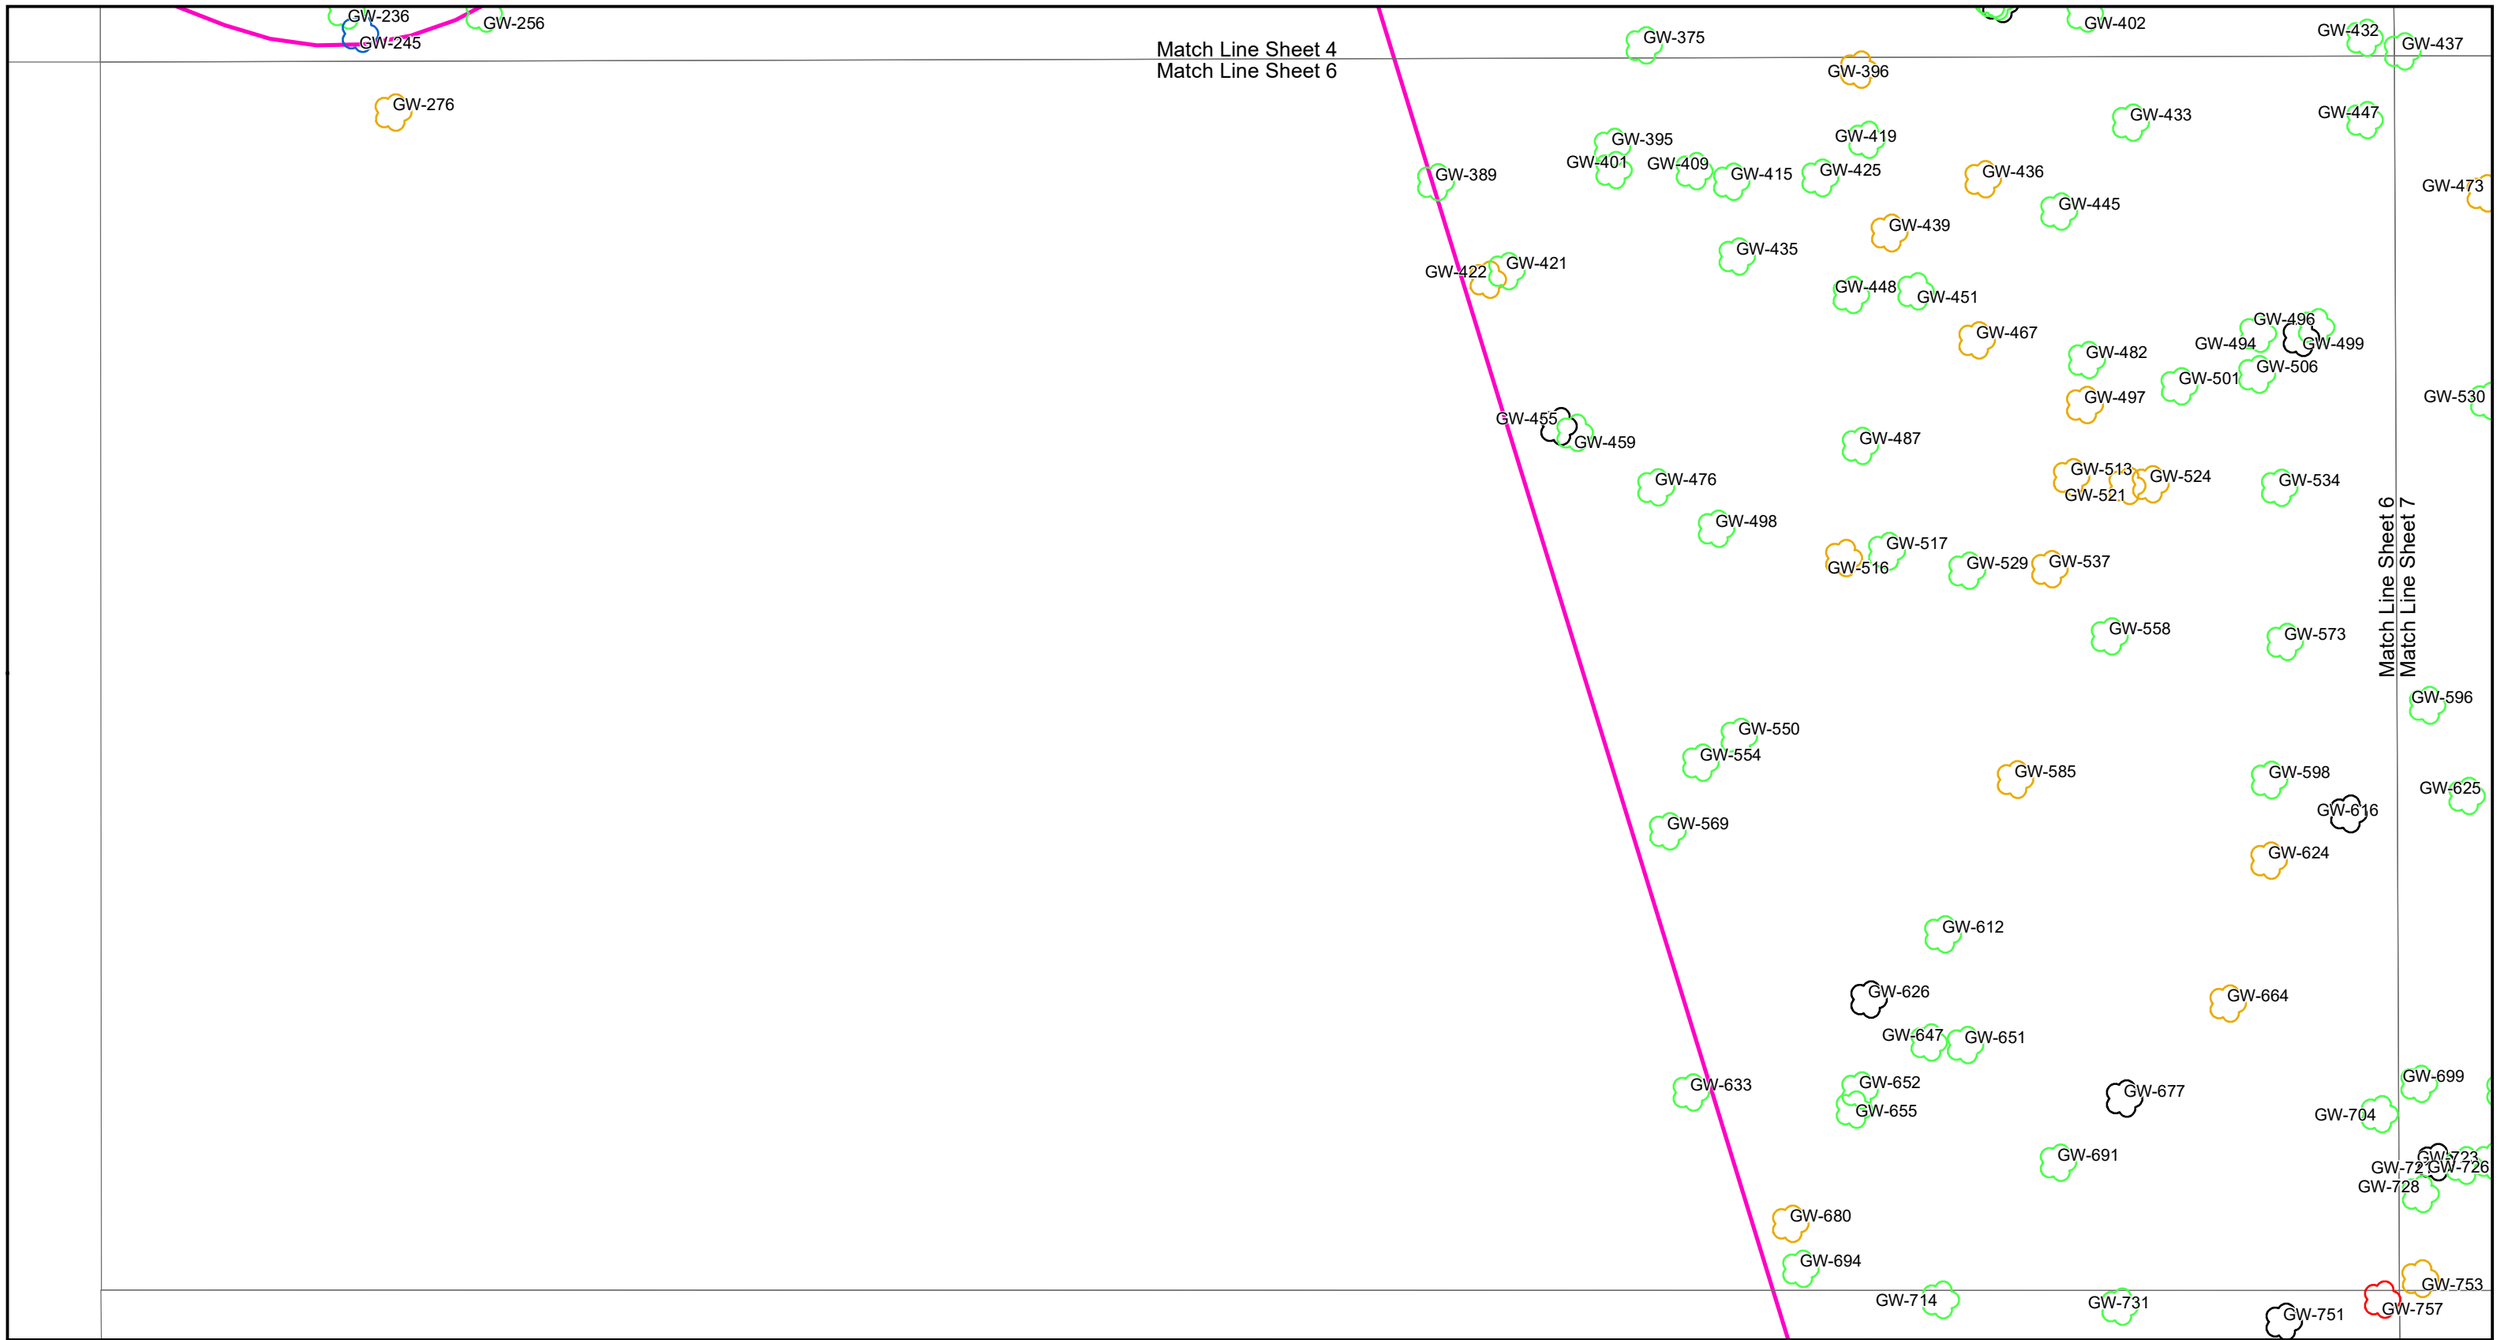

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 MANAGED LANES STUDY 270

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | SHEET NO. 6 OF 51

Match Line Sheet 5
Match Line Sheet 7

Match Line Sheet 6
Match Line Sheet 7

Match Line Sheet 7
Match Line Sheet 9

Potomac River

GW-432 GW-437 GW-447 GW-465 GW-473 GW-481 GW-477 GW-492 GW-502 GW-504 GW-507 GW-509 GW-519 GW-520 GW-528 GW-514 GW-515 GW-527 GW-541 GW-543 GW-549 GW-563 GW-564 GW-600 GW-603 GW-611 GW-627 GW-547 GW-556 GW-572 GW-584 GW-586 GW-590 GW-617 GW-540 GW-545 GW-548 GW-561 GW-567 GW-557 GW-574 GW-576 GW-578 GW-580 GW-581 GW-592 GW-597 GW-604 GW-622 GW-630 GW-653 GW-658 GW-670 GW-682 GW-684 GW-496 GW-499 GW-531 GW-538 GW-539 GW-532 GW-536 GW-530 GW-571 GW-579 GW-560 GW-582 GW-555 GW-566 GW-562 GW-568 GW-577 GW-591 GW-601 GW-609 GW-619 GW-614 GW-607 GW-594 GW-573 GW-599 GW-602 GW-596 GW-610 GW-615 GW-613 GW-632 GW-640 GW-646 GW-650 GW-665 GW-657 GW-659 GW-641 GW-639 GW-644 GW-642 GW-643 GW-625 GW-636 GW-656 GW-660 GW-667 GW-678 GW-687 GW-696 GW-616 GW-666 GW-676 GW-668 GW-686 GW-693 GW-705 GW-709 GW-708 GW-717 GW-703 GW-707 GW-699 GW-704 GW-718 GW-719 GW-725 GW-738 GW-752 GW-755 GW-761 GW-780 GW-794 GW-778 GW-785 GW-726 GW-721 GW-723 GW-728 GW-760 GW-772 GW-776 GW-781 GW-753 GW-757 GW-751 GW-783 GW-816 GW-825 GW-828 GW-834 GW-850 GW-620 GW-629 GW-631 GW-635 GW-645 GW-638 GW-661 GW-663 GW-675 GW-673 GW-685 GW-688 GW-690 GW-706 GW-711 GW-765 GW-788 GW-799 GW-806 GW-800 GW-804 GW-815 GW-733 GW-734 GW-746 GW-710 GW-715 GW-754 GW-767 GW-764 GW-771 GW-773 GW-787 GW-791 GW-803 GW-742 GW-724 GW-735 GW-759 GW-768 GW-775 GW-671 GW-695 GW-702 GW-700 GW-713 GW-729 GW-722 GW-736 GW-745 GW-770 GW-782 GW-698 GW-712 GW-732 GW-743 GW-748 GW-805 GW-812 GW-810 GW-819 GW-824 GW-841 GW-837 GW-839 GW-847 GW-849 GW-854 GW-856 GW-867 GW-868 GW-861 GW-875

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees

- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | SHEET NO. 7 OF 51

GW-694
GW-714
GW-731
GW-751
GW-753
GW-757
GW-720
GW-758
GW-786
GW-747
GW-777
GW-774
GW-766
GW-818
GW-820
GW-821
GW-829
GW-830
GW-801
GW-817
GW-823
GW-822
GW-840
GW-842
GW-852
GW-873
GW-845
GW-874
GW-865
GW-869
GW-877
GW-887
Match Line Sheet 8
Match Line Sheet 9
GW-899
GW-905
GW-911
GW-922
GW-914
GW-932
GW-919
GW-933
GW-939
GW-953
GW-948
GW-961
GW-959
GW-976

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021

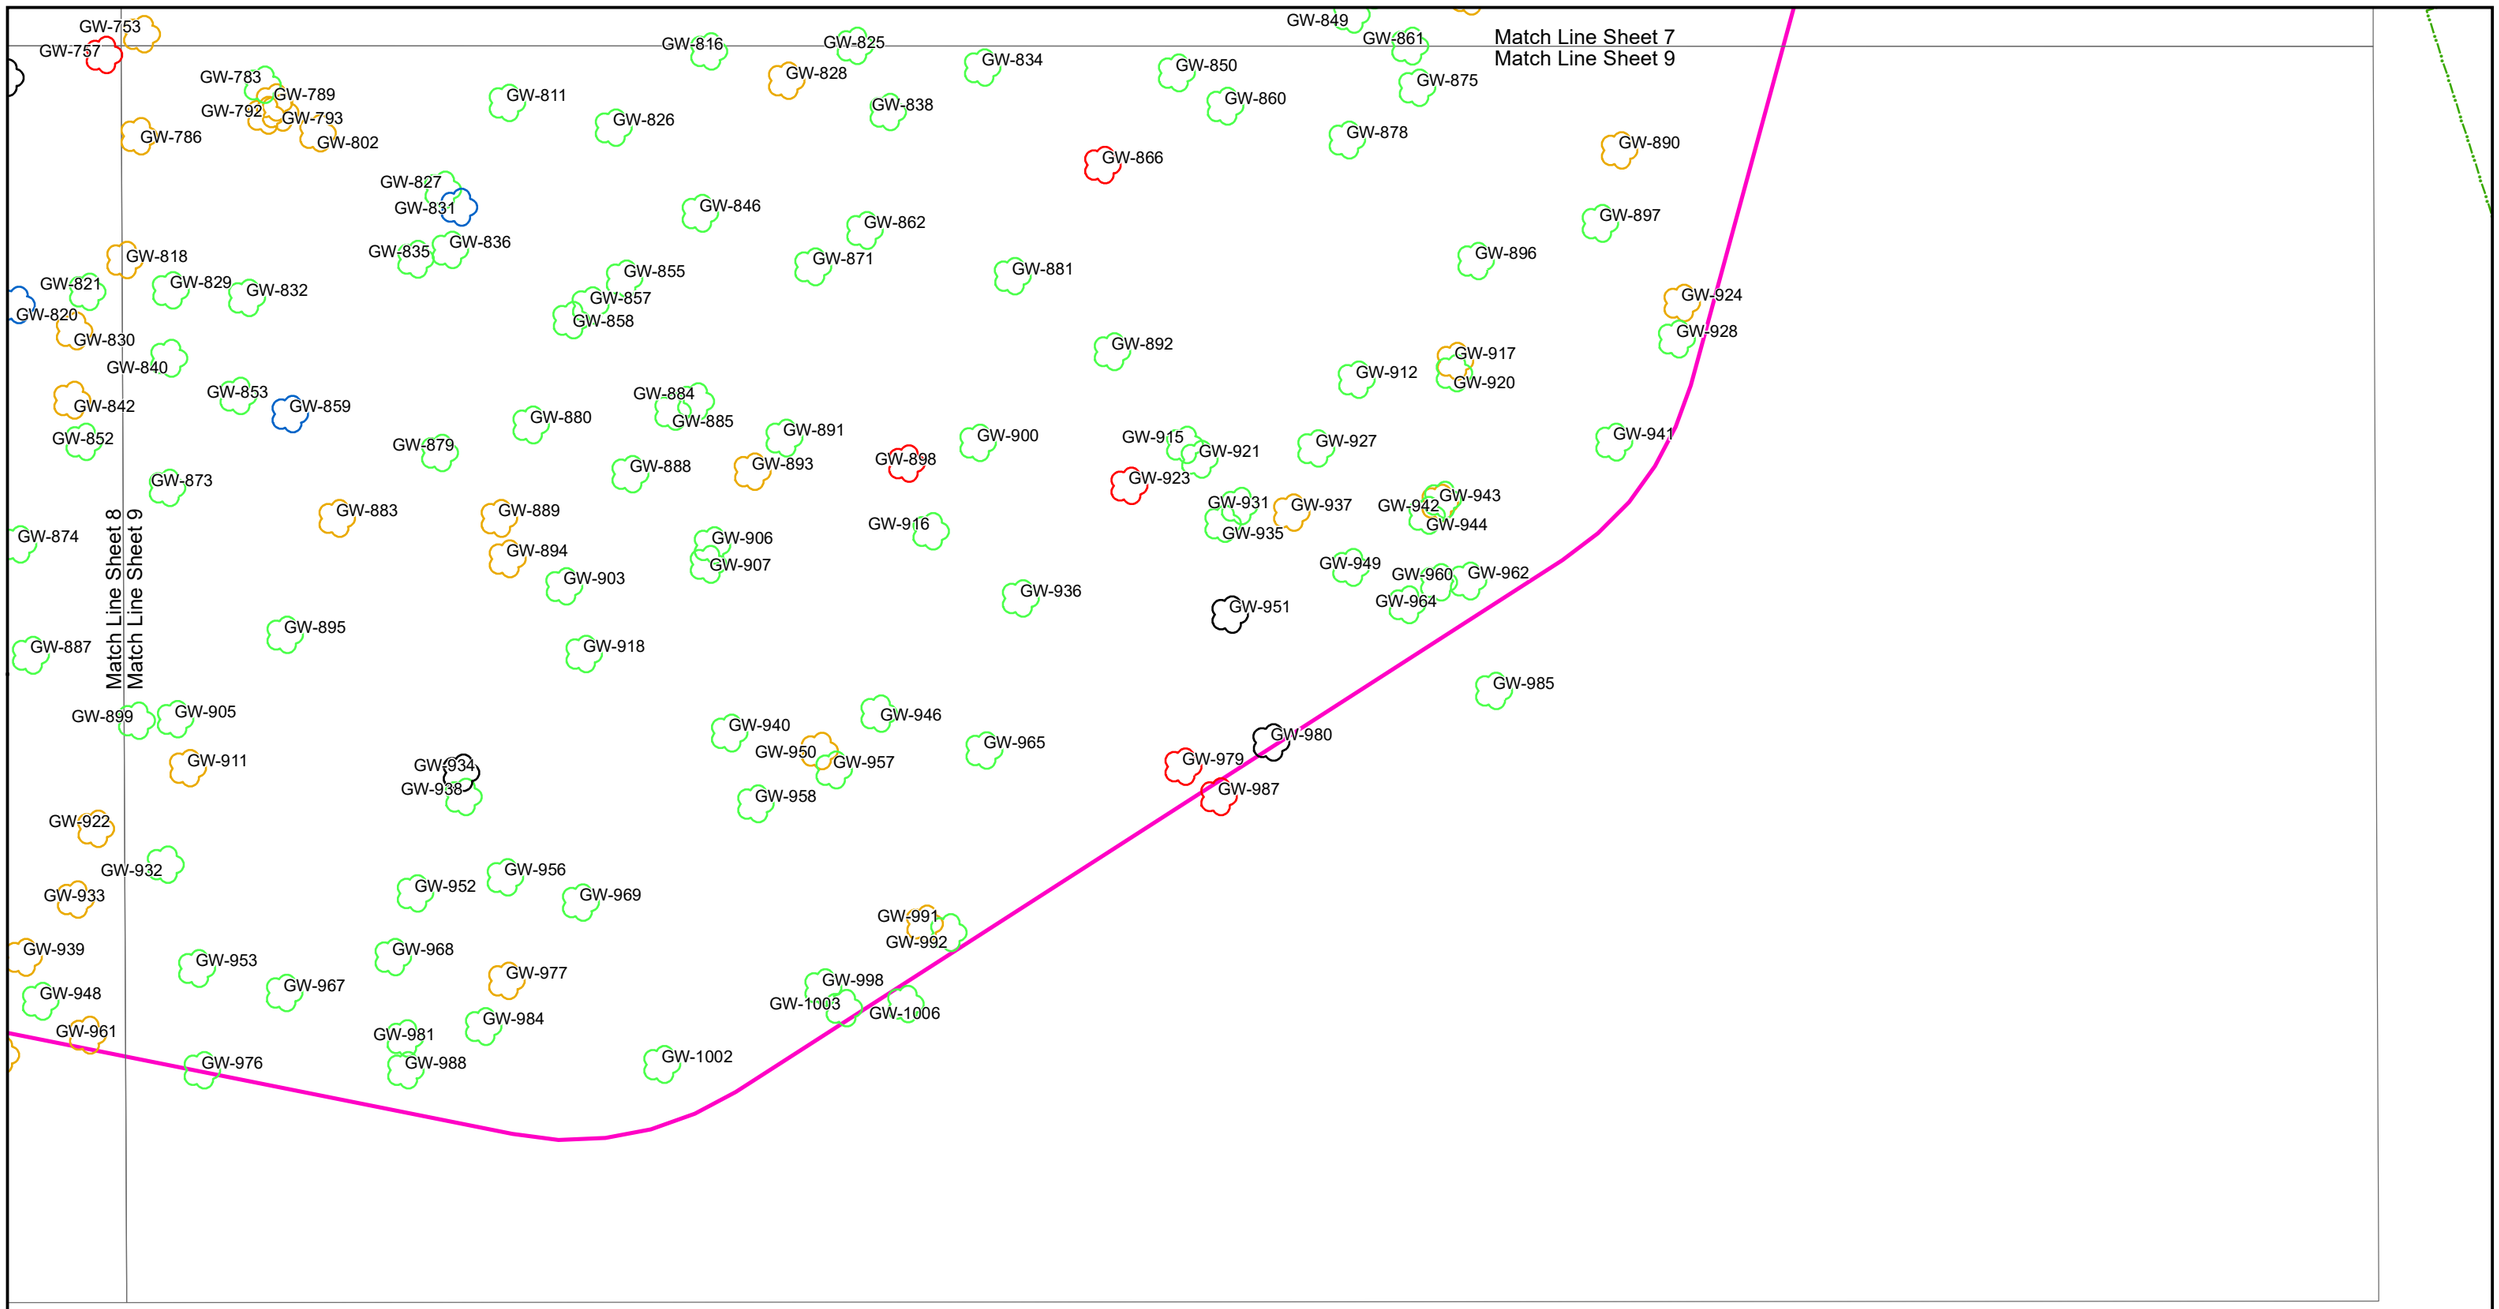

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees

- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | SHEET NO. 9 OF 51

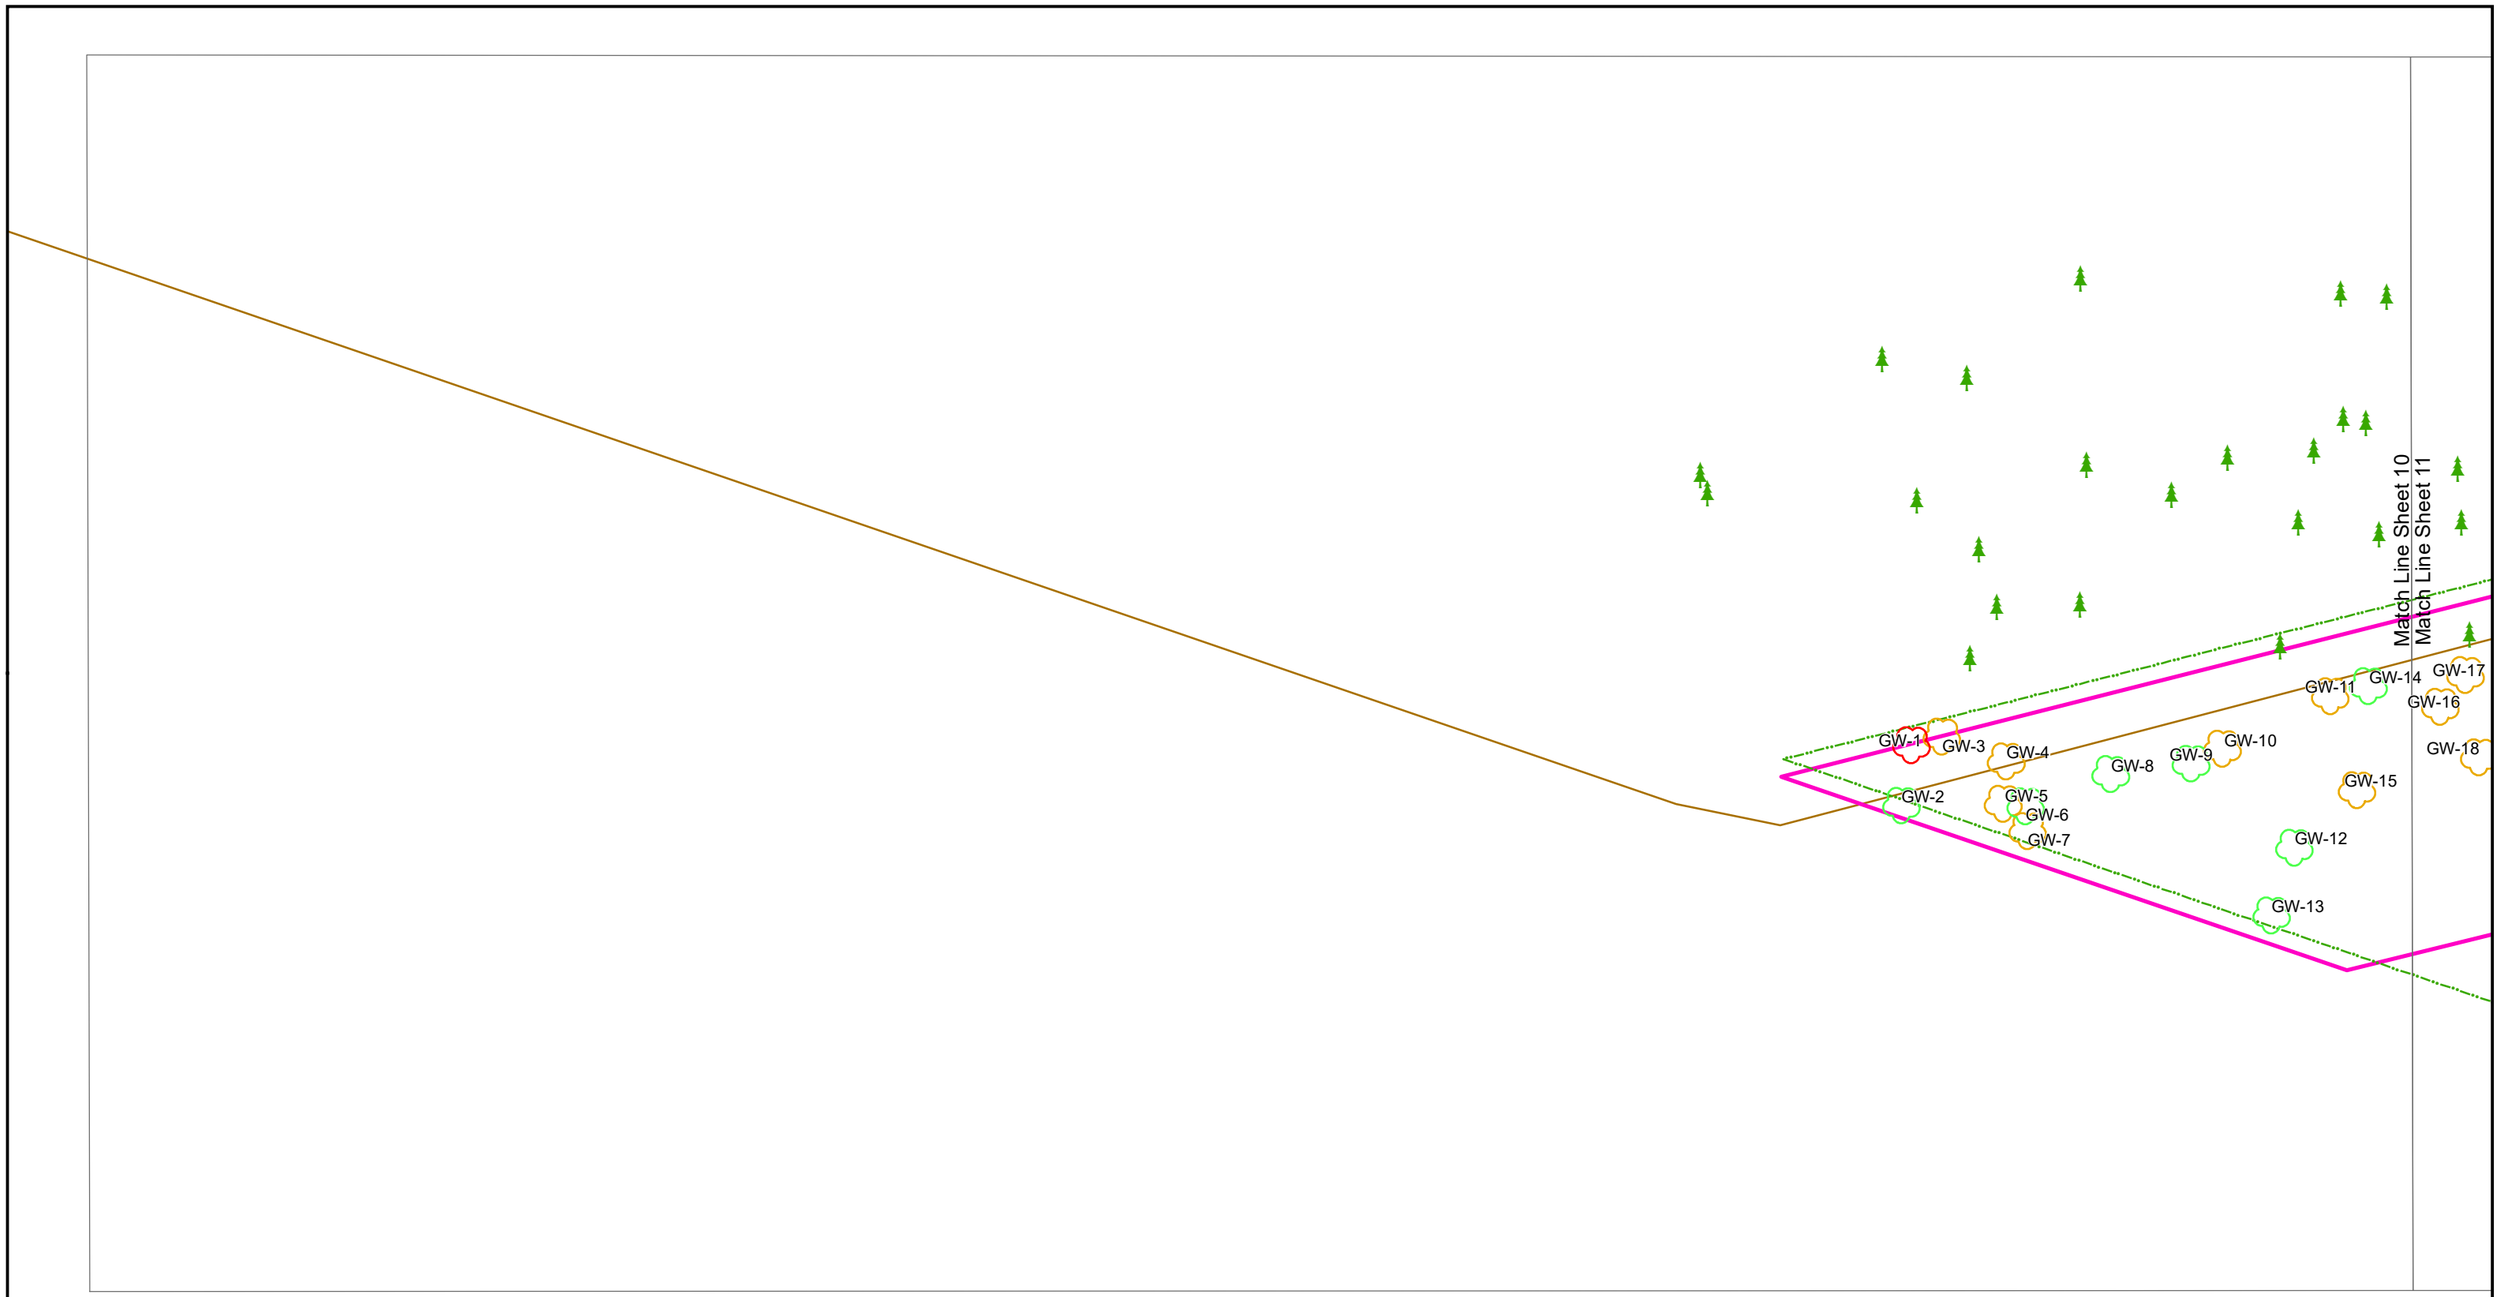

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | SHEET NO. 10 OF 51

George Washington Memorial Parkway

Match Line Sheet 10
Match Line Sheet 11

Match Line Sheet 11
Match Line Sheet 12

Match Line Sheet 11
Match Line Sheet 13

GW-11
GW-14
GW-15
GW-16
GW-17
GW-18
GW-19
GW-20
GW-21
GW-22
GW-23

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021

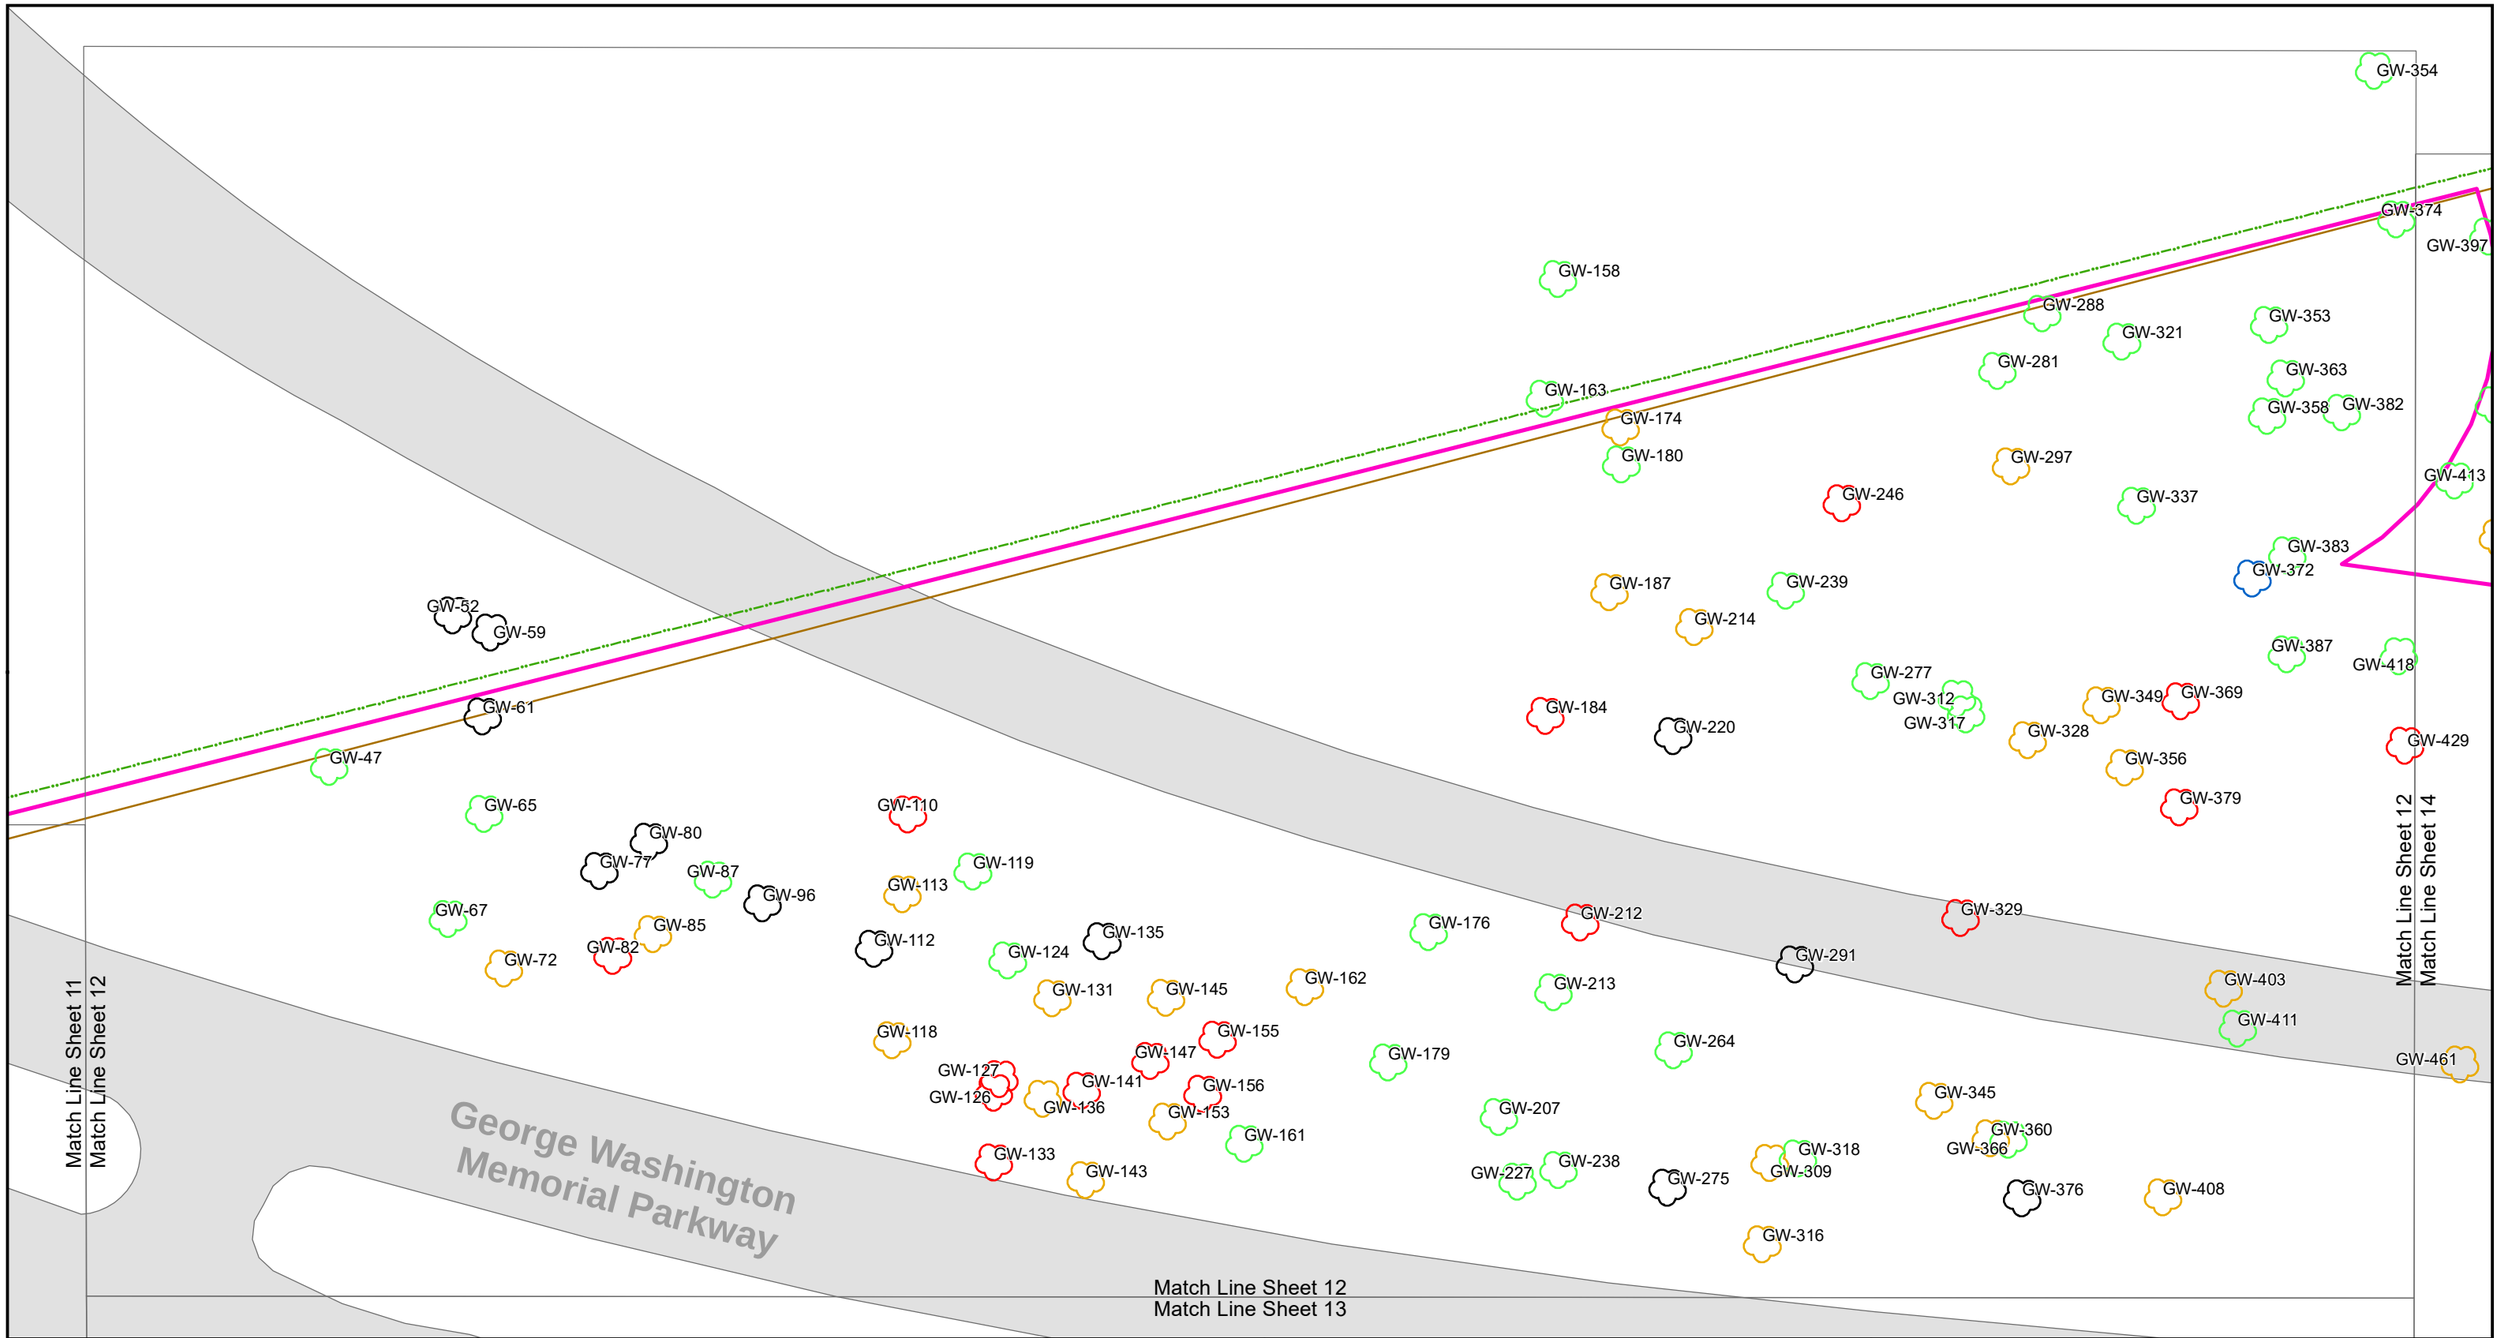

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees

- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | SHEET NO. 12 OF 51

Match Line Sheet 12
Match Line Sheet 13

Match Line Sheet 11
Match Line Sheet 13

Match Line Sheet 13
Match Line Sheet 15

George Washington
Memorial Parkway

GW-338
GW-471
GW-486
GW-523
GW-500
GW-480
GW-526
GW-490
GW-552
GW-495
GW-587
GW-533
GW-346
GW-595

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021

GW-374
GW-397
GW-382
GW-416
GW-413
GW-430
GW-418
GW-472
GW-525
GW-575
GW-583
GW-621
GW-457
GW-484
GW-485
GW-634
GW-750
GW-769
GW-814
GW-848
GW-870
GW-876
GW-740
GW-741
GW-808
GW-429
GW-535
GW-544
GW-588
GW-608
GW-689
GW-737
GW-739
GW-790
GW-796
GW-913
GW-475
GW-511
GW-649
GW-692
GW-929
GW-637
GW-628
GW-551
GW-559
GW-697
GW-756
GW-701
GW-470
GW-542
GW-546
GW-565
GW-570
GW-589
GW-674
GW-672
GW-681
GW-930
GW-851
GW-863
GW-505
GW-483
GW-491
GW-508
GW-908
GW-461
GW-999
GW-605
GW-833

Match Line Sheet 12
Match Line Sheet 14

Match Line Sheet 14
Match Line Sheet 16

Match Line Sheet 14
Match Line Sheet 15

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | SHEET NO. 14 OF 51

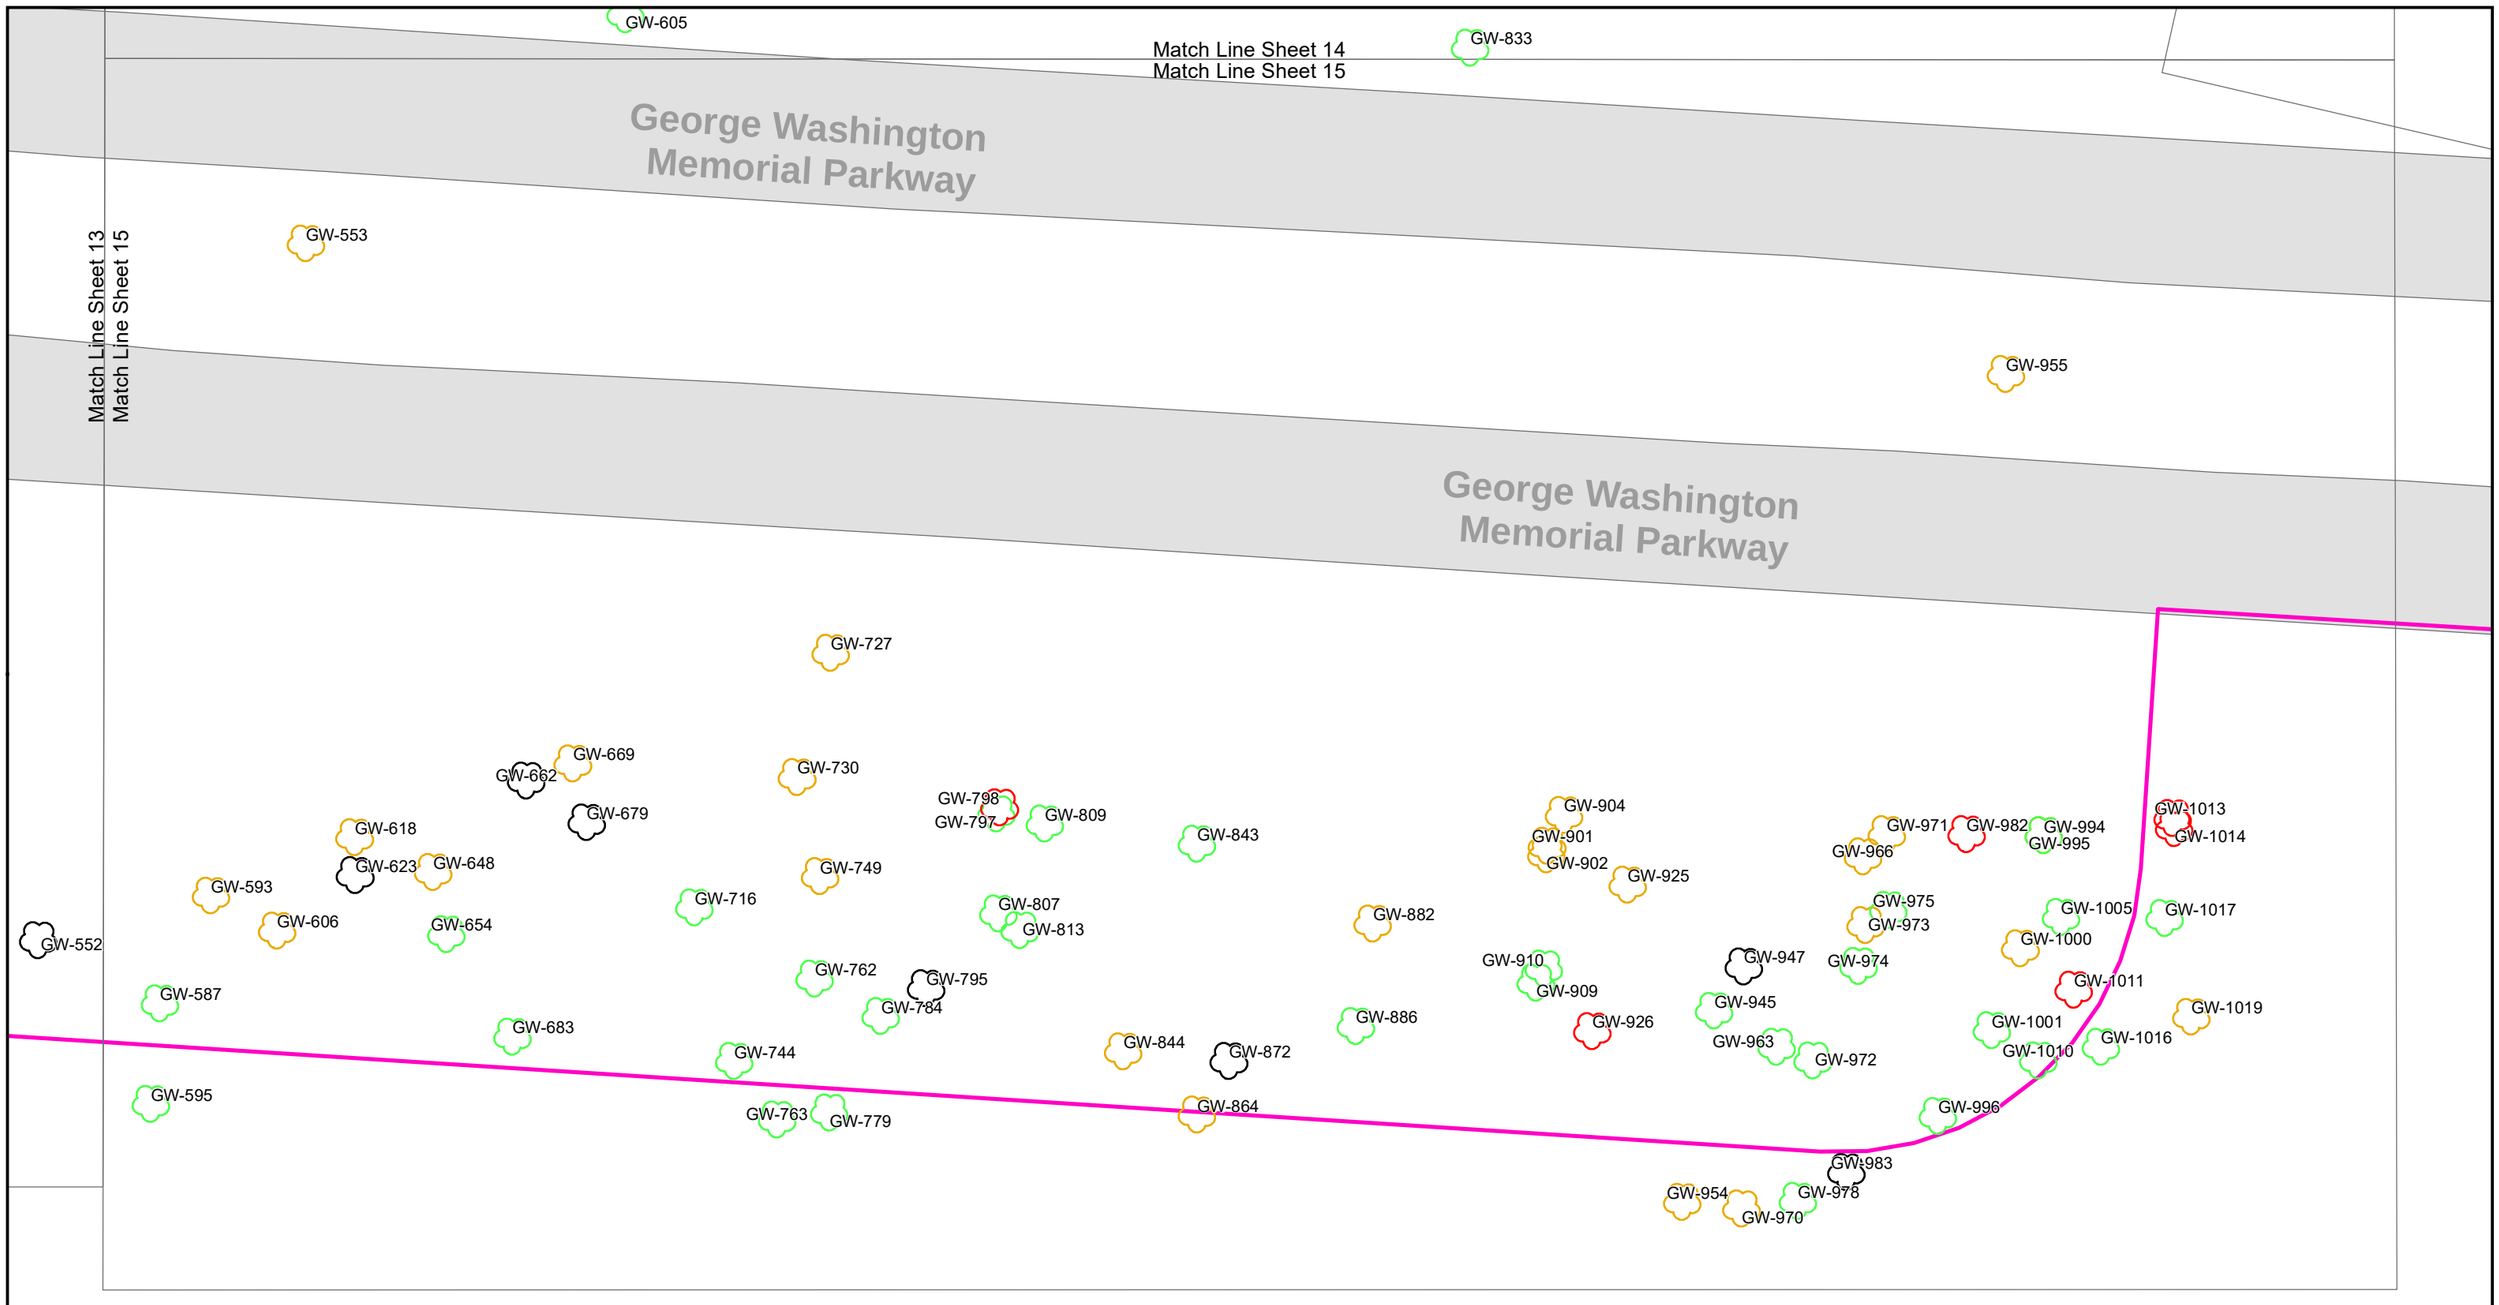

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees

- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:

1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021

Match Line Sheet 14
Match Line Sheet 16

Match Line Sheet 16
Match Line Sheet 17

Match Line Sheet 14
Match Line Sheet 15

GW-1067
GW-1038
GW-1053
GW-1071
GW-1076
GW-1075
GW-1027
GW-1046
GW-1022
GW-1043
GW-1048
GW-1050
GW-1057
GW-1065
GW-1066
GW-1074
GW-1026
GW-1036
GW-1039
GW-1032
GW-1042
GW-1044
GW-1047
GW-1068
GW-986
GW-990
GW-1021
GW-1023
GW-1035
GW-1040
GW-1063
GW-1069
GW-1070
GW-1004
GW-993
GW-1026
GW-1028
GW-1029
GW-1034
GW-1045
GW-1052
GW-1072
GW-1073
GW-997
GW-1030
GW-1037
GW-1049
GW-1051
GW-1056
GW-1059
GW-1060
GW-1024
GW-1031
GW-1041
GW-1058
GW-1064
GW-929
GW-989
GW-1033
GW-1061
GW-1054
GW-1055
GW-1077
GW-1012
GW-1018
GW-1025
GW-1062
GW-1009
GW-930
GW-1015
GW-1008
GW-1007
GW-999

George Washington Memorial Parkway

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021

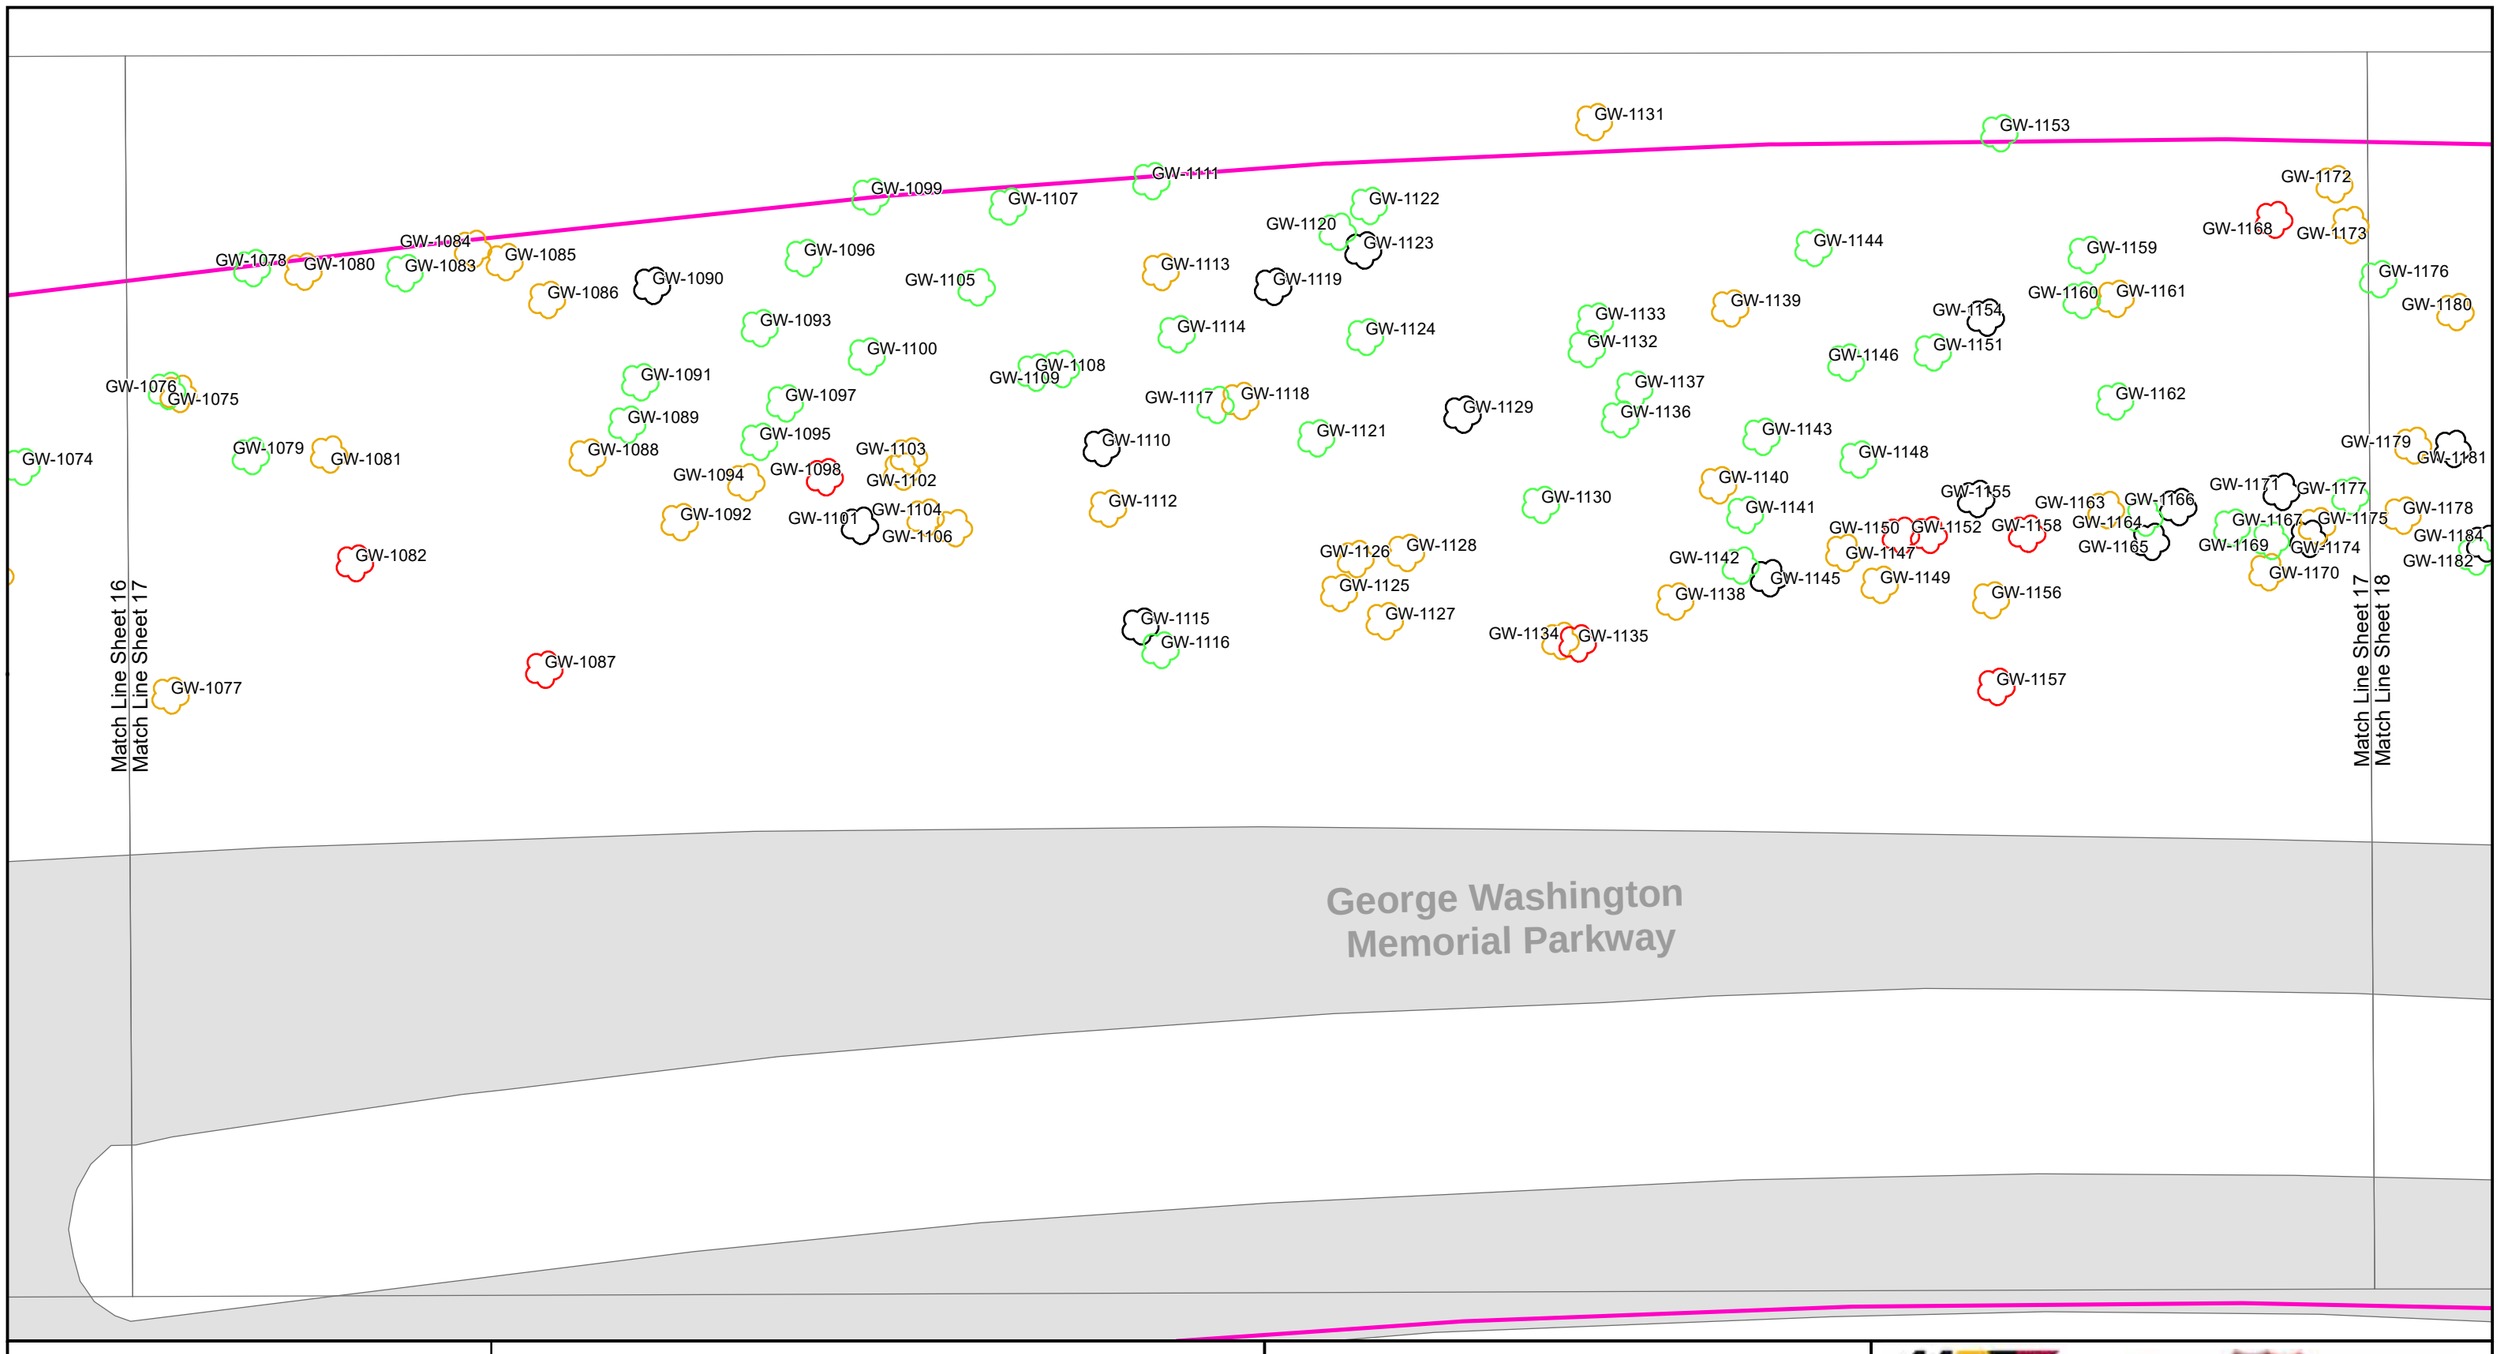

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021

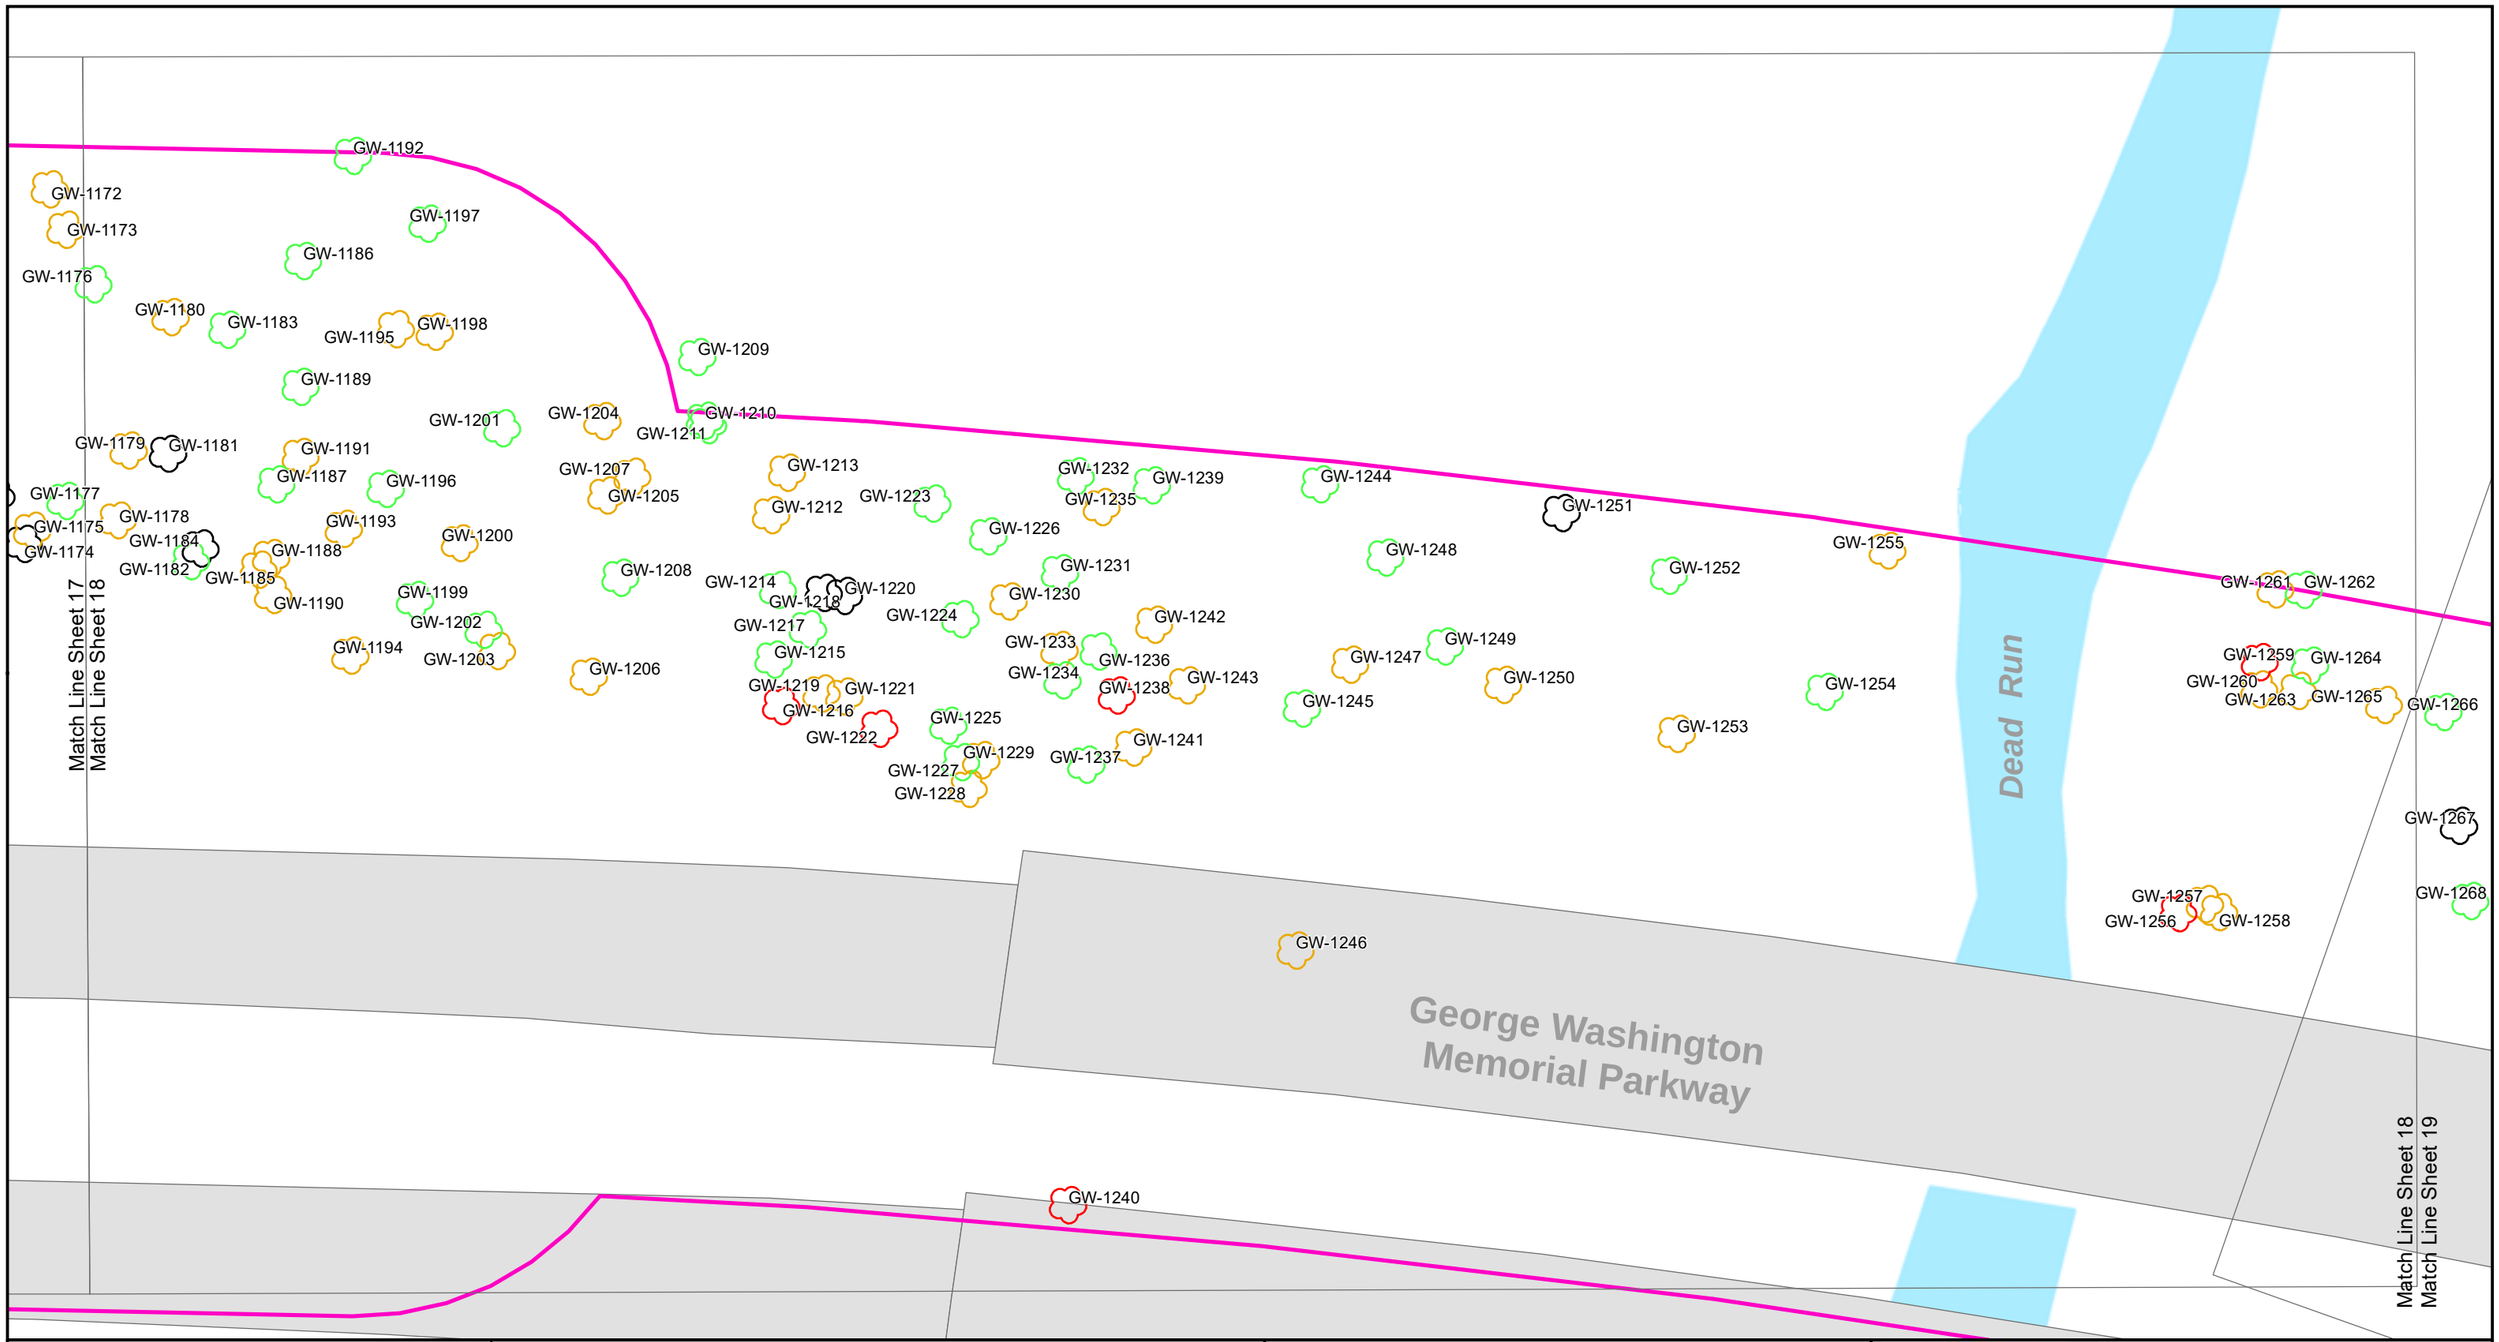

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | SHEET NO. 18 OF 51

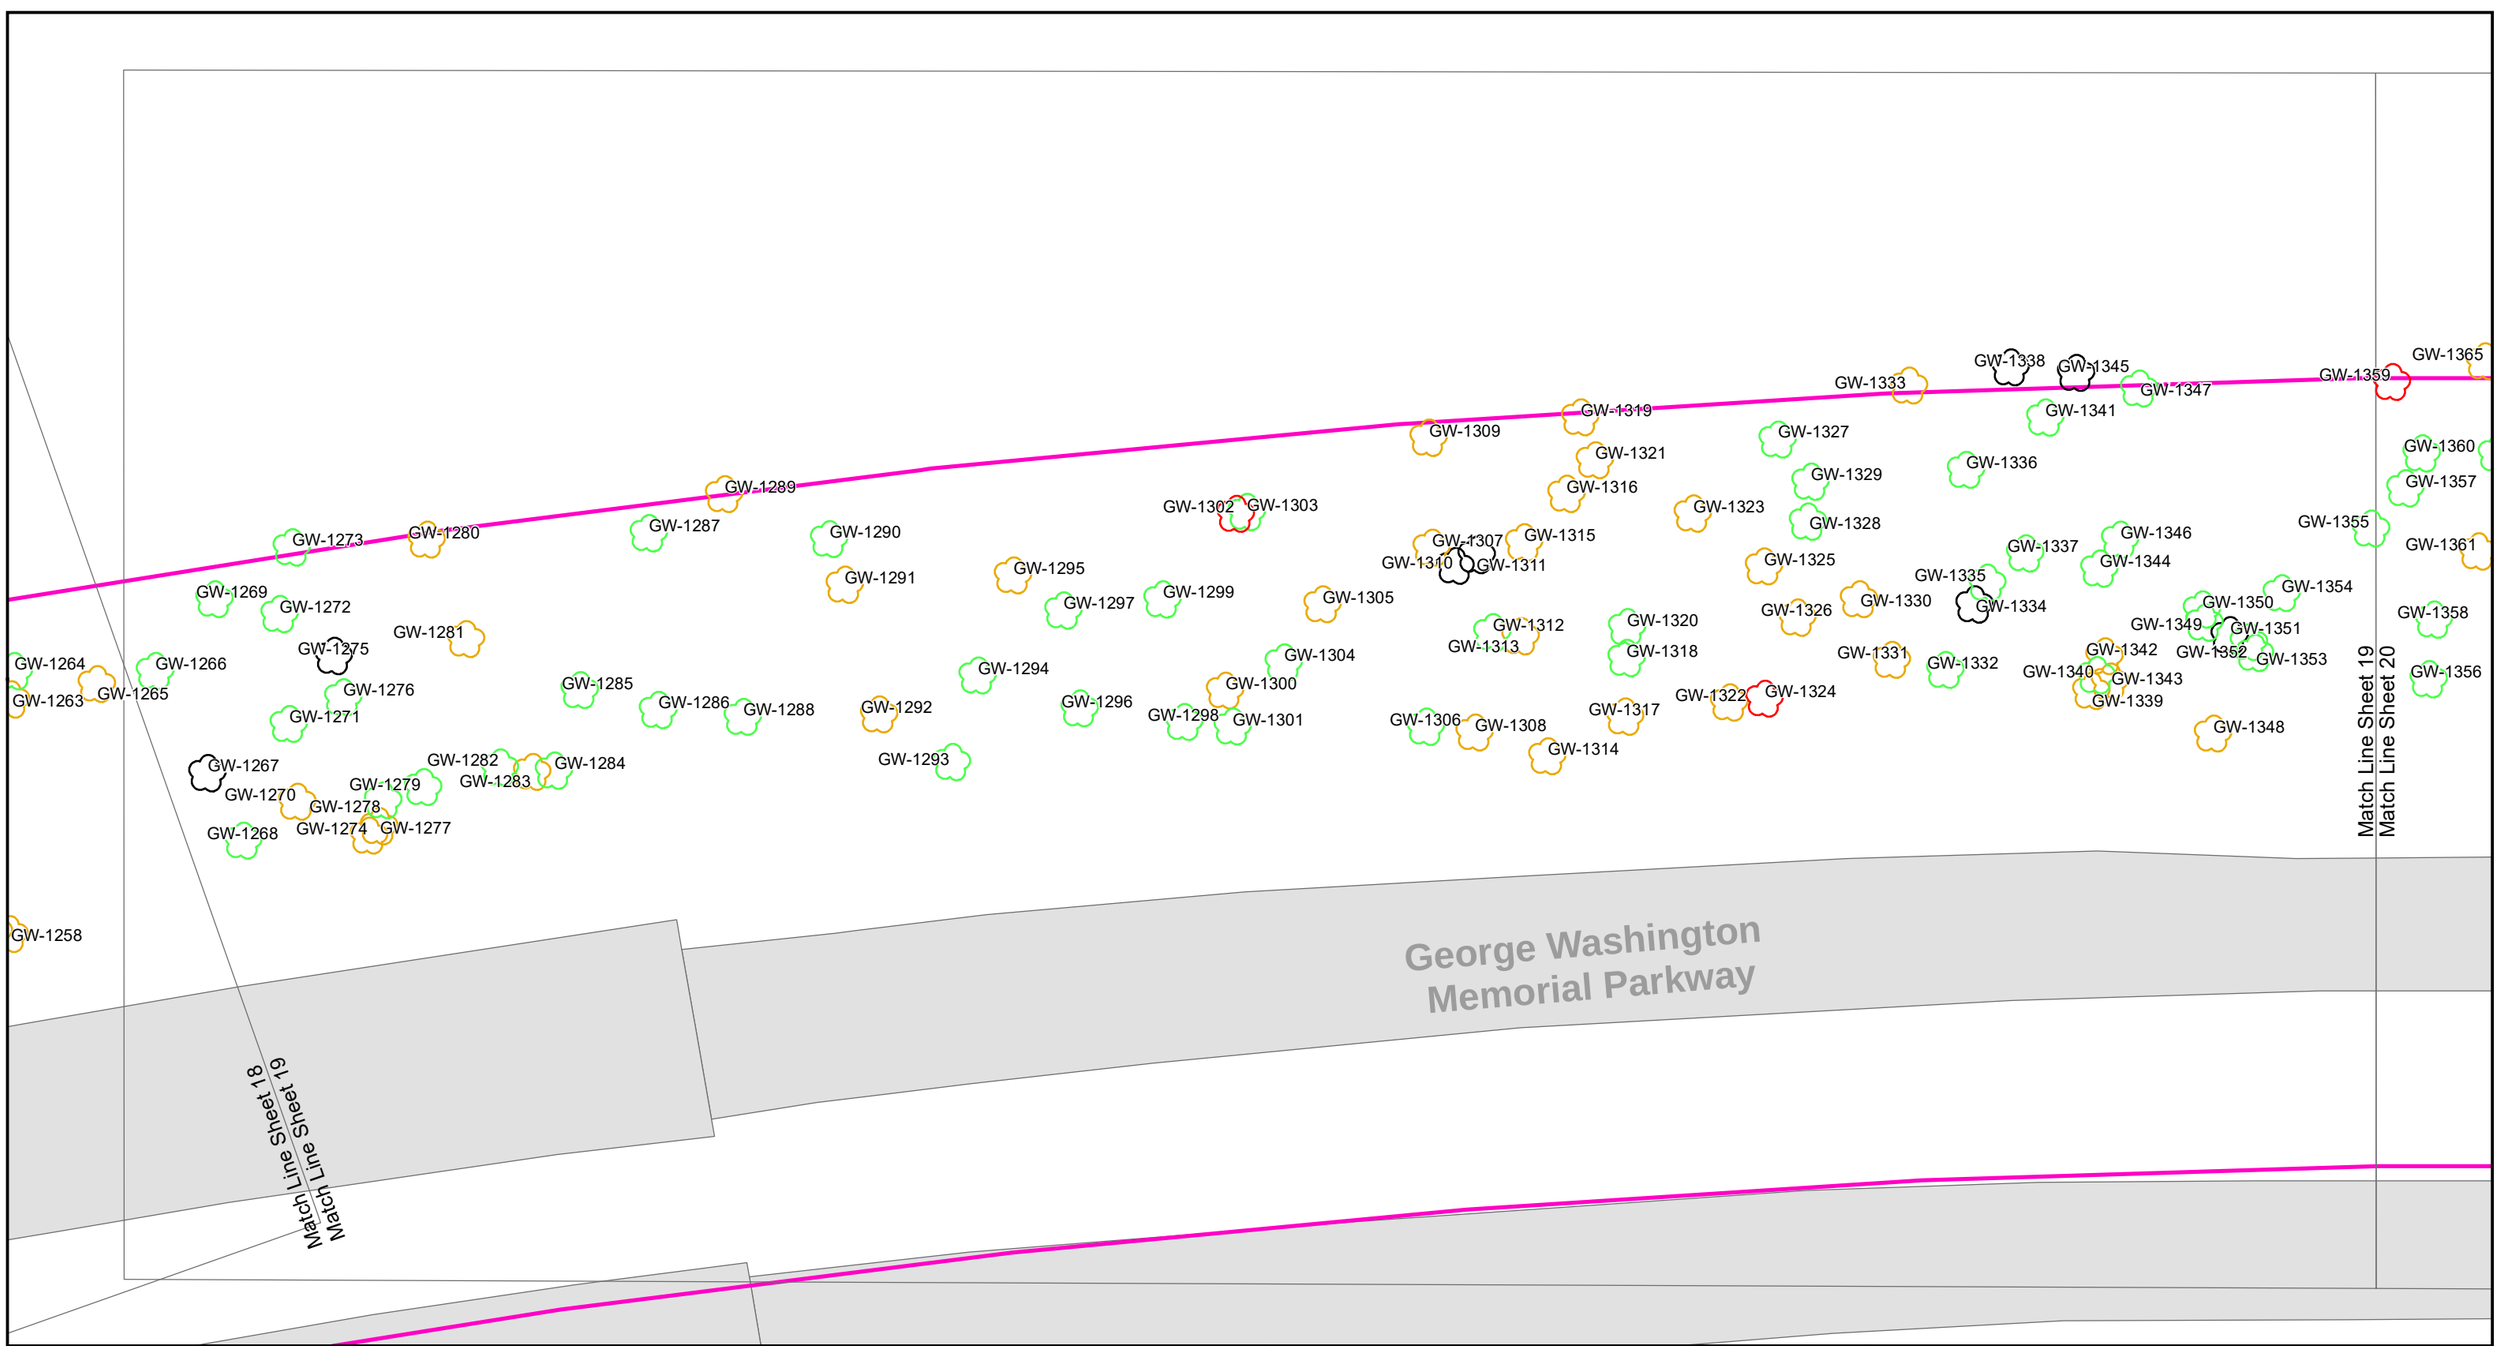

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 MANAGED LANES STUDY 270

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | SHEET NO. 19 OF 51

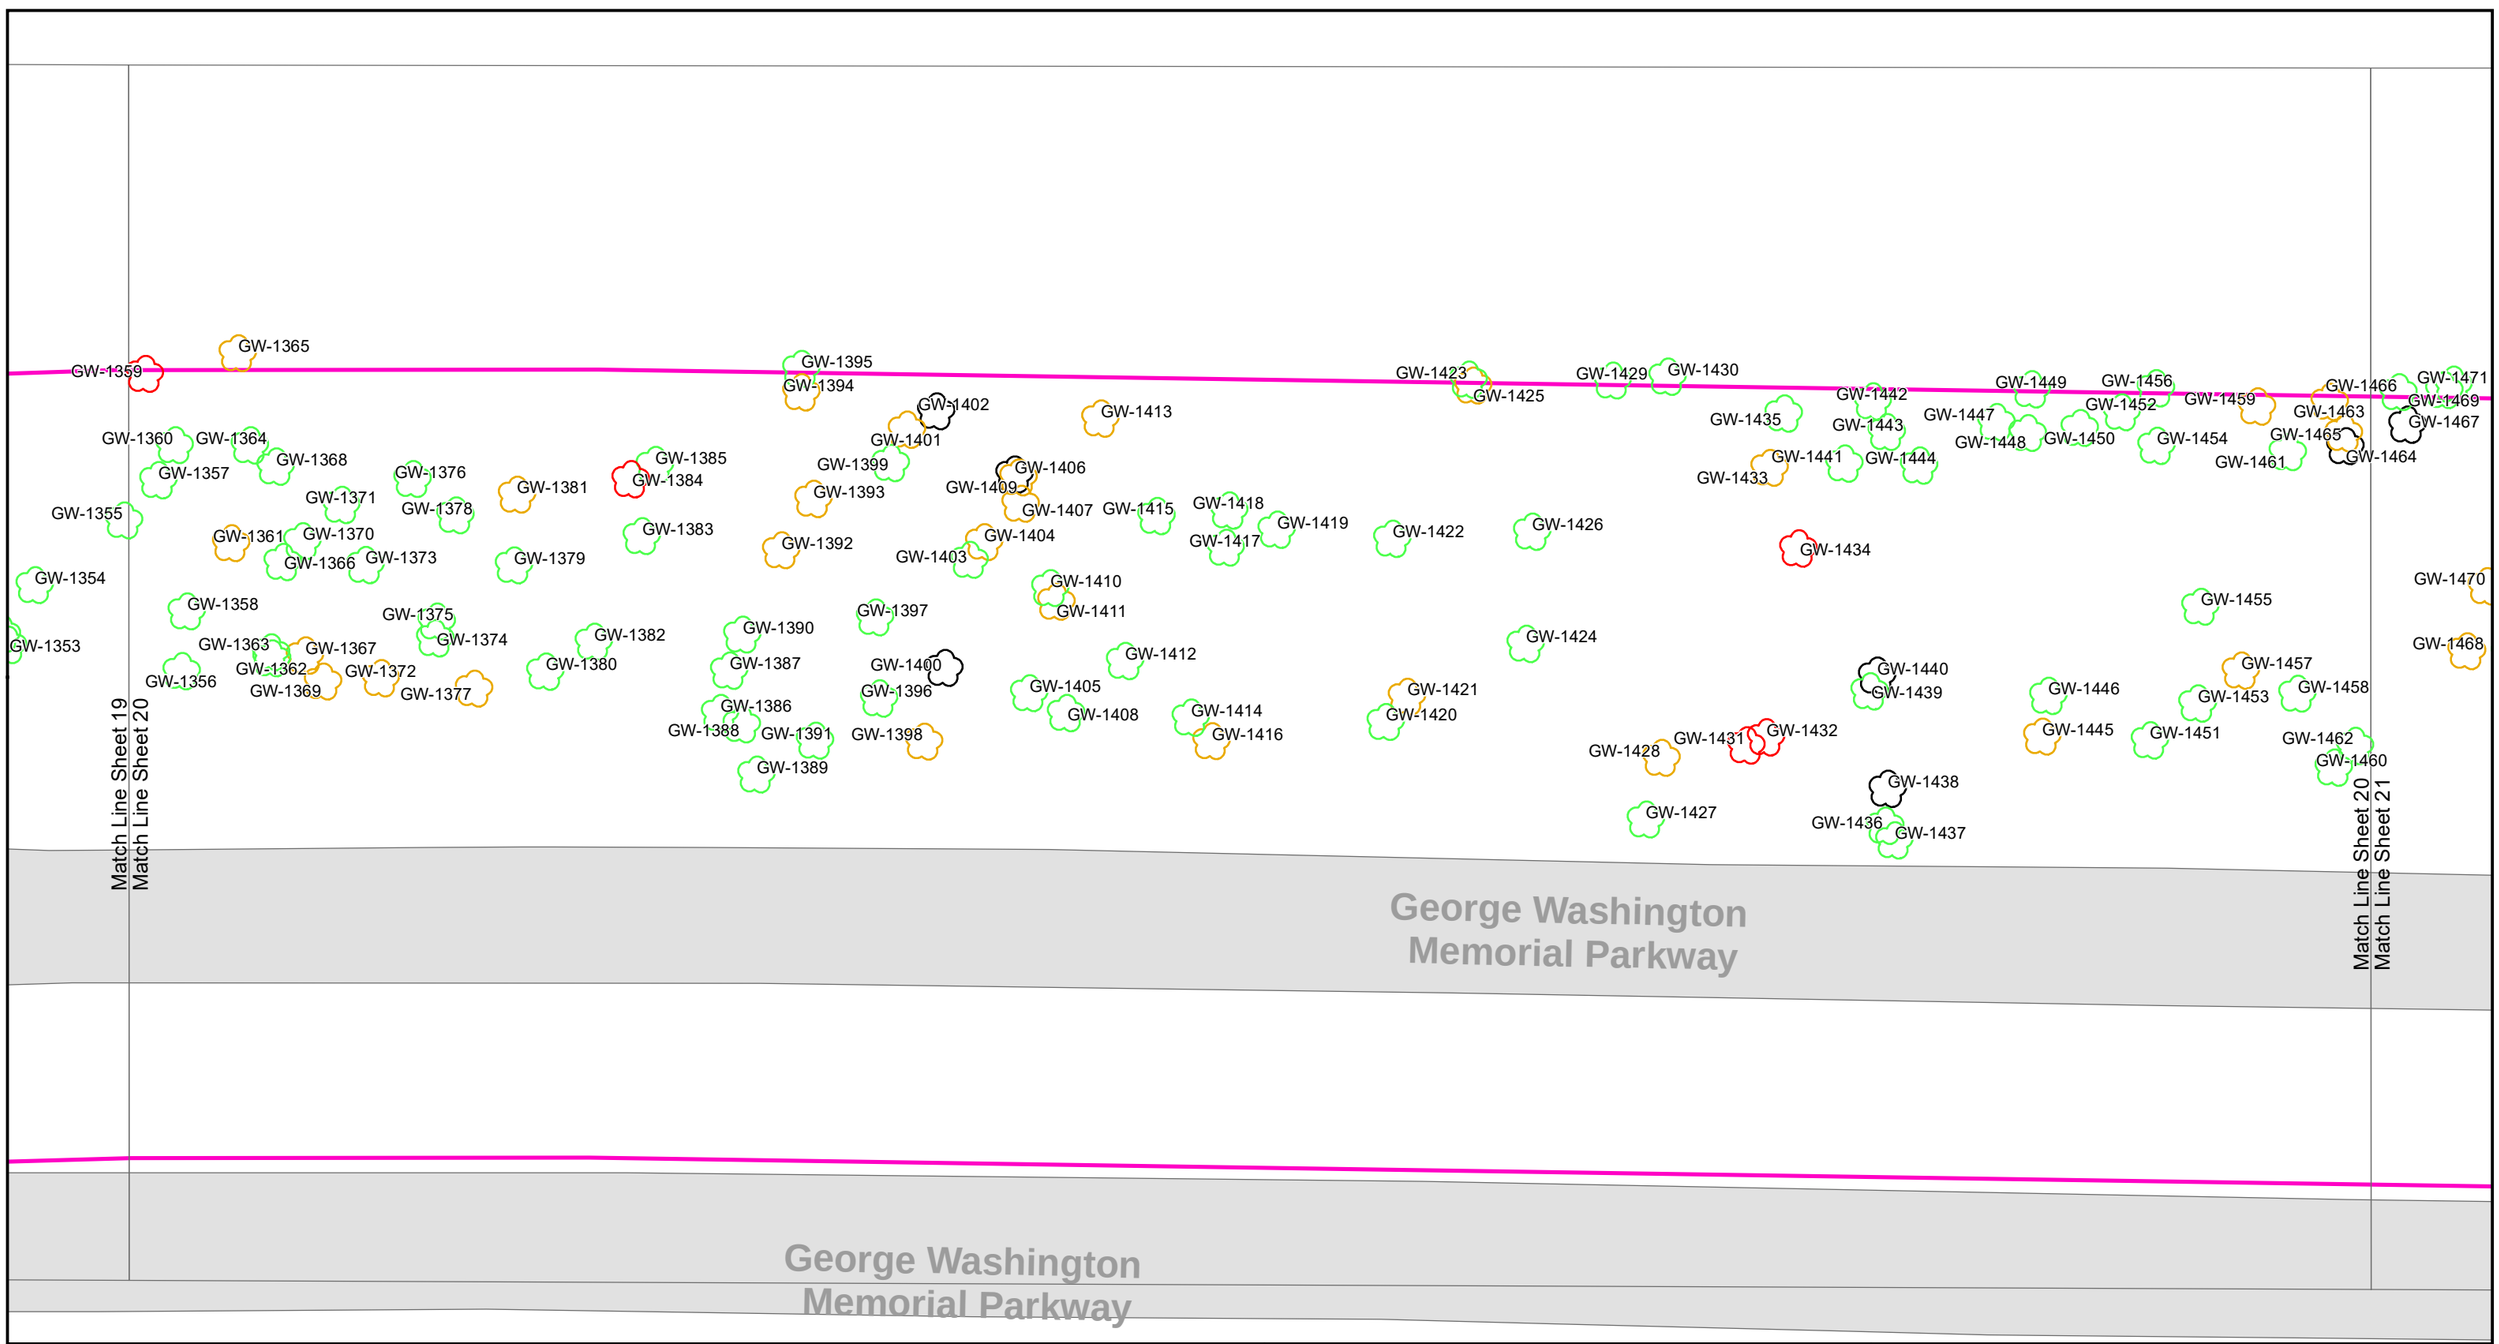

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021

GW-1466 GW-1471 GW-1463 GW-1469 GW-1478 GW-1467 GW-1476 GW-1465 GW-1464 GW-1485 GW-1499 GW-1501 GW-1508 GW-1493 GW-1503 GW-1514 GW-1530 GW-1538 GW-1542 GW-1549 GW-1558 GW-1539 GW-1535 GW-1554 GW-1489 GW-1491 GW-1516 GW-1521 GW-1546 GW-1518 GW-1527 GW-1528 GW-1492 GW-1495 GW-1496 GW-1502 GW-1519 GW-1522 GW-1531 GW-1548 GW-1553 GW-1560 GW-1475 GW-1509 GW-1545 GW-1559 GW-1470 GW-1500 GW-1513 GW-1515 GW-1532 GW-1551 GW-1481 GW-1512 GW-1534 GW-1537 GW-1529 GW-1540 GW-1520 GW-1543 GW-1505 GW-1547 GW-1556 GW-1468 GW-1472 GW-1473 GW-1480 GW-1484 GW-1486 GW-1494 GW-1504 GW-1524 GW-1526 GW-1541 GW-1458 GW-1482 GW-1517 GW-1525 GW-1479 GW-1533 GW-1536 GW-1544 GW-1552 GW-1555 GW-1557 GW-1462 GW-1483 GW-1490 GW-1510 GW-1550 GW-1474 GW-1477 GW-1511 GW-1523 GW-1460 GW-1487 GW-1498 GW-1488 GW-1497 GW-1507 GW-1506

Match Line Sheet 20
Match Line Sheet 21

Match Line Sheet 21
Match Line Sheet 22

George Washington Memorial Parkway

George Washington Memorial Parkway

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees

- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | SHEET NO. 21 OF 51

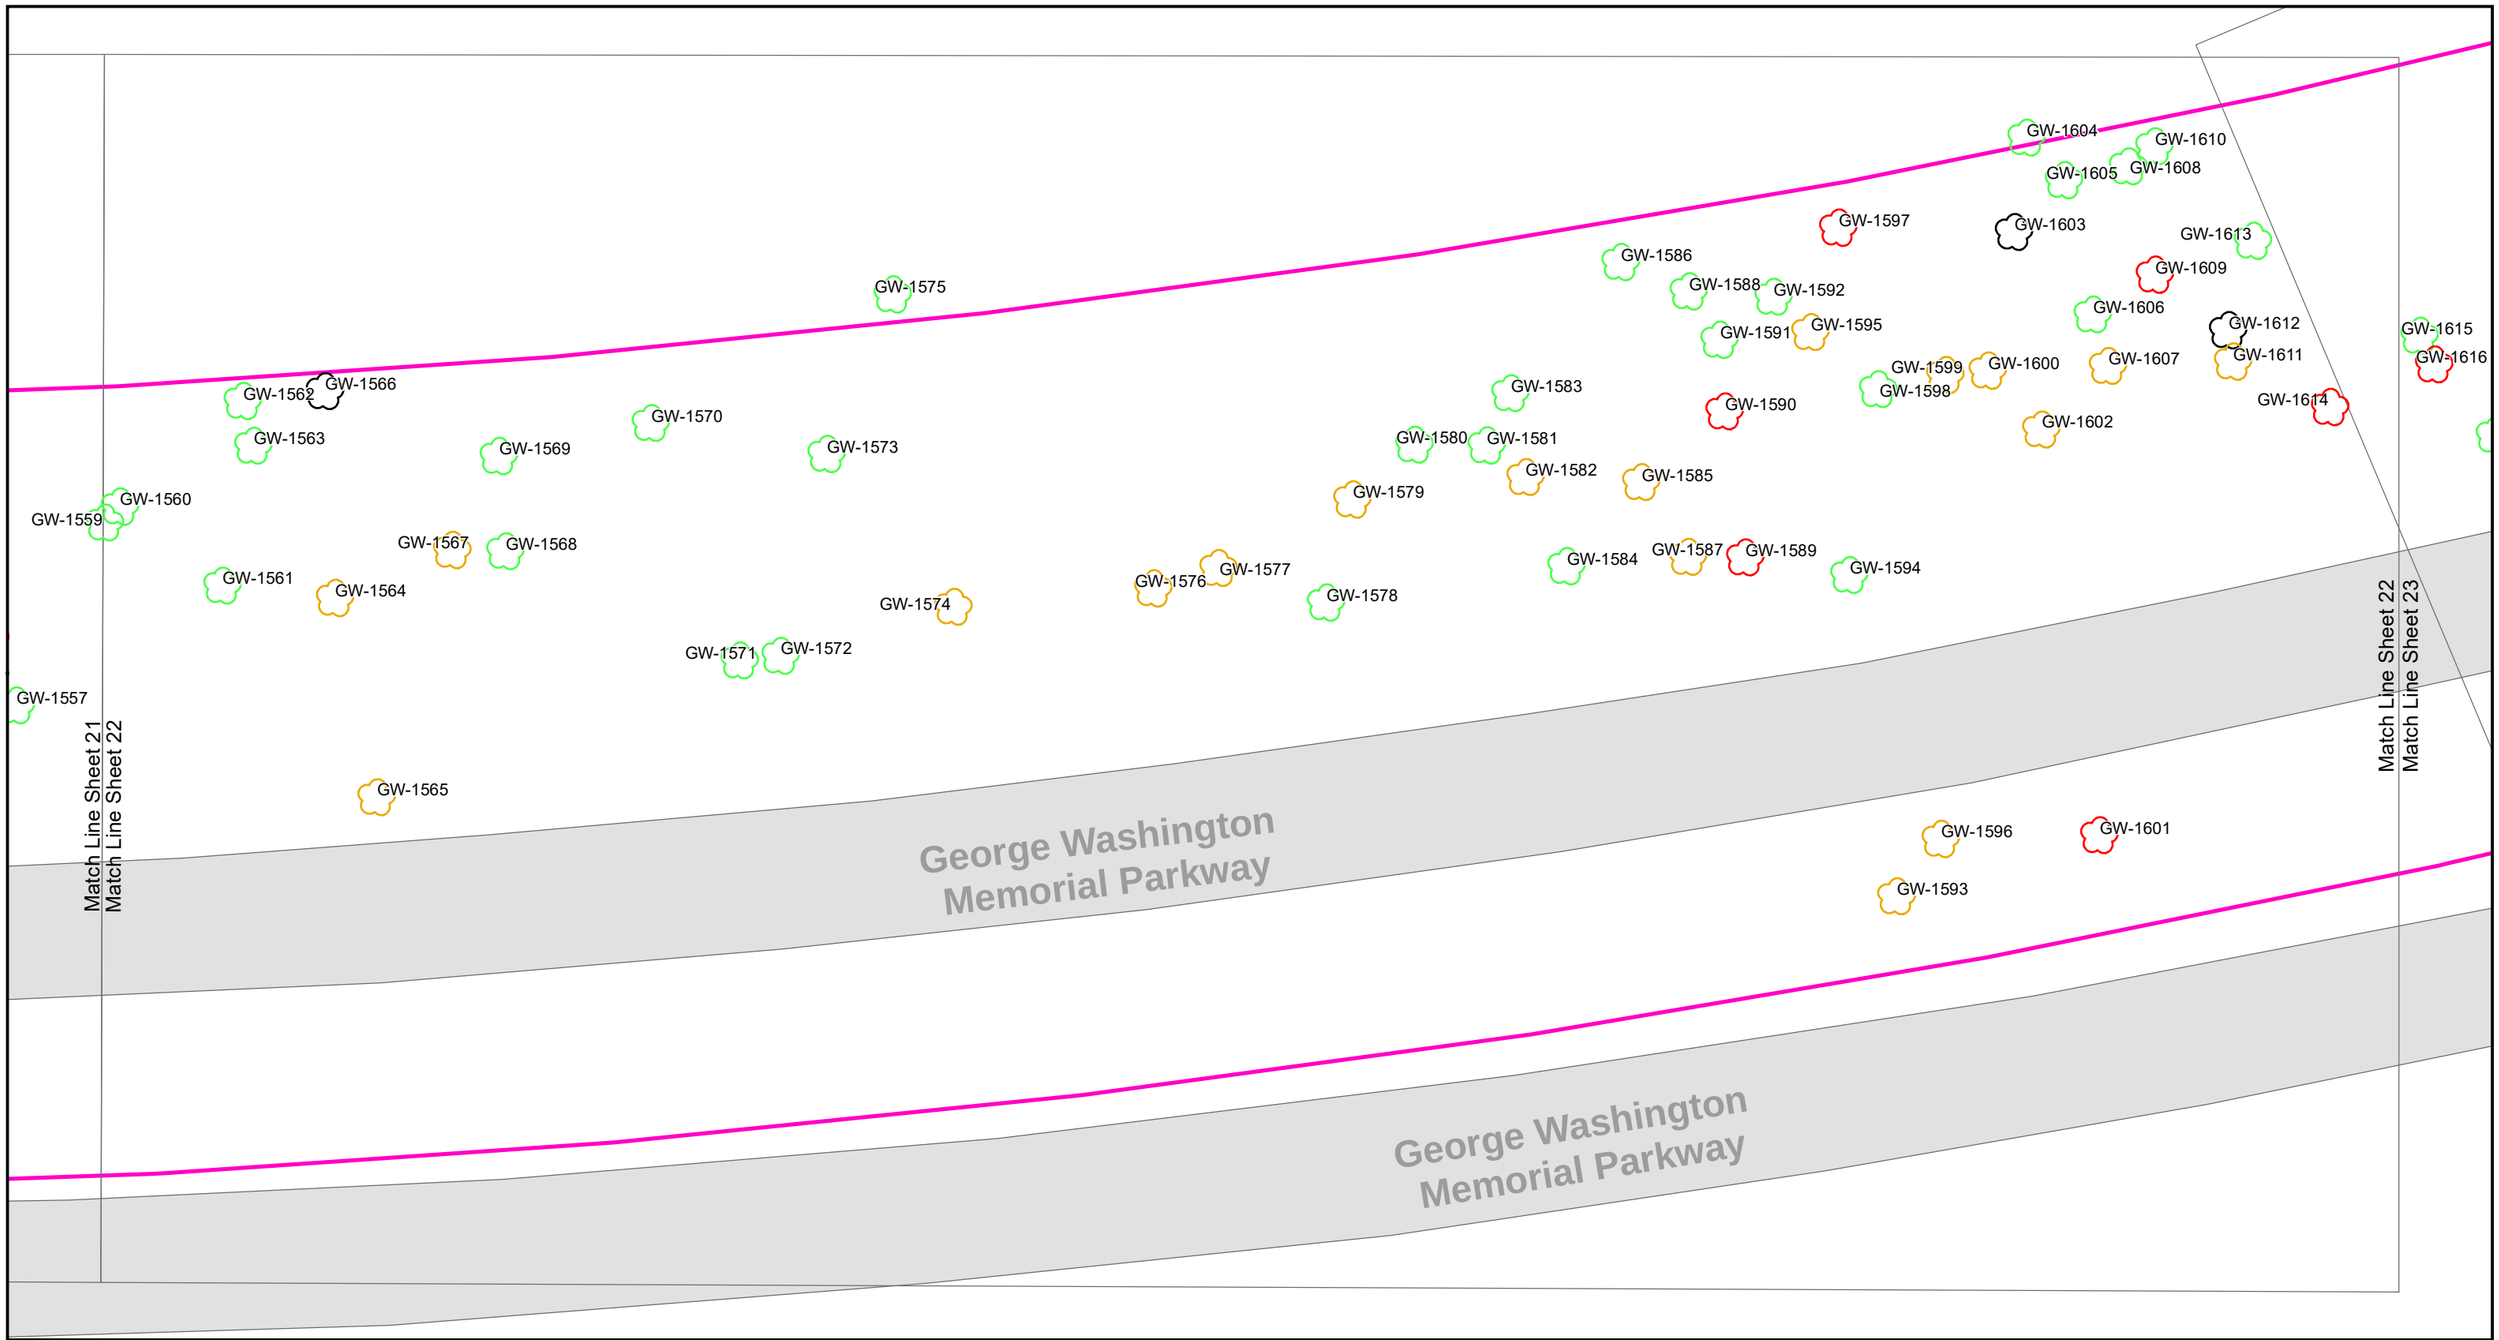

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | SHEET NO. 22 OF 51

GW-1608
GW-1610
GW-1613
GW-1612
GW-1611
GW-1614
GW-1615
GW-1616
GW-1618
GW-1619
GW-1620
GW-1622
GW-1621
GW-1624
GW-1628
GW-1623
GW-1625
GW-1626
GW-1627
GW-1634
GW-1632
GW-1631
GW-1629
GW-1633
GW-1630
GW-1635
GW-1636
GW-1637
GW-1638
GW-1641
GW-1642
GW-1640
GW-1639
GW-1643
GW-1644
GW-1645
GW-1646
GW-1647
GW-1650
GW-1648
GW-1649
GW-1653
GW-1652
GW-1651
GW-1654
GW-1655
GW-1657
GW-1656
GW-1658
GW-1659
GW-1660
GW-1662
GW-1666
GW-1665
GW-1664
GW-1670
GW-1675
GW-1676
GW-1673
GW-1674
GW-1672
GW-1668
GW-1669
GW-1661
GW-1663
GW-1667
GW-1671
GW-1678
GW-1677
GW-1679
GW-1682
GW-1680
GW-1685
GW-1681
GW-1683
GW-1687
GW-1684
GW-1688
GW-1689
GW-1686
GW-1617

Match Line Sheet 22
Match Line Sheet 23

Match Line Sheet 23
Match Line Sheet 24

George Washington Memorial Parkway

George Washington Memorial Parkway

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | SHEET NO. 23 OF 51

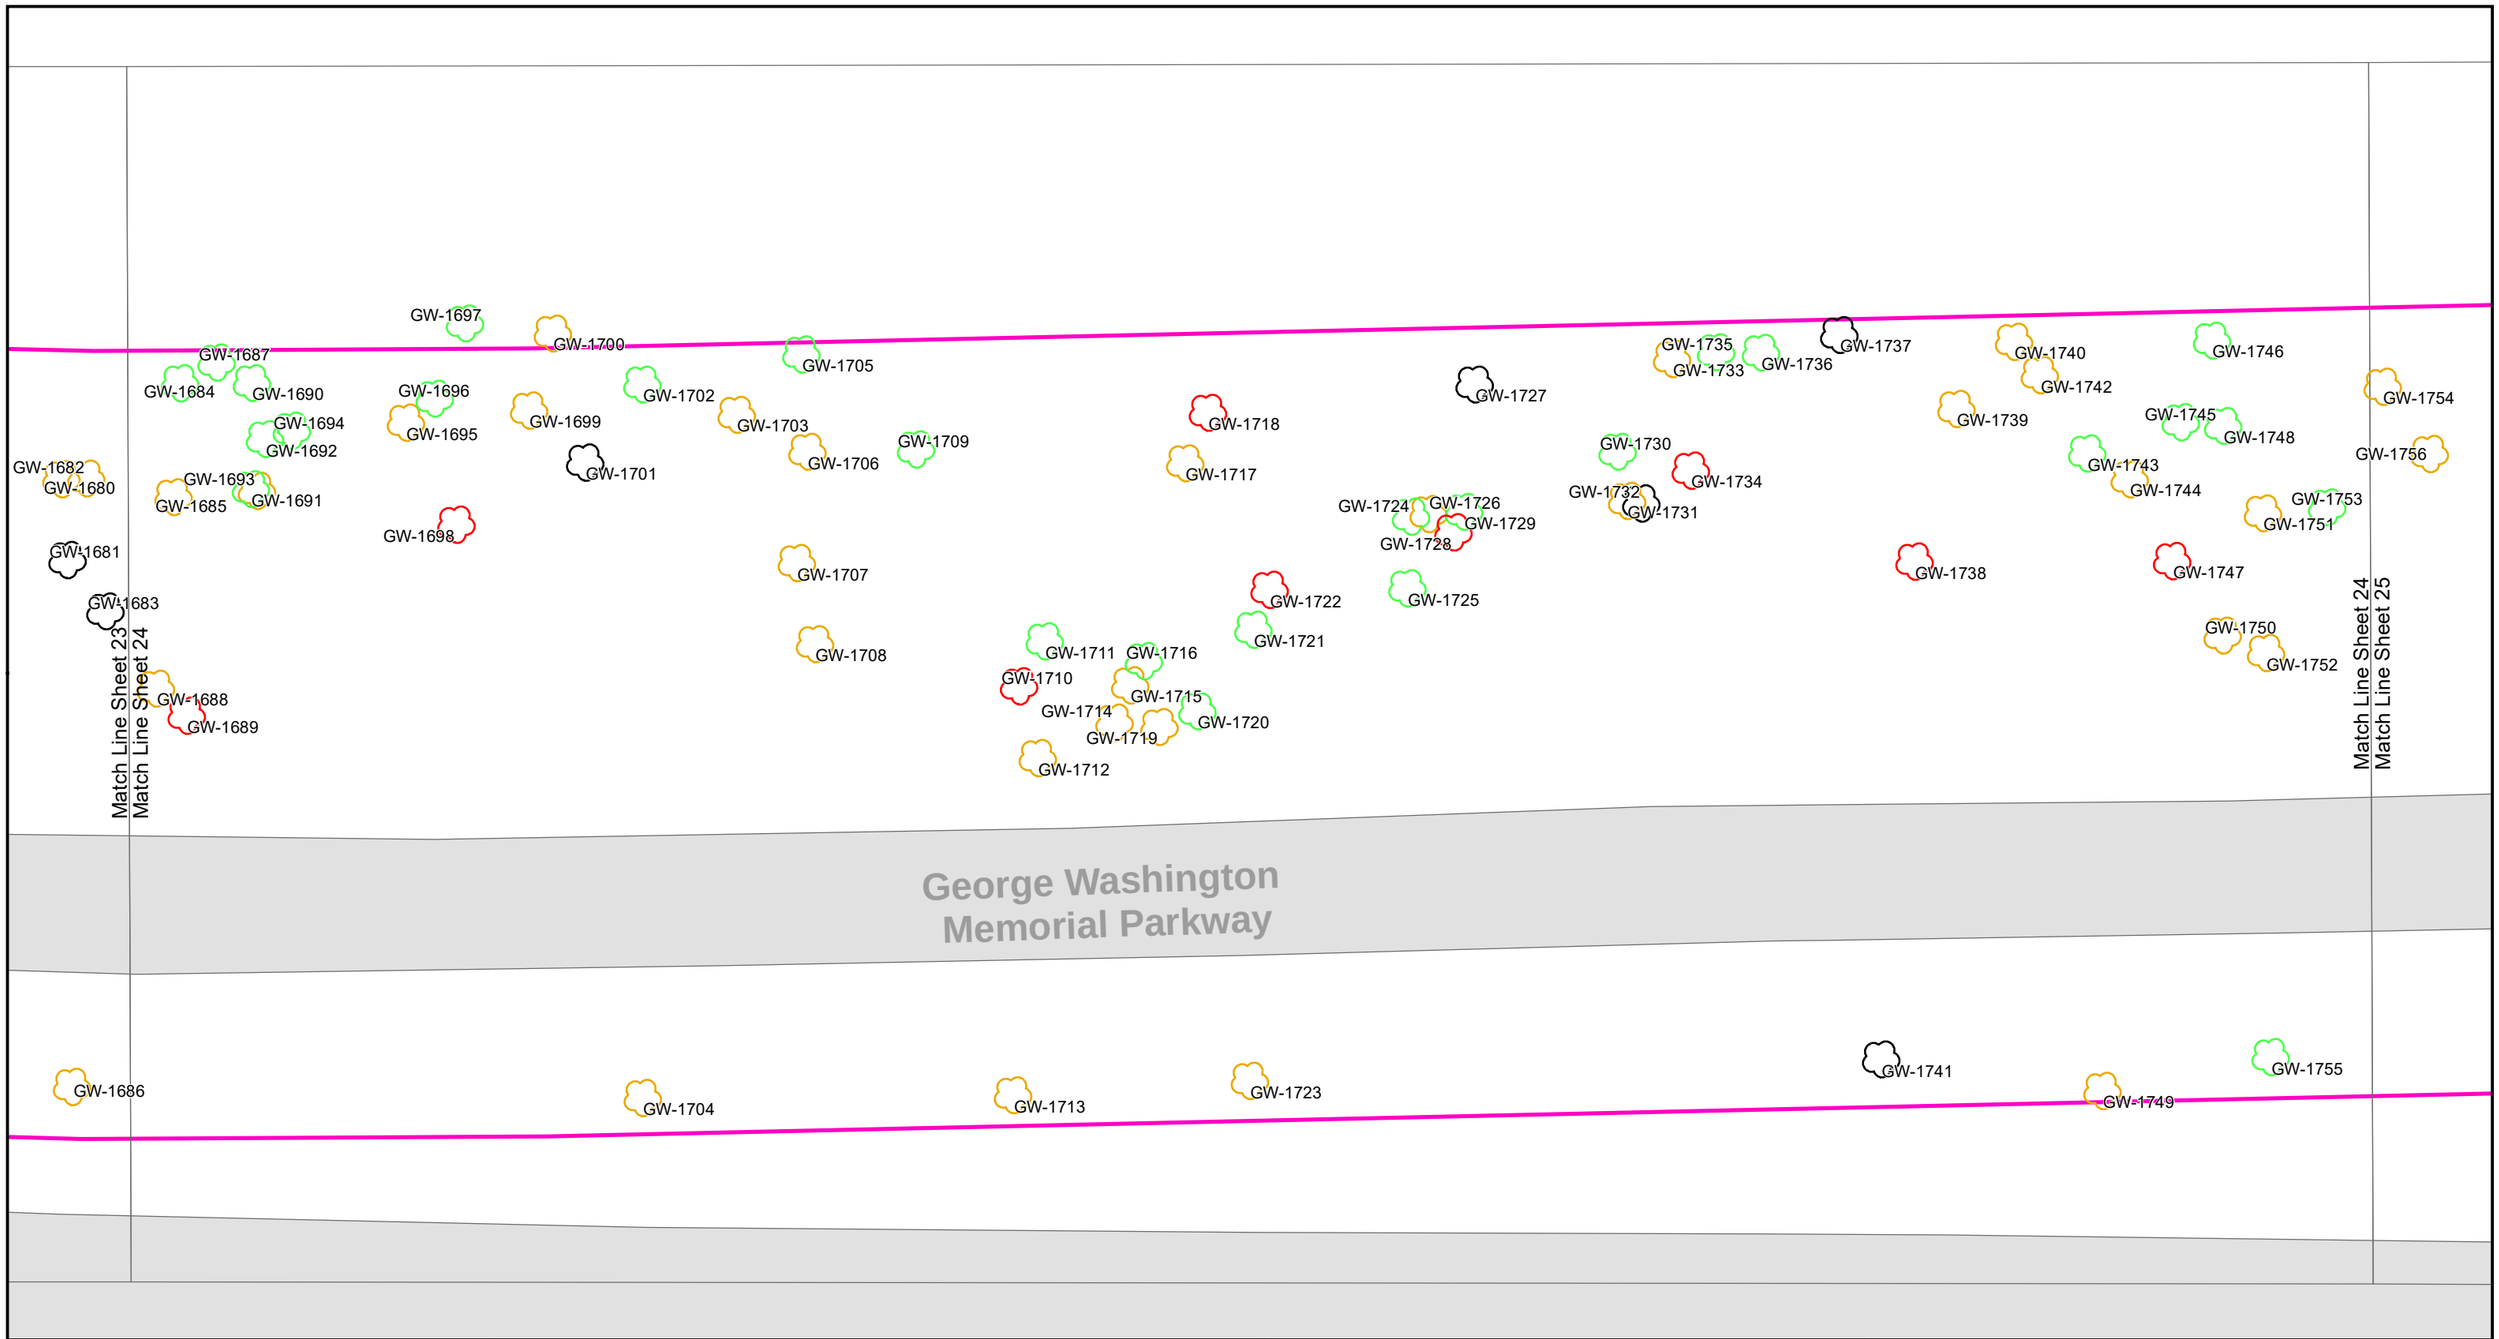

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021

GW-1759 GW-1762 GW-1758 GW-1766 GW-1770 GW-1769 GW-1767 GW-1757 GW-1754 GW-1756 GW-1753 GW-1761 GW-1765 GW-1760 GW-1764 GW-1763 GW-1768 GW-1772 GW-1774 GW-1776 GW-1773 GW-1777 GW-1778 GW-1779 GW-1780 GW-1775 GW-1781 GW-1784 GW-1786 GW-1789 GW-1791 GW-1785 GW-1783 GW-1787 GW-1788 GW-1790 GW-1792 GW-1793 GW-1794 GW-1795 GW-1798 GW-1799 GW-1804 GW-1806 GW-1800 GW-1805 GW-1807 GW-1796 GW-1803 GW-1797 GW-1802 GW-1801 GW-1808 GW-1809 GW-1810 GW-1811 GW-1812 GW-1813 GW-1814 GW-1815 GW-1816 GW-1819 GW-1820 GW-1821 GW-1822 GW-1823 GW-1824 GW-1825 GW-1826 GW-1827 GW-1828 GW-1830 GW-1832 GW-1833 GW-1836 GW-1839 GW-1840 GW-1841 GW-1838 GW-1843 GW-1845 GW-1846

Match Line Sheet 24
Match Line Sheet 25

Match Line Sheet 25
Match Line Sheet 26

George Washington Memorial Parkway

GW-1771 GW-1782 GW-1817 GW-1818 GW-1829 GW-1831 GW-1834 GW-1837 GW-1835 GW-1842 GW-1844 GW-1847

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | SHEET NO. 25 OF 51

GW-1848 GW-1865 GW-1870 GW-1872 GW-1877 GW-1881 GW-1874 GW-1878 GW-1900 GW-1890 GW-1892 GW-1898 GW-1909 GW-1938

GW-1851 GW-1859 GW-1902 GW-1886 GW-1901 GW-1907 GW-1910 GW-1932 GW-1937

GW-1856 GW-1891 GW-1915 GW-1928

GW-1843 GW-1852 GW-1887 GW-1917 GW-1923

GW-1846 GW-1857 GW-1864 GW-1869 GW-1884 GW-1889 GW-1895 GW-1922 GW-1924 GW-1933 GW-1939

GW-1854 GW-1904

GW-1845 GW-1849 GW-1858 GW-1894 GW-1916

GW-1855 GW-1875 GW-1879 GW-1883 GW-1906 GW-1930 GW-1934

GW-1885 GW-1899

GW-1853 GW-1873 GW-1882 GW-1919 GW-1931

GW-1850 GW-1867 GW-1888 GW-1920 GW-1926

GW-1903

GW-1876 GW-1880 GW-1893 GW-1897 GW-1927

GW-1905 GW-1936

GW-1896

GW-1911

GW-1862 GW-1908

GW-1868

GW-1860 GW-1863 GW-1871 GW-1913

GW-1941

GW-1847 GW-1918

GW-1861 GW-1866 GW-1929

GW-1914

GW-1935

GW-1912 GW-1925

Match Line Sheet 25
Match Line Sheet 26

Match Line Sheet 26
Match Line Sheet 27

George Washington
Memorial Parkway

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees

- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | SHEET NO. 26 OF 51

GW-1942 GW-1944
GW-1938
GW-1962
GW-1972
GW-1976
GW-1979
GW-1988
GW-1998
GW-2006
GW-1963
GW-1966
GW-1953
GW-1973
GW-1989
GW-1994
GW-2009
GW-2020
GW-1932
GW-1937
GW-1974
GW-2018
GW-1969
GW-1985
GW-2000
GW-2010
GW-2017
GW-1959
GW-1975
GW-1977
GW-1996
GW-2002
GW-2008
GW-2022
GW-2026
GW-1990
GW-1991
GW-2007
GW-1970
GW-2024
GW-1933
GW-1939
GW-1940
GW-1950
GW-1968
GW-1981
GW-2023
GW-2029
GW-2034
GW-1934
GW-1978
GW-2011
GW-2013
GW-2016
GW-1930
GW-1964
GW-1971
GW-1999
GW-2014
GW-1943
GW-1945
GW-1954
GW-1982
GW-2004
GW-2015
GW-2021
GW-2031
GW-1931
GW-1948
GW-1946
GW-2028
GW-1952
GW-1956
GW-1957
GW-1958
GW-1995
GW-2030
GW-1936
GW-1949
GW-1980
GW-2005
GW-1961
GW-2033
GW-1951
GW-1986
GW-2012
GW-2019
GW-1992
GW-2001
GW-1965
GW-2032
GW-1987
GW-1997
GW-2025
GW-2027
GW-2035

Match Line Sheet 26
Match Line Sheet 27

George Washington
Memorial Parkway

GW-1941
GW-1955
GW-1947
GW-1983
GW-1960
GW-1967
GW-1984
GW-1993
GW-2003

Match Line Sheet 27
Match Line Sheet 28

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees

- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021

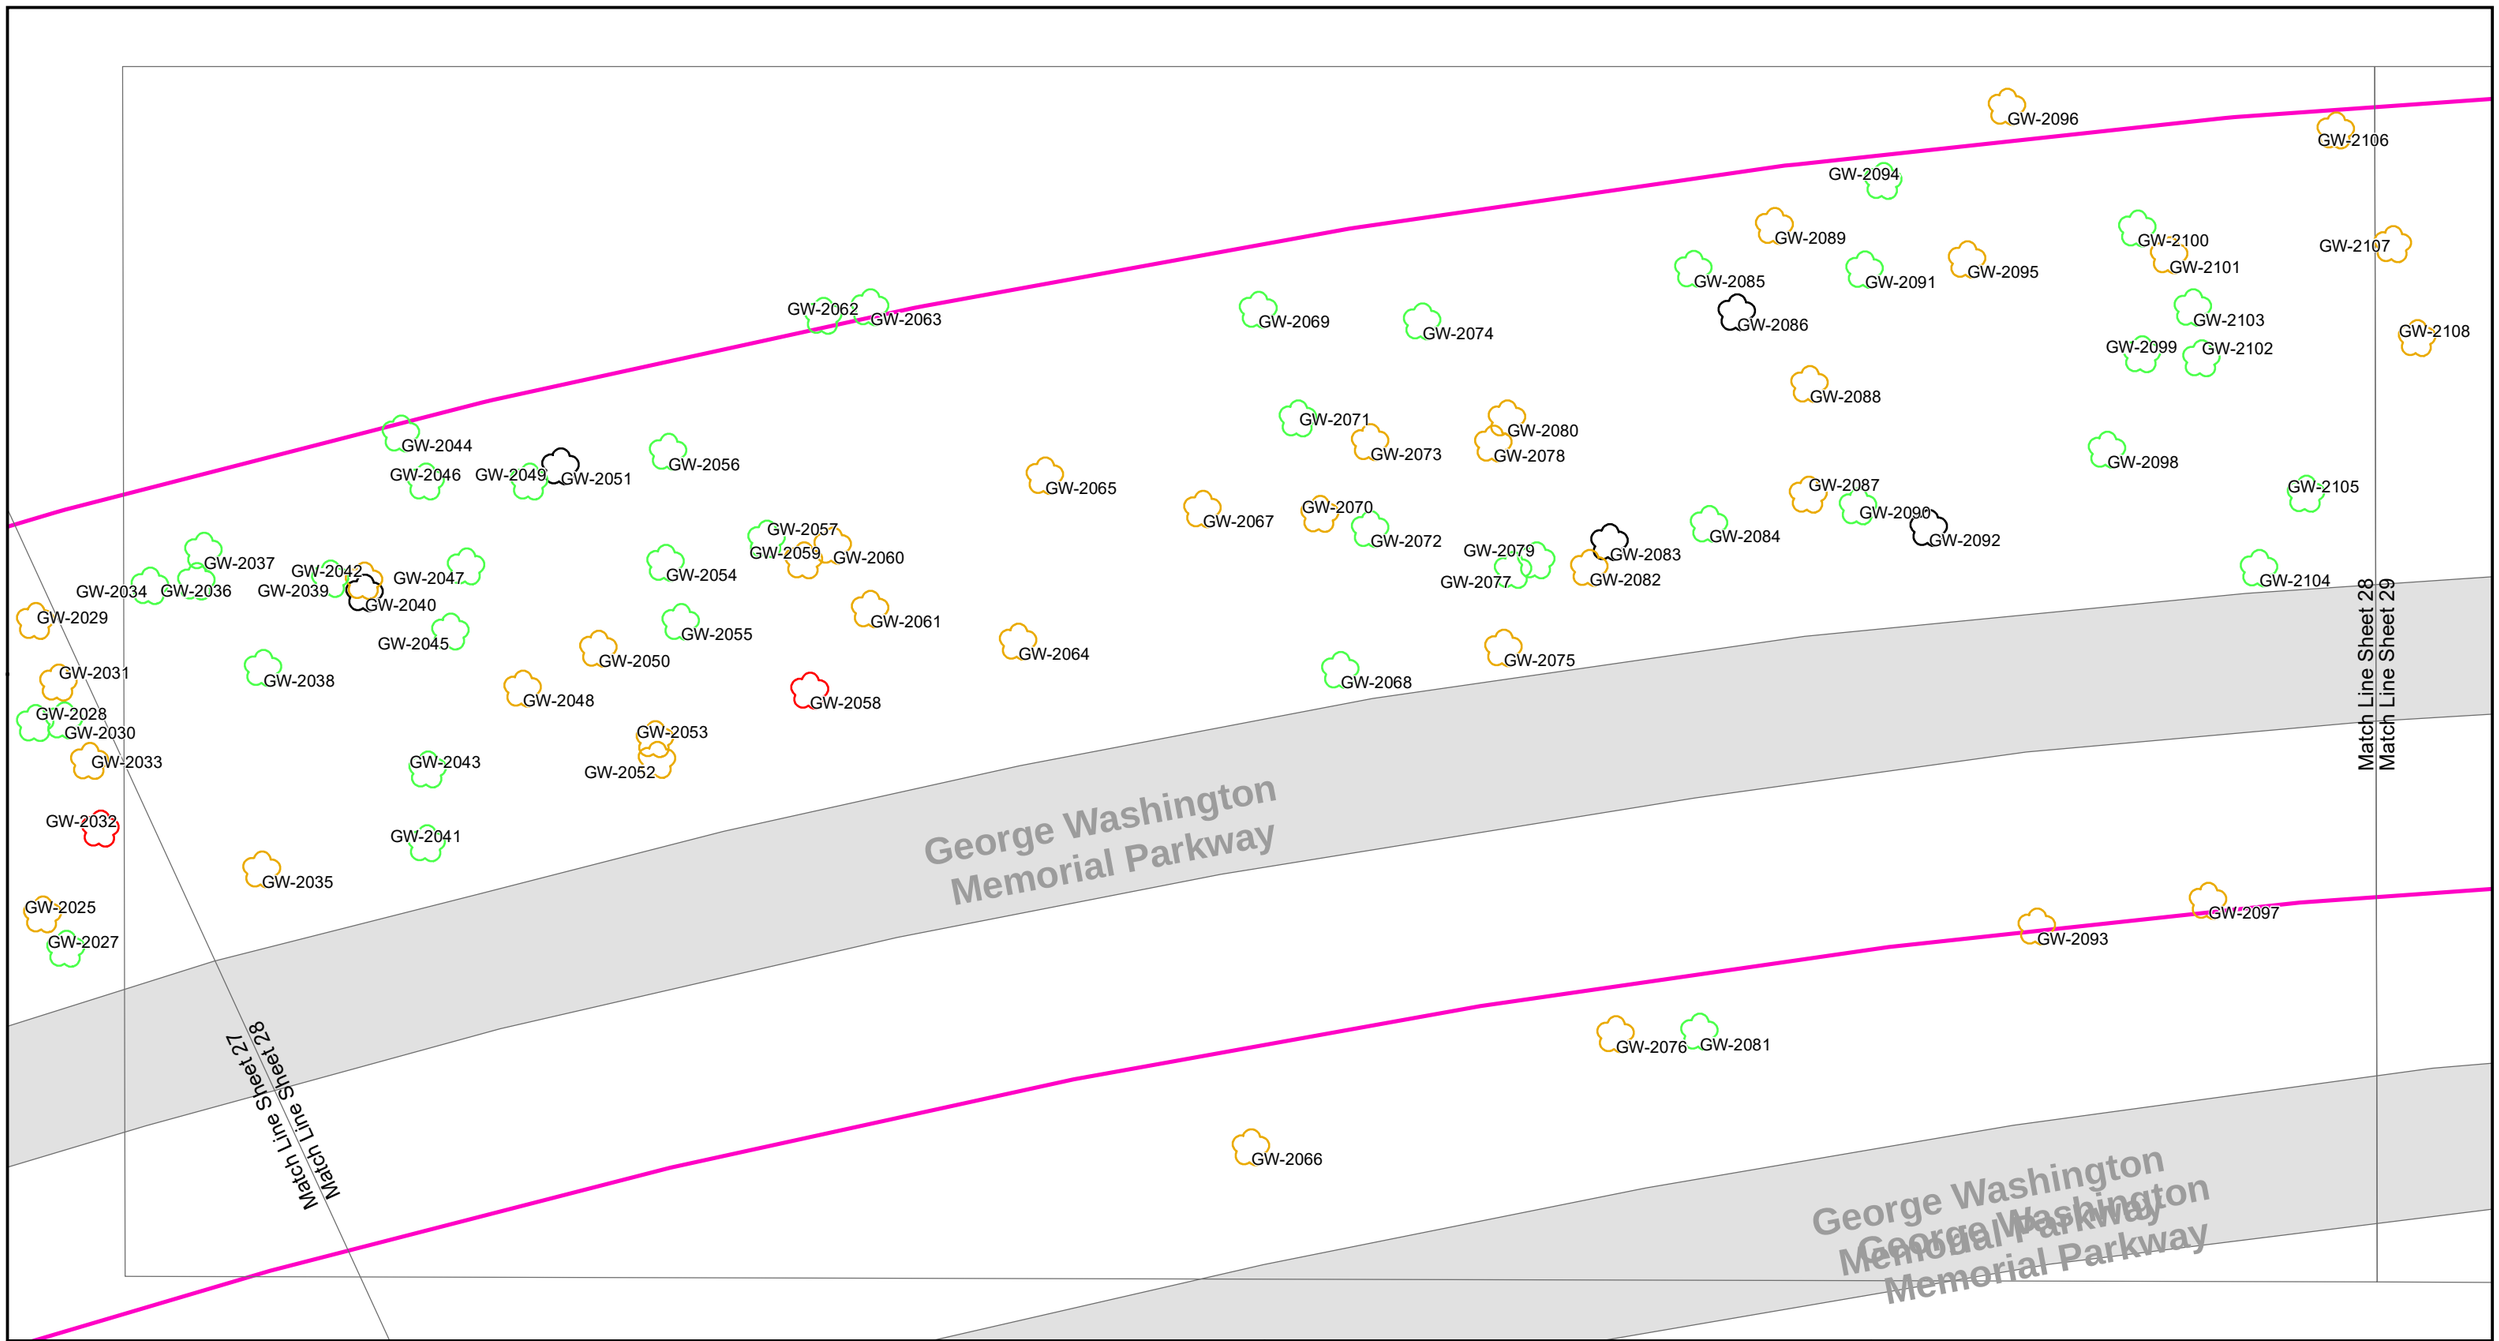

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL


NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021 | SHEET NO. 28 OF 51

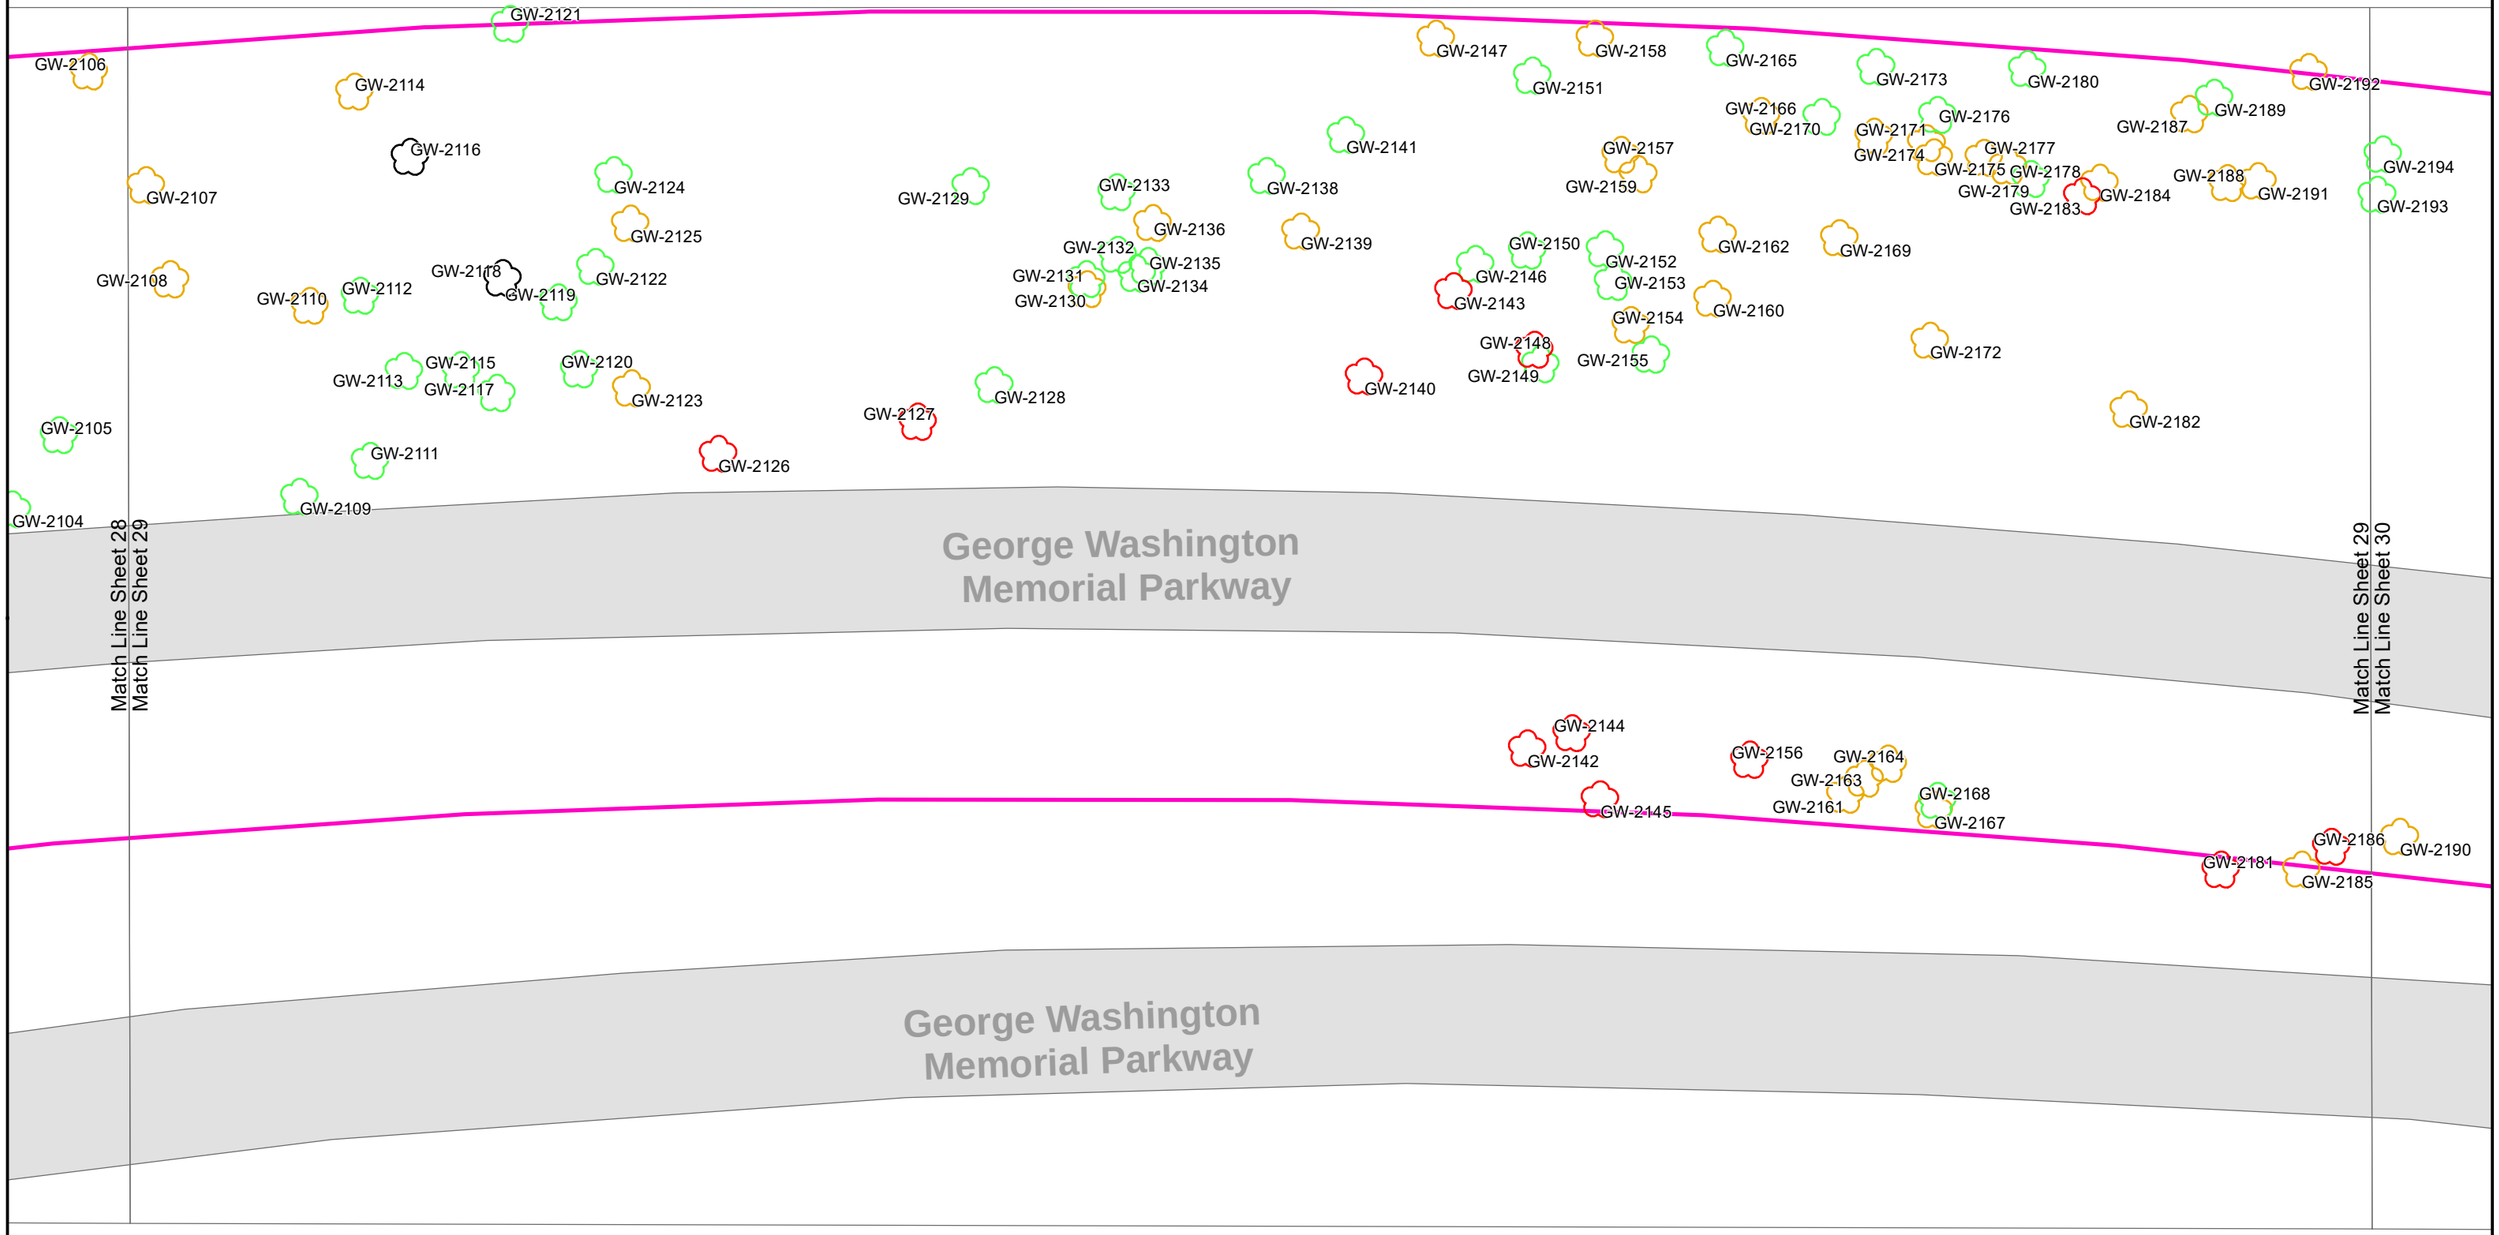

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021

GW-2192
GW-2194
GW-2193
GW-2198
GW-2197
GW-1935
GW-2199
GW-2203
GW-2201
GW-2205
GW-2202
GW-2204
GW-2207
GW-2208
GW-2215
GW-2216
GW-2213
GW-2220
GW-2222
GW-2219
GW-2228
GW-2212
GW-2223
GW-2235
GW-2237
GW-2206
GW-2214
GW-2217
GW-2226
GW-2229
GW-2210
GW-2211
GW-2218
GW-2221
GW-2224
GW-2243
GW-2253
GW-2259
GW-2234
GW-2236
GW-2238
GW-2233
GW-2244
GW-2249
GW-2247
GW-2254
GW-2257
GW-2262
GW-2209
GW-2231
GW-2230
GW-2227
GW-2225
GW-2232
GW-2239
GW-2248
GW-2251
GW-2272
GW-2242
GW-2241
GW-2240
GW-2246
GW-2245
GW-2250
GW-2263
GW-2252
GW-2271
GW-2261
GW-2267
GW-2268
GW-2256
GW-2255
GW-2258
GW-2264
GW-2265
GW-2260
GW-2266
GW-2186
GW-2185
GW-2190
GW-2195
GW-2200

Match Line Sheet 29
Match Line Sheet 30

Match Line Sheet 30
Match Line Sheet 31

George Washington Memorial Parkway

George Washington Memorial Parkway

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MDOT MARYLAND DEPARTMENT OF TRANSPORTATION STATE HIGHWAY ADMINISTRATION

495 270 MANAGED LANES STUDY

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021

Match Line Sheet 30
Match Line Sheet 31

GW-2263
GW-2271
GW-2267
GW-2268
GW-2273
GW-2264
GW-2270
GW-2260
GW-2269
GW-2265
GW-2266
GW-2272
GW-2276
GW-2275
GW-2277
GW-2274
GW-2284
GW-2283
GW-2278
GW-2282
GW-2279
GW-2281
GW-2285
GW-2287
GW-2280
GW-2292
GW-2293
GW-2289
GW-2298
GW-2297
GW-2296
GW-2288
GW-2306
GW-2310
GW-2307
GW-2308
GW-2311
GW-2322
GW-2326
GW-2329
GW-2321
GW-2328
GW-2330
GW-2302
GW-2305
GW-2314
GW-2324
GW-2323
GW-2291
GW-2295
GW-2290
GW-2312
GW-2313
GW-2319
GW-2303
GW-2304
GW-2309
GW-2294
GW-2286
GW-2300
GW-2301
GW-2299
GW-2317
GW-2320
GW-2315
GW-2316
GW-2318
GW-2325
GW-2327

George Washington Memorial Parkway

Turkey Run

0 5 10 15 20 25 Feet

SCALE: 1" = 25'

Legend

- NPS Boundary
- Study Area
- Right-of-Way
- VDOT Trees
- GW-# Tree in Excellent Condition
- GW-# Tree in Good Condition
- GW-# Tree in Fair Condition
- GW-# Tree in Poor Condition
- GW-# Standing Dead

*GW = George Washington Memorial Parkway

PRE-DECISIONAL, DELIBERATIVE & CONFIDENTIAL

NOTES:
1. Tree Condition Assessment Guidelines are detailed on Sheet 32. For species, condition, and diameter-at-breast height of the trees shown on this map, see the Tree Table starting on Sheet 33.

MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

495 MANAGED LANES STUDY 270

I-495 & I-270 MANAGED LANES STUDY
NATIONAL PARK SERVICE TREE INVENTORY
GEORGE WASHINGTON MEMORIAL PARKWAY (GW)

AUGUST 2021

Tree Condition Assessment Guidelines:

- ***Excellent*** – healthy tree with exceptional growth form; no visible defects; well-formed crown; few minor dead branches acceptable; this tree condition is rare.
- ***Good*** – healthy tree; very minor defects/decay acceptable with callous forming/complete; well-formed crown; minor lean and/or few minor/major dead branches acceptable; vines may be growing along trunk but not present within crown.
- ***Fair*** – health questionable/stress evident; structurally sound tree; defects present that do not affect structural integrity; moderate lean; minor/major dead branches may be present; crown not broken out but not necessarily well formed or even; vines may be growing along trunk and within crown.

  Ex. Fair tree could be experiencing insect damage, or exhibit a growth form that makes it very susceptible to wind damage in an open setting.
- ***Poor*** – significant health problems; may be structurally unsound; may be dead or dying; may contain significant decay; may have broken or missing top/crown; may have heavy lean; vines may be significantly affecting tree health.
- ***Standing dead*** – any tree inventoried that was standing upright and determined to be dead by the field team.

These tree species may commonly exhibit dead branches and/or ratty growth form/structure, which should be taken into account when assessing tree condition:

- Mulberry (*Morus spp*.)
- Pin Oak (*Quercus palustris*)
- Silver Maple (*Acer saccharinum*)
- Virginia Pine (*Pinus virginiana*)
- Scarlet Oak (*Quercus coccinea*)
- Black Locust (*Robinia pseudoacacia*)
- Osage Orange (*Maclura pomifera*)
- Willow Oak (*Quercus phellos*)
- Black Willow (*Salix nigra*)

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
George Washington Memorial Parkway								
GW-1	Red maple	*Acer rubrum*	10	1	5	15	Poor	Topped leader, unbalanced crown, trunk decaying
GW-2	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
GW-3	Red maple	*Acer rubrum*	18	1	9	27	Fair	Branch dieback in crown, exposed roots
GW-4	Mockernut hickory	*Carya tomentosa*	10	1	5	15	Fair	Minor gall at base of trunk
GW-5	American beech	*Fagus grandifolia*	8	1	4	12	Fair	Low branch dieback
GW-6	Blackgum	*Nyssa sylvatica*	12	1	6	18	Good	
GW-7	Blackgum	*Nyssa sylvatica*	6	1	3	9	Fair	Suckering/water sprouts, low branch dieback
GW-8	Red maple	*Acer rubrum*	14	1	7	21	Good	Large branch removed in crown, exposed roots
GW-9	White oak	*Quercus alba*	23	1	11.5	34.5	Good	Thin crown
GW-10	Red maple	*Acer rubrum*	11	1	5.5	16.5	Fair	Irregular branching structure in crown
GW-11	White oak	*Quercus alba*	22	1	11	33	Fair	Branch dieback in crown
GW-12	American beech	*Fagus grandifolia*	11	1	5.5	16.5	Good	
GW-13	Mockernut hickory	*Carya tomentosa*	14	1	7	21	Good	
GW-14	Chestnut oak	*Quercus montana*	22	1	11	33	Good	
GW-15	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Fair	Irregular bark on trunk into crown
GW-16	Chestnut oak	*Quercus montana*	8	1	4	12	Fair	Leaning, branch dieback in crown
GW-17	Chestnut oak	*Quercus montana*	22	1	11	33	Fair	Trunk trunks in crown, branch dieback in lower canopy
GW-18	Red maple	*Acer rubrum*	16	1	8	24	Fair	Cavity at base healing, twin trunks above DBH, second stem is dead
GW-19	Chestnut oak	*Quercus montana*	5	1	2.5	7.5	Good	Slight lean
GW-20	Red maple	*Acer rubrum*	6	1	3	9	Good	Slight lean
GW-21	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Lots of water sprouts, galls at base of trunk
GW-22	Maple sp.	*Acer sp.*	7	1	N/A	N/A	Standing Dead	
GW-23	Tuliptree	*Liriodendron tulipifera*	27	1	13.5	40.5	Good	
GW-24	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-25	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Fair	Stressed, reduced canopy
GW-26*	Tuliptree	*Liriodendron tulipifera*	36	1	18	54	Good	Minor trunk rot at base
GW-27*	Tuliptree	*Liriodendron tulipifera*	46	1	23	69	Good	
GW-28	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Good	
GW-29	Northern red oak	*Quercus rubra*	7	1	3.5	10.5	Good	
GW-30	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-31	Tuliptree	*Liriodendron tulipifera*	12	1	N/A	N/A	Standing Dead	
GW-32	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-33	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Fair	Stressed, dead branches
GW-34	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Good	
GW-35*	Tuliptree	*Liriodendron tulipifera*	34	1	17	51	Good	
GW-36	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Good	
GW-37	Sugar maple	*Acer saccharum*	6	1	3	9	Good	Good
GW-38	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-39*	White oak	*Quercus alba*	38	1	19	57	Good	Few dead limbs
GW-40	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Good	
GW-41	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Good	
GW-42	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Good	
GW-43	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	
GW-44	Sugar maple	*Acer saccharum*	12	1	6	18	Good	
GW-45	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Good	
GW-46	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	Good
GW-47*	Scarlet oak	*Quercus coccinea*	32	1	16	48	Good	Many vines at base
GW-48	Unknown		11	1	N/A	N/A	Standing Dead	
GW-49	Tuliptree	*Liriodendron tulipifera*	7	1	N/A	N/A	Standing Dead	
GW-50	American beech	*Fagus grandifolia*	17	1	8.5	25.5	Excellent	
GW-51*	Tuliptree	*Liriodendron tulipifera*	32	1	16	48	Good	
GW-52	Unknown		12	1	N/A	N/A	Standing Dead	
GW-53	American beech	*Fagus grandifolia*	17	1	8.5	25.5	Excellent	
GW-54*	Tuliptree	*Liriodendron tulipifera*	33	1	16.5	49.5	Good	
GW-55*	Tuliptree	*Liriodendron tulipifera*	32	1	16	48	Good	
GW-56*	Tuliptree	*Liriodendron tulipifera*	31	1	15.5	46.5	Good	Few dead branches
GW-57	Sugar maple	*Acer saccharum*	5	1	2.5	7.5	Good	
GW-58	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Good	One dead leader
GW-59	Unknown		6	1	N/A	N/A	Standing Dead	
GW-60*	Tuliptree	*Liriodendron tulipifera*	31	1	15.5	46.5	Excellent	
GW-61	Black locust	*Robinia pseudoacacia*	9	1	N/A	N/A	Standing Dead	
GW-62	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Fair	Stunted growth, dead branches
GW-63	Sugar maple	*Acer saccharum*	6	1	3	9	Fair	Fair trunk damage dead branches
GW-64	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	
GW-65	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Good	
GW-66	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Good	
GW-67	Northern red oak	*Quercus rubra*	21	1	10.5	31.5	Good	Vines, few dead branches
GW-68	Sugar maple	*Acer saccharum*	6	1	3	9	Good	
GW-69	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Good	
GW-70*	Tuliptree	*Liriodendron tulipifera*	32	1	16	48	Good	
GW-71	American beech	*Fagus grandifolia*	6	1	3	9	Good	Good
GW-72	Red maple	*Acer rubrum*	14, 10, 9	3	7	21	Fair	Trunk rot, fungi on trunk, multistem trunk 14 x 10 x 9
GW-73	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Good	
GW-74	Pignut hickory	*Carya glabra*	6	1	3	9	Good	
GW-75	Sugar maple	*Acer saccharum*	9	1	4.5	13.5	Fair	Dead branches
GW-76	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Fair	Fair trunk rot at base
GW-77	Unknown		11	1	N/A	N/A	Standing Dead	
GW-78*	Tuliptree	*Liriodendron tulipifera*	33	1	16.5	49.5	Good	
GW-79	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-80	Unknown		17	1	N/A	N/A	Standing Dead	
GW-81	American basswood	*Tilia americana*	7	1	3.5	10.5	Fair	Dead branches, leaning
GW-82	Black locust	*Robinia pseudoacacia*	6	1	3	9	Poor	Second trunk dead, reduced canopy
GW-83	Sugar maple	*Acer saccharum*	6	1	3	9	Good	
GW-84*	Tuliptree	*Liriodendron tulipifera*	31	1	15.5	46.5	Good	
GW-85	Black locust	*Robinia pseudoacacia*	8	1	4	12	Fair	Leaning
GW-86	Sugar maple	*Acer saccharum*	24	1	12	36	Fair	Few dead limbs
GW-87	Sugar maple	*Acer saccharum*	11	1	5.5	16.5	Good	Minor vines
GW-88	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Good	
GW-89	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Fair	Trunk rot at base
GW-90	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Good	
GW-91	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Good	Small hole at base
GW-92	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Fair	Vines in canopy
GW-93	Tuliptree	*Liriodendron tulipifera*	28, 21	2	14	42	Good	Twin trunks 28 x 21
GW-94	American beech	*Fagus grandifolia*	8	1	4	12	Good	
GW-95	Oak sp.	*Quercus sp.*	42	1	N/A	N/A	Standing Dead	
GW-96	Unknown		13	1	N/A	N/A	Standing Dead	
GW-97	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Poor	Trunk rot at base, dead leader, sparse canopy
GW-98	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	
GW-99	Pignut hickory	*Carya glabra*	10	1	5	15	Good	
GW-100	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-101	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Fair	Trunk rot at base
GW-102*	Tuliptree	*Liriodendron tulipifera*	38	1	19	57	Good	
GW-103*	Tuliptree	*Liriodendron tulipifera*	33	1	16.5	49.5	Good	
GW-104	Tuliptree	*Liriodendron tulipifera*	27	1	13.5	40.5	Good	
GW-105	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	
GW-106	Tuliptree	*Liriodendron tulipifera*	19, 13	2	9.5	28.5	Fair	Twin trunk 19 x 13, dead branches, hole in trunk
GW-107	Oak sp.	*Quercus sp.*	17	1	N/A	N/A	Standing Dead	
GW-108*	Tuliptree	*Liriodendron tulipifera*	34	1	17	51	Good	
GW-109	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Fair	Vines in canopy
GW-110	Tuliptree	*Liriodendron tulipifera*	5	1	2.5	7.5	Poor	Vines choking tree
GW-111	Sugar maple	*Acer saccharum*	8	1	4	12	Good	
GW-112	Unknown		9	1	N/A	N/A	Standing Dead	
GW-113	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Fair	Vines in canopy, few dead branches
GW-114	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Poor	Broken trunk
GW-115	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	
GW-116	Sugar maple	*Acer saccharum*	6	1	3	9	Good	
GW-117	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Good	
GW-118	Red maple	*Acer rubrum*	15	1	7.5	22.5	Fair	Trunk rot at base
GW-119	Scarlet oak	*Quercus coccinea*	25	1	12.5	37.5	Good	With vines
GW-120	Slippery elm	*Ulmus rubra*	8	1	4	12	Fair	Trunk damage, few dead branches
GW-121	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-122	Sugar maple	*Acer saccharum*	6	1	3	9	Good	
GW-123	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Good	
GW-124	Red maple	*Acer rubrum*	15	1	7.5	22.5	Good	Few dead branches
GW-125	Sugar maple	*Acer saccharum*	5	1	2.5	7.5	Good	
GW-126	Tree of heaven	*Ailanthus altissima*	5	1	2.5	7.5	Poor	Leaning, extensive vines
GW-127	Tree of heaven	*Ailanthus altissima*	6	1	3	9	Poor	Leaning, extensive vines
GW-128	Bitternut hickory	*Carya cordiformis*	17, 17	2	8.5	25.5	Fair	Twin trunk 17 x 17, dead branches
GW-129	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Good	
GW-130	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	
GW-131	Red maple	*Acer rubrum*	16	1	8	24	Fair	Vines in canopy
GW-132	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Good	

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-133	Tree of heaven	*Ailanthus altissima*	6	1	3	9	Poor	Leaning, extensive vines
GW-134	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-135	Unknown		7	1	N/A	N/A	Standing Dead	
GW-136	Tree of heaven	*Ailanthus altissima*	7	1	3.5	10.5	Fair	Leaning, extensive vines
GW-137	Chestnut oak	*Quercus montana*	18	1	9	27	Fair	Hole at base of trunk
GW-138	American beech	*Fagus grandifolia*	11	1	5.5	16.5	Good	
GW-139	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	
GW-140	American beech	*Fagus grandifolia*	17	1	8.5	25.5	Good	
GW-141	Tree of heaven	*Ailanthus altissima*	6	1	3	9	Poor	Leaning, extensive vines
GW-142	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-143	Tree of heaven	*Ailanthus altissima*	5	1	2.5	7.5	Fair	Leaning
GW-144	Sugar maple	*Acer saccharum*	21	1	10.5	31.5	Good	
GW-145	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Fair	Vines in canopy, straggling tree
GW-146	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Good	
GW-147	Tree of heaven	*Ailanthus altissima*	6	1	3	9	Poor	Leaning, extensive vines
GW-148	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Good	Fused at base with GW-1675
GW-149	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Good	
GW-150	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Good	
GW-151*	Tuliptree	*Liriodendron tulipifera*	32	1	16	48	Good	
GW-152	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	
GW-153	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Fair	Vines in canopy, broken limbs
GW-154	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Good	
GW-155	Green ash	*Fraxinus pennsylvanica*	12	1	6	18	Poor	Many vines, dying
GW-156	Tree of heaven	*Ailanthus altissima*	6	1	3	9	Poor	Leaning, extensive vines
GW-157	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	
GW-158	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Good	Minor fungus
GW-159	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	Few vines
GW-160	American beech	*Fagus grandifolia*	21	1	10.5	31.5	Excellent	
GW-161	Red maple	*Acer rubrum*	12	1	6	18	Good	
GW-162	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Fair	Reduced canopy, vines
GW-163	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Good	
GW-164	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Vines in canopy
GW-165	Red maple	*Acer rubrum*	6	1	3	9	Poor	Possibly dead with many vines in canopy
GW-166	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	
GW-167	American elm	*Ulmus americana*	6	1	3	9	Fair	With vines in canopy
GW-168	American beech	*Fagus grandifolia*	11	1	5.5	16.5	Good	
GW-169	Unknown		12, 8	2	N/A	N/A	Standing Dead	Twin trunks 12 x 8
GW-170	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Fair	Reduced canopy, few dead limbs
GW-171	American beech	*Fagus grandifolia*	8	1	4	12	Good	
GW-172	Red maple	*Acer rubrum*	9	1	4.5	13.5	Poor	Dying
GW-173	Tuliptree	*Liriodendron tulipifera*	27	1	13.5	40.5	Good	
GW-174	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Fair	Trunk damage, leaning
GW-175	Blackgum	*Nyssa sylvatica*	7	1	3.5	10.5	Good	
GW-176	Blackgum	*Nyssa sylvatica*	7	1	3.5	10.5	Good	
GW-177	Chestnut oak	*Quercus montana*	25	1	12.5	37.5	Fair	Several dead branches
GW-178	Red maple	*Acer rubrum*	7	1	3.5	10.5	Poor	Broken and topped, one living branch
GW-179	American holly	*Ilex opaca*	6	1	3	9	Good	
GW-180	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	
GW-181	Mockernut hickory	*Carya tomentosa*	7	1	3.5	10.5	Good	
GW-182	Red maple	*Acer rubrum*	10	1	5	15	Fair	Dead leader
GW-183	American sycamore	*Platanus occidentalis*	18	1	9	27	Good	Few vines
GW-184	Northern red oak	*Quercus rubra*	6	1	3	9	Poor	Vines in canopy, leaning
GW-185*	Tuliptree	*Liriodendron tulipifera*	30	1	15	45	Good	
GW-186	Bitternut hickory	*Carya cordiformis*	13	1	6.5	19.5	Good	
GW-187	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Fair	Vines in canopy
GW-188	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	
GW-189	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-190	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Fair	Vines and reduced canopy
GW-191	White oak	*Quercus alba*	25	1	12.5	37.5	Good	
GW-192	American elm	*Ulmus americana*	5	1	2.5	7.5	Good	
GW-193	Chestnut oak	*Quercus montana*	14	1	7	21	Good	
GW-194	Princesstree	*Paulownia tomentosa*	14	1	7	21	Fair	Broken trunk
GW-195	Chestnut oak	*Quercus montana*	16	1	8	24	Fair	Second trunk dead
GW-196	Northern red oak	*Quercus rubra*	15, 13	2	7.5	22.5	Good	Twin trunks 15 x 13
GW-197	Mockernut hickory	*Carya tomentosa*	7	1	3.5	10.5	Good	
GW-198	Pignut hickory	*Carya glabra*	5	1	2.5	7.5	Good	
GW-199	Red maple	*Acer rubrum*	12	1	6	18	Fair	Few dead branches
GW-200	Chestnut oak	*Quercus montana*	21, 20	2	N/A	N/A	Standing Dead	Twin trunk 21 x 20
GW-201	Tree of heaven	*Ailanthus altissima*	14	1	7	21	Fair	Reduced canopy, vines
GW-202	Blackgum	*Nyssa sylvatica*	5	1	2.5	7.5	Good	
GW-203*	White oak	*Quercus alba*	34	1	17	51	Good	One dead leader

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-204	Red maple	*Acer rubrum*	8	1	4	12	Fair	Hole in trunk and burl
GW-205	Red maple	*Acer rubrum*	6	1	3	9	Fair	Broken branches, narrow crown
GW-206	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	
GW-207	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Good	Minor vines
GW-208	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-209	Unknown		9	1	N/A	N/A	Standing Dead	
GW-210	Chestnut oak	*Quercus montana*	20	1	10	30	Fair	Several dead branches
GW-211	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-212	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Poor	Vines, dying
GW-213	Red maple	*Acer rubrum*	11, 10	2	5.5	16.5	Good	Twin trunk 11 x 10, slight lean
GW-214	Red maple	*Acer rubrum*	13	1	6.5	19.5	Fair	Broken branches
GW-215	American beech	*Fagus grandifolia*	9	1	4.5	13.5	Good	
GW-216	Red maple	*Acer rubrum*	6	1	3	9	Poor	Trunk damage and rot, dying
GW-217	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-218	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	
GW-219	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-220	Green ash	*Fraxinus pennsylvanica*	7	1	N/A	N/A	Standing Dead	
GW-221	Red maple	*Acer rubrum*	6	1	3	9	Good	Fused with GW-1688
GW-222	Red maple	*Acer rubrum*	6	1	3	9	Poor	Possibly dead
GW-223	American beech	*Fagus grandifolia*	6	1	N/A	N/A	Standing Dead	
GW-224	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Good	
GW-225	Mockernut hickory	*Carya tomentosa*	11	1	5.5	16.5	Good	
GW-226	American elm	*Ulmus americana*	6	1	3	9	Good	
GW-227	Northern red oak	*Quercus rubra*	7, 7	2	3.5	10.5	Good	Twin trunk 7 x 7, slight lean
GW-228	Chestnut oak	*Quercus montana*	7	1	3.5	10.5	Poor	Possibly dead
GW-229	Red maple	*Acer rubrum*	6	1	3	9	Fair	Stressed
GW-230	Black locust	*Robinia pseudoacacia*	10	1	5	15	Fair	Reduced crown
GW-231*	Northern red oak	*Quercus rubra*	32	1	16	48	Good	
GW-232	White mulberry	*Morus alba*	5	1	2.5	7.5	Fair	Trunk damage
GW-233	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-234	Mockernut hickory	*Carya tomentosa*	7	1	3.5	10.5	Good	
GW-235	White oak	*Quercus alba*	27	1	13.5	40.5	Fair	Few dead leaders
GW-236	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	Fused with GW-1689 at base
GW-237	Unknown		6	1	N/A	N/A	Standing Dead	
GW-238	American holly	*Ilex opaca*	5	1	2.5	7.5	Good	Two fused trunks
GW-239	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Good	
GW-240	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Good	One broken leader
GW-241	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Fair	Dead leader
GW-242	Chestnut oak	*Quercus montana*	21	1	10.5	31.5	Good	One dead branch
GW-243	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-244	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Trunk damage
GW-245	White oak	*Quercus alba*	27	1	13.5	40.5	Excellent	
GW-246	Black cherry	*Prunus serotina*	23	1	11.5	34.5	Poor	Dying
GW-247	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-248	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-249	Red maple	*Acer rubrum*	10, 6	2	5	15	Fair	Twin trunks 10 x 6, third trunk dead
GW-250	Red maple	*Acer rubrum*	16	1	8	24	Good	
GW-251	Tuliptree	*Liriodendron tulipifera*	27	1	13.5	40.5	Good	One dead branch
GW-252*	Northern red oak	*Quercus rubra*	35	1	17.5	52.5	Fair	Trunk rot, leaning
GW-253	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Good	
GW-254	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-255	American elm	*Ulmus americana*	11	1	5.5	16.5	Good	
GW-256	Red maple	*Acer rubrum*	16	1	8	24	Good	
GW-257	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Fair	Broken leader
GW-258	American sycamore	*Platanus occidentalis*	20	1	10	30	Good	
GW-259	American sycamore	*Platanus occidentalis*	22	1	11	33	Good	
GW-260	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Poor	Dying trunk
GW-261	Red maple	*Acer rubrum*	14	1	7	21	Good	
GW-262	American sycamore	*Platanus occidentalis*	10	1	5	15	Fair	Many vines in canopy
GW-263	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Good	
GW-264	Blackgum	*Nyssa sylvatica*	10	1	5	15	Good	Some vines
GW-265	Boxelder	*Acer negundo*	8	1	4	12	Fair	Vines in canopy
GW-266	Red maple	*Acer rubrum*	7, 7, 6	3	3.5	10.5	Good	Multistem trunk 7 x 7 x 6
GW-267	Northern red oak	*Quercus rubra*	42	1	N/A	N/A	Standing Dead	
GW-268	Chestnut oak	*Quercus montana*	5	1	N/A	N/A	Standing Dead	
GW-269	Tree of heaven	*Ailanthus altissima*	12	1	6	18	Fair	Vines in canopy
GW-270	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	
GW-271	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	
GW-272	Unknown		8	1	N/A	N/A	Standing Dead	
GW-273	Blackgum	*Nyssa sylvatica*	10	1	5	15	Good	
GW-274	White oak	*Quercus alba*	23	1	11.5	34.5	Fair	Few dead limbs

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-275	Unknown		23	1	N/A	N/A	Standing Dead	
GW-276	White oak	*Quercus alba*	20	1	10	30	Fair	Couple broken leaders
GW-277	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Good	One dead leader
GW-278	Chestnut oak	*Quercus montana*	21	1	10.5	31.5	Good	
GW-279	Northern red oak	*Quercus rubra*	6	1	3	9	Fair	Few dead branches
GW-280	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Good	
GW-281	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	Leaning
GW-282*	Tuliptree	*Liriodendron tulipifera*	31, 16	2	15.5	46.5	Good	Twin trunks 31 x 16
GW-283	White oak	*Quercus alba*	14	1	7	21	Fair	Dead branches
GW-284	American elm	*Ulmus americana*	5	1	2.5	7.5	Good	
GW-285	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Fair	Vines in canopy
GW-286	White oak	*Quercus alba*	12	1	N/A	N/A	Standing Dead	
GW-287	White oak	*Quercus alba*	22	1	11	33	Poor	Possibly dead
GW-288	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Good	Dead branch
GW-289	Tuliptree	*Liriodendron tulipifera*	28	1	14	42	Good	
GW-290	American sycamore	*Platanus occidentalis*	26, 22, 9	3	13	39	Fair	Vines in canopy, multistem 26 x 22 x 9
GW-291	Boxelder	*Acer negundo*	12	1	N/A	N/A	Standing Dead	
GW-292	Boxelder	*Acer negundo*	20	1	10	30	Good	
GW-293	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-294	Boxelder	*Acer negundo*	6	1	3	9	Poor	Extensive vines in canopy
GW-295	Blackgum	*Nyssa sylvatica*	6	1	3	9	Good	
GW-296	Red maple	*Acer rubrum*	9, 8	2	4.5	13.5	Fair	Twin trunks 9 x 8
GW-297	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Fair	Dead trunk, broken branch
GW-298	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Fair	Many vines, reduced canopy
GW-299	Blackgum	*Nyssa sylvatica*	6	1	3	9	Good	
GW-300*	Silver maple	*Acer saccharinum*	31, 25, 17	3	15.5	46.5	Fair	Broken trunk, multistem 31 x 25 x 17
GW-301	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-302	Tuliptree	*Liriodendron tulipifera*	5	1	2.5	7.5	Good	
GW-303	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-304	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Good	
GW-305	Bitternut hickory	*Carya cordiformis*	20	1	10	30	Good	
GW-306	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	
GW-307	Boxelder	*Acer negundo*	10	1	5	15	Fair	Trunk rot
GW-308	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-309	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Fair	Many vines, reduced canopy
GW-310	Red maple	*Acer rubrum*	11	1	5.5	16.5	Fair	Stressed, trunk rot
GW-311*	Northern red oak	*Quercus rubra*	30	1	15	45	Excellent	
GW-312	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Good	
GW-313	American elm	*Ulmus americana*	7	1	3.5	10.5	Good	
GW-314*	Northern red oak	*Quercus rubra*	35	1	17.5	52.5	Good	
GW-315	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-316	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Fair	Reduced canopy and vines in canopy
GW-317	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	
GW-318*	White oak	*Quercus alba*	36	1	18	54	Good	
GW-319	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Fair	Broken leader
GW-320	Tuliptree	*Liriodendron tulipifera*	5	1	2.5	7.5	Good	
GW-321	Red maple	*Acer rubrum*	17	1	8.5	25.5	Good	
GW-322	Unknown		23	1	N/A	N/A	Standing Dead	
GW-323	Chestnut oak	*Quercus montana*	13	1	6.5	19.5	Fair	Some bark damage, dead branch
GW-324	Northern red oak	*Quercus rubra*	22	1	11	33	Good	
GW-325	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-326	Chestnut oak	*Quercus montana*	26	1	13	39	Good	
GW-327	Red maple	*Acer rubrum*	7	1	3.5	10.5	Poor	Dying
GW-328	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Fair	Sparse canopy w/ vines
GW-329	Slippery elm	*Ulmus rubra*	8	1	4	12	Poor	Extensive vines in canopy
GW-330	Chestnut oak	*Quercus montana*	21	1	10.5	31.5	Fair	Few dead branches
GW-331	Chestnut oak	*Quercus montana*	21	1	10.5	31.5	Good	
GW-332*	Silver maple	*Acer saccharinum*	44	1	22	66	Good	
GW-333	Chestnut oak	*Quercus montana*	24	1	12	36	Good	
GW-334	Pine species	*Pinus sp.*	11	1	N/A	N/A	Standing Dead	
GW-335	Chestnut oak	*Quercus montana*	28	1	14	42	Good	
GW-336	Silver maple	*Acer saccharinum*	25	1	12.5	37.5	Fair	Leaning, few dead branches
GW-337*	Tuliptree	*Liriodendron tulipifera*	31	1	15.5	46.5	Good	
GW-338	Scarlet oak	*Quercus coccinea*	29	1	14.5	43.5	Fair	Poor branching structure, exposed roots, dead branches in crown
GW-339	White oak	*Quercus alba*	19	1	9.5	28.5	Good	
GW-340	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Stressed
GW-341	Red maple	*Acer rubrum*	11	1	5.5	16.5	Fair	Dead branches
GW-342	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Good	
GW-343	Chestnut oak	*Quercus montana*	19	1	9.5	28.5	Fair	Leaning, dead branches
GW-344	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-345	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Fair	Leaning, reduced canopy
GW-346	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Good	Slightly unbalanced crown
GW-347	Chestnut oak	*Quercus montana*	20	1	10	30	Good	
GW-348	Red maple	*Acer rubrum*	6	1	3	9	Poor	Possibly dead
GW-349	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Fair	Many vines, reduced canopy
GW-350	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-351	Sugar maple	*Acer saccharum*	14, 13	2	7	21	Good	Twin trunks 14 x 13
GW-352	Chestnut oak	*Quercus montana*	16	1	8	24	Fair	Stressed
GW-353	American beech	*Fagus grandifolia*	11	1	5.5	16.5	Good	
GW-354	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	
GW-355	American beech	*Fagus grandifolia*	11	1	5.5	16.5	Good	
GW-356	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Fair	Vines in canopy
GW-357	Red maple	*Acer rubrum*	18	1	9	27	Fair	Dead branches, fused trunks
GW-358	Tuliptree	*Liriodendron tulipifera*	28	1	14	42	Good	
GW-359	Chestnut oak	*Quercus montana*	29	1	14.5	43.5	Good	
GW-360	Red maple	*Acer rubrum*	10	1	5	15	Fair	Vines in canopy, reduced crown
GW-361	Sugar maple	*Acer saccharum*	16	1	8	24	Good	
GW-362	Chestnut oak	*Quercus montana*	16	1	8	24	Good	
GW-363	American beech	*Fagus grandifolia*	10	1	5	15	Good	
GW-364	American beech	*Fagus grandifolia*	7, 5	2	3.5	10.5	Good	Twin trunks 7 x 5
GW-365	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Trunk rot
GW-366	Red maple	*Acer rubrum*	29	1	14.5	43.5	Good	Multiple fused trunks and some vines
GW-367	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-368	Northern red oak	*Quercus rubra*	22	1	11	33	Good	
GW-369	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Poor	Extensive vines in canopy
GW-370	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
GW-371	Silver maple	*Acer saccharinum*	7	1	3.5	10.5	Fair	Leaning, dead branches
GW-372	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Excellent	
GW-373	Red maple	*Acer rubrum*	8	1	N/A	N/A	Standing Dead	
GW-374	American beech	*Fagus grandifolia*	13	1	6.5	19.5	Good	Cavity in trunk
GW-375	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	
GW-376	Tuliptree	*Liriodendron tulipifera*	12	1	N/A	N/A	Standing Dead	
GW-377	Red maple	*Acer rubrum*	6	1	3	9	Fair	Reduced canopy
GW-378	Unknown		20	1	N/A	N/A	Standing Dead	
GW-379	Northern red oak	*Quercus rubra*	5	1	2.5	7.5	Poor	Extensive vines in canopy
GW-380	American basswood	*Tilia americana*	10	1	5	15	Good	
GW-381	Silver maple	*Acer saccharinum*	25	1	12.5	37.5	Good	
GW-382	American beech	*Fagus grandifolia*	11	1	5.5	16.5	Good	
GW-383	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Good	
GW-384	American basswood	*Tilia americana*	9	1	4.5	13.5	Good	
GW-385	Red maple	*Acer rubrum*	6	1	3	9	Poor	Broken trunk
GW-386	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	Leaning
GW-387	Red maple	*Acer rubrum*	10	1	5	15	Good	Leaning
GW-388	Blackgum	*Nyssa sylvatica*	9	1	4.5	13.5	Good	
GW-389	Chestnut oak	*Quercus montana*	23	1	11.5	34.5	Good	
GW-390	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	
GW-391	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-392	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Good	
GW-393	Northern red oak	*Quercus rubra*	23	1	N/A	N/A	Standing Dead	
GW-394	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-395	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-396	Red maple	*Acer rubrum*	10	1	5	15	Fair	Dead leader
GW-397	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-398	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Good	
GW-399	Chestnut oak	*Quercus montana*	24	1	12	36	Fair	Dead branches
GW-400	Unknown		20	1	N/A	N/A	Standing Dead	
GW-401	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Good	
GW-402	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	
GW-403	Northern red oak	*Quercus rubra*	9	1	4.5	13.5	Fair	Pruned and dead branches
GW-404*	Tuliptree	*Liriodendron tulipifera*	33	1	16.5	49.5	Good	
GW-405	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Good	
GW-406	Red maple	*Acer rubrum*	14	1	7	21	Fair	Dead branches, stressed
GW-407	Chestnut oak	*Quercus montana*	20	1	N/A	N/A	Standing Dead	
GW-408	Northern red oak	*Quercus rubra*	12	1	6	18	Fair	Leaning, vines in canopy
GW-409	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	
GW-410	Sugar maple	*Acer saccharum*	14	1	7	21	Good	
GW-411	Red maple	*Acer rubrum*	20	1	10	30	Good	
GW-412	Northern red oak	*Quercus rubra*	28	1	14	42	Good	
GW-413	Tuliptree	*Liriodendron tulipifera*	27	1	13.5	40.5	Good	Few dead branches
GW-414	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Good	
GW-415	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Good	

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-416	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-417*	Chestnut oak	*Quercus montana*	31	1	15.5	46.5	Good	
GW-418*	Tuliptree	*Liriodendron tulipifera*	31	1	15.5	46.5	Good	
GW-419	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	
GW-420	Chestnut oak	*Quercus montana*	25	1	12.5	37.5	Good	
GW-421	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-422	Chestnut oak	*Quercus montana*	20	1	10	30	Fair	Reduced canopy, stressed
GW-423	Red maple	*Acer rubrum*	9, 5	2	4.5	13.5	Good	Twin trunks 9 x 5
GW-424	American elm	*Ulmus americana*	28	1	14	42	Good	
GW-425	Mockernut hickory	*Carya tomentosa*	11	1	5.5	16.5	Good	
GW-426	Unknown		10	1	N/A	N/A	Standing Dead	
GW-427	Blackgum	*Nyssa sylvatica*	5	1	2.5	7.5	Good	
GW-428	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-429	Northern red oak	*Quercus rubra*	7	1	3.5	10.5	Poor	Leaning, extensive vines
GW-430	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Fair	Two dead leaders
GW-431	Chestnut oak	*Quercus montana*	13	1	6.5	19.5	Good	
GW-432	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-433	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-434	Red maple	*Acer rubrum*	11	1	N/A	N/A	Standing Dead	
GW-435	Mockernut hickory	*Carya tomentosa*	9	1	4.5	13.5	Good	
GW-436	Chestnut oak	*Quercus montana*	15	1	7.5	22.5	Fair	Few dead branches
GW-437*	Chestnut oak	*Quercus montana*	35	1	17.5	52.5	Good	
GW-438	Red maple	*Acer rubrum*	6	1	3	9	Fair	Stressed
GW-439	Chestnut oak	*Quercus montana*	23	1	11.5	34.5	Fair	Dead leader
GW-440	Chestnut oak	*Quercus montana*	11	1	5.5	16.5	Good	
GW-441	Chestnut oak	*Quercus montana*	13	1	6.5	19.5	Good	
GW-442	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-443	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Fair	Trunk rot at base
GW-444	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-445	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Good	
GW-446	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Good	
GW-447	Red maple	*Acer rubrum*	11	1	5.5	16.5	Good	
GW-448	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-449	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-450	Chestnut oak	*Quercus montana*	27	1	13.5	40.5	Good	
GW-451	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Good	
GW-452	Red maple	*Acer rubrum*	10	1	5	15	Poor	Dying
GW-453	Sugar maple	*Acer saccharum*	8	1	4	12	Good	
GW-454	American elm	*Ulmus americana*	7	1	3.5	10.5	Good	
GW-455	Chestnut oak	*Quercus montana*	15	1	N/A	N/A	Standing Dead	
GW-456	Chestnut oak	*Quercus montana*	16	1	8	24	Fair	Dead leader
GW-457	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	
GW-458	Blackgum	*Nyssa sylvatica*	8	1	4	12	Good	
GW-459	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-460	Sugar maple	*Acer saccharum*	10	1	5	15	Good	
GW-461	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Fair	Many vines and some dead branches
GW-462	Northern red oak	*Quercus rubra*	29	1	N/A	N/A	Standing Dead	
GW-463	Chestnut oak	*Quercus montana*	11	1	5.5	16.5	Good	
GW-464	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-465	American beech	*Fagus grandifolia*	11	1	5.5	16.5	Good	
GW-466	Blackgum	*Nyssa sylvatica*	8	1	4	12	Good	
GW-467	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Trunk rot, stressed
GW-468	American basswood	*Tilia americana*	24, 7	2	12	36	Good	Twin trunks 24 x 7
GW-469	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-470	Northern red oak	*Quercus rubra*	5	1	2,5	7.5	Poor	One living leader
GW-471	Unknown		6	1	N/A	N/A	Standing Dead	
GW-472	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	Few dead branches
GW-473*	Chestnut oak	*Quercus montana*	30	1	15	45	Fair	Few dead branches
GW-474	Chestnut oak	*Quercus montana*	7	1	3.5	10.5	Fair	Dead branches
GW-475	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Dead branches, bent
GW-476	American beech	*Fagus grandifolia*	10	1	5	15	Good	
GW-477	Red maple	*Acer rubrum*	10	1	5	15	Good	
GW-478	Chestnut oak	*Quercus montana*	10	1	5	15	Good	Leaning
GW-479	Blackgum	*Nyssa sylvatica*	8	1	4	12	Fair	Reduced crown
GW-480	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Fair	Leaning, bend in leader
GW-481	Chestnut oak	*Quercus montana*	18	1	N/A	N/A	Standing Dead	
GW-482	Sugar maple	*Acer saccharum*	5	1	2.5	7.5	Good	
GW-483	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Fair	Broken and pruned branches
GW-484	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Good	
GW-485*	Tuliptree	*Liriodendron tulipifera*	31	1	15.5	46.5	Good	
GW-486	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Poor	Trunk and bark decaying

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-487	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-488*	Silver maple	*Acer saccharinum*	59	1	29.5	88.5	Fair	With vines
GW-489	Boxelder	*Acer negundo*	6	1	3	9	Good	
GW-490	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Fair	Topped leader, irregular bark
GW-491	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Fair	Vines, broken branches
GW-492	Chestnut oak	*Quercus montana*	25	1	12.5	37.5	Good	
GW-493	Chestnut oak	*Quercus montana*	24	1	12	36	Good	
GW-494	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-495*	Tuliptree	*Liriodendron tulipifera*	32	1	16	48	Fair	Twin trunks above DBH, thin crown, cavity at base of trunk
GW-496	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Good	
GW-497	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Reduced canopy
GW-498	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-499	Northern red oak	*Quercus rubra*	6	1	N/A	N/A	Standing Dead	
GW-500	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Fair	Bend in leader, irregular bark
GW-501	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-502	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Stressed
GW-503	Northern red oak	*Quercus rubra*	9	1	4.5	13.5	Good	
GW-504	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-505	Northern red oak	*Quercus rubra*	9	1	4.5	13.5	Fair	Many vines
GW-506	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	
GW-507	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-508	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Good	
GW-509	Northern red oak	*Quercus rubra*	9	1	N/A	N/A	Standing Dead	Standing dead
GW-510*	Chestnut oak	*Quercus montana*	40	1	20	60	Good	
GW-511	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	
GW-512	Sugar maple	*Acer saccharum*	15	1	7.5	22.5	Good	
GW-513	Blackgum	*Nyssa sylvatica*	5	1	2.5	7.5	Fair	Trunk bent
GW-514	Chestnut oak	*Quercus montana*	19	1	9.5	28.5	Good	Good
GW-515	Red maple	*Acer rubrum*	8, 6	2	4	12	Good	Twin trunks 8 x 6
GW-516	White oak	*Quercus alba*	14	1	7	21	Fair	Stressed, dead leader
GW-517	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Good	
GW-518	Sugar maple	*Acer saccharum*	5	1	2.5	7.5	Good	
GW-519	Blackgum	*Nyssa sylvatica*	5	1	2.5	7.5	Good	
GW-520	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-521	Mockernut hickory	*Carya tomentosa*	17	1	8.5	25.5	Fair	Stressed
GW-522	Northern red oak	*Quercus rubra*	5	1	2.5	7.5	Fair	Canopy reduced
GW-523	Tuliptree	*Liriodendron tulipifera*	17, 12	2	8.5	25.5	Fair	Twin trunks 17 x 12, vines into crown, decaying bark and trunk
GW-524	Chestnut oak	*Quercus montana*	15	1	7.5	22.5	Fair	Some bark damage, leaning
GW-525*	Tuliptree	*Liriodendron tulipifera*	35	1	17.5	52.5	Good	
GW-526	Slippery elm	*Ulmus rubra*	16	1	8	24	Fair	Buttressed roots, slight lean, Burls on trunk
GW-527	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-528	Unknown		6	1	N/A	N/A	Standing Dead	
GW-529	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
GW-530	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	
GW-531	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-532	Chestnut oak	*Quercus montana*	29	1	14.5	43.5	Good	
GW-533	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-534	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-535	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Fair	Healed basal cavity, one sided
GW-536*	Chestnut oak	*Quercus montana*	36	1	18	54	Good	
GW-537	Red maple	*Acer rubrum*	8	1	4	12	Fair	Few dead branches, stressed
GW-538	Red maple	*Acer rubrum*	5	1	2,5	7.5	Good	
GW-539	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-540	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-541*	Chestnut oak	*Quercus montana*	40	1	20	60	Good	Split leaders
GW-542	American beech	*Fagus grandifolia*	13	1	6,5	19.5	Good	
GW-543	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-544	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Good	Dead vine on trunk
GW-545	Chestnut oak	*Quercus montana*	6	1	3	9	Good	
GW-546	Tuliptree	*Liriodendron tulipifera*	28	1	14	42	Good	
GW-547	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	
GW-548	Chestnut oak	*Quercus montana*	17	1	8.5	25.5	Fair	Reduced canopy
GW-549	Chestnut oak	*Quercus montana*	10	1	5	15	Fair	With vine
GW-550	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-551	Bitternut hickory	*Carya cordiformis*	6	1	3	9	Good	
GW-552	Unknown		13	1	N/A	N/A	Standing Dead	
GW-553	White oak	*Quercus alba*	6	1	3	9	Fair	Heavy branch dieback in crown
GW-554*	Tuliptree	*Liriodendron tulipifera*	31, 8	2	15.5	46.5	Good	Twin trunks 31 x 8

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-555	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-556	Blackgum	*Nyssa sylvatica*	5	1	2.5	7.5	Good	
GW-557	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	
GW-558	White oak	*Quercus alba*	24	1	12	36	Good	Few small dead branches
GW-559	Red maple	*Acer rubrum*	6	1	3	9	Good	Slight lean
GW-560	Red maple	*Acer rubrum*	10, 6	2	5	15	Good	Twin trunk 10 x 6
GW-561	Red maple	*Acer rubrum*	10	1	5	15	Fair	Trunk rot
GW-562*	Chestnut oak	*Quercus montana*	33	1	16.5	49.5	Good	
GW-563	American basswood	*Tilia americana*	14	1	7	21	Good	
GW-564	Red maple	*Acer rubrum*	10, 7	2	5	15	Good	Twin trunk 10 x 7
GW-565	Bitternut hickory	*Carya cordiformis*	6	1	3	9	Poor	Heavy vines in crown
GW-566	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-567	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-568	Chestnut oak	*Quercus montana*	23	1	11.5	34.5	Fair	Sparse canopy
GW-569	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-570	Tuliptree	*Liriodendron tulipifera*	28	1	14	42	Fair	Vines in crown
GW-571	Chestnut oak	*Quercus montana*	23	1	11.5	34.5	Good	
GW-572	Chestnut oak	*Quercus montana*	17	1	8.5	25.5	Good	
GW-573	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-574	Red maple	*Acer rubrum*	8	1	4	12	Fair	Reduced crown, stressed
GW-575	American beech	*Fagus grandifolia*	13	1	6.5	19.5	Good	
GW-576	Blackgum	*Nyssa sylvatica*	5	1	2.5	7.5	Good	
GW-577	Red maple	*Acer rubrum*	7	1	3.5	10.5	Poor	Trunk rot, dead limbs
GW-578*	Chestnut oak	*Quercus montana*	31	1	15.5	46.5	Good	
GW-579	Chestnut oak	*Quercus montana*	15	1	7.5	22.5	Good	
GW-580	Chestnut oak	*Quercus montana*	15	1	7.5	22.5	Fair	Dead branches, stressed
GW-581	Chestnut oak	*Quercus montana*	17	1	N/A	N/A	Standing Dead	
GW-582	Red maple	*Acer rubrum*	7	1	3.5	10.5	Poor	Broken at breast height
GW-583	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Good	
GW-584	Chestnut oak	*Quercus montana*	15	1	7.5	22.5	Good	
GW-585	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Few dead branches
GW-586	Chestnut oak	*Quercus montana*	20	1	10	30	Good	
GW-587*	Tuliptree	*Liriodendron tulipifera*	47	1	23.5	70.5	Good	Twin trunks above DBH
GW-588	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Fair	Some bark damage
GW-589	Swamp chestnut oak	*Quercus michauxii*	24	1	12	36	Poor	Heavy vines in crown and on trunk, large dead branches. Splits above DBH
GW-590	Chestnut oak	*Quercus montana*	23	1	11.5	34.5	Good	Few vines
GW-591	Red maple	*Acer rubrum*	8	1	4	12	Fair	Trunk damage at top
GW-592	Chestnut oak	*Quercus montana*	21	1	10.5	31.5	Good	
GW-593	Tuliptree	*Liriodendron tulipifera*	27	1	13.5	40.5	Fair	Bend in leader, poison ivy vines into crown
GW-594	Red maple	*Acer rubrum*	10	1	5	15	Good	
GW-595	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Good	Thin crown
GW-596	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Good	
GW-597	Chestnut oak	*Quercus montana*	15	1	7.5	22.5	Good	
GW-598	Tuliptree	*Liriodendron tulipifera*	27	1	13.5	40.5	Good	
GW-599	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Good	
GW-600*	Silver maple	*Acer saccharinum*	30	1	15	45	Fair	Some vines, leaning
GW-601	Unknown		5	1	N/A	N/A	Standing Dead	
GW-602	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Dead branches in canopy
GW-603	Silver maple	*Acer saccharinum*	29	1	14.5	43.5	Good	
GW-604	Chestnut oak	*Quercus montana*	15	1	7.5	22.5	Fair	Leaning, stressed
GW-605*	White oak	*Quercus alba*	30	1	15	45	Good	Few broken/dead branches
GW-606	Tuliptree	*Liriodendron tulipifera*	27	1	13.5	40.5	Fair	Gall at base of trunk, thin crown
GW-607	Chestnut oak	*Quercus montana*	10	1	5	15	Good	
GW-608	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Good	
GW-609	Sassafras	*Sassafras albidum*	6	1	3	9	Fair	Broken leader
GW-610	Pignut hickory	*Carya glabra*	23	1	11.5	34.5	Good	
GW-611	Green ash	*Fraxinus pennsylvanica*	24, 10	2	N/A	N/A	Standing Dead	Twin trunks 24 x 10
GW-612	Mockernut hickory	*Carya tomentosa*	13	1	6.5	19.5	Good	
GW-613	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Stressed, sparse canopy
GW-614	Red maple	*Acer rubrum*	9	1	4.5	13.5	Poor	Trunk broken
GW-615	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-616	Unknown		13	1	N/A	N/A	Standing Dead	
GW-617	Sugar maple	*Acer saccharum*	6, 6	2	3	9	Good	Twin trunks 6 x 6
GW-618	Tuliptree	*Liriodendron tulipifera*	25, 15	2	12.5	37.5	Fair	Twin trunks 25 x 15, small cavity at base healing, thin crown
GW-619	Unknown		8	1	N/A	N/A	Standing Dead	
GW-620	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-621	American beech	*Fagus grandifolia*	8	1	4	12	Fair	Many water sprouts, dead twin
GW-622	American elm	*Ulmus americana*	8	1	4	12	Fair	With vines

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-623	Cherry sp.	*Prunus sp.*	14	1	N/A	N/A	Standing Dead	
GW-624	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Dead branches, trunk rot
GW-625	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-626	Northern red oak	*Quercus rubra*	19	1	N/A	N/A	Standing Dead	
GW-627	Boxelder	*Acer negundo*	9	1	4.5	13.5	Good	
GW-628	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Fair	Lean, dead small leader
GW-629	Red maple	*Acer rubrum*	9, 6, 6	3	4.5	13.5	Fair	Some broken branches, multistem 9 x 6 x 6
GW-630	Bitternut hickory	*Carya cordiformis*	24	1	12	36	Good	
GW-631	Chestnut oak	*Quercus montana*	24	1	12	36	Good	
GW-632	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-633	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
GW-634	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	
GW-635*	Chestnut oak	*Quercus montana*	31	1	15.5	46.5	Good	
GW-636	Red maple	*Acer rubrum*	13	1	6.5	19.5	Good	
GW-637	Northern red oak	*Quercus rubra*	5	1	2.5	7.5	Poor	Heavy vines in crown, lean, broken
GW-638	Red maple	*Acer rubrum*	10	1	5	15	Fair	Reduced crown
GW-639	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	
GW-640	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-641*	Chestnut oak	*Quercus montana*	30	1	15	45	Good	
GW-642	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Sparse canopy
GW-643	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-644	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-645	Red maple	*Acer rubrum*	7	1	3.5	10.5	Poor	Dying
GW-646	Red maple	*Acer rubrum*	7	1	3.5	10.5	Poor	Broken trunk, trunk rot
GW-647*	Tuliptree	*Liriodendron tulipifera*	30, 30	2	15	45	Good	Twin trunks 30 x 30
GW-648	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Fair	Poor branching structure in crown, leaning
GW-649	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Fair	Vines on trunk, thin crown
GW-650	Blackgum	*Nyssa sylvatica*	13	1	6.5	19.5	Good	
GW-651	Chestnut oak	*Quercus montana*	7	1	3.5	10.5	Good	
GW-652	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-653	American elm	*Ulmus americana*	10	1	5	15	Fair	Vines, dead branches
GW-654	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Good	Minor amounts of bark removed on trunk
GW-655	Red maple	*Acer rubrum*	12	1	6	18	Good	
GW-656*	Chestnut oak	*Quercus montana*	34	1	17	51	Good	
GW-657	Chestnut oak	*Quercus montana*	12	1	6	18	Good	
GW-658	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Fungus, vines
GW-659	Red maple	*Acer rubrum*	9, 3	2	4.5	13.5	Poor	Dead branches, stressed, trunk rot, dying. Twin trunks 9 x 3
GW-660	Chestnut oak	*Quercus montana*	17	1	8.5	25.5	Good	
GW-661	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-662	Unknown		11	1	N/A	N/A	Standing Dead	
GW-663	Chestnut oak	*Quercus montana*	18	1	9	27	Good	
GW-664	Red maple	*Acer rubrum*	13	1	6.5	19.5	Fair	Dead branches, trunk damage
GW-665	Chestnut oak	*Quercus montana*	11	1	5.5	16.5	Good	
GW-666	Chestnut oak	*Quercus montana*	19	1	9.5	28.5	Good	
GW-667	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-668	Chestnut oak	*Quercus montana*	24	1	12	36	Good	
GW-669	Slippery elm	*Ulmus rubra*	13	1	6.5	19.5	Fair	Significant lean
GW-670	Boxelder	*Acer negundo*	10	1	5	15	Good	
GW-671	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Bark damage
GW-672	Black walnut	*Juglans nigra*	6	1	3	9	Poor	Heavy vines in crown, lean
GW-673	Chestnut oak	*Quercus montana*	6	1	3	9	Good	Leaning
GW-674	Green ash	*Fraxinus pennsylvanica*	7	1	3.5	10.5	Poor	Heavy vines in crown
GW-675	Northern red oak	*Quercus rubra*	18	1	9	27	Good	
GW-676*	Chestnut oak	*Quercus montana*	32	1	16	48	Good	
GW-677	White oak	*Quercus alba*	13	1	N/A	N/A	Standing Dead	
GW-678	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-679	Tuliptree	*Liriodendron tulipifera*	24	1	N/A	N/A	Standing Dead	
GW-680	Red maple	*Acer rubrum*	6	1	3	9	Fair	Trunk rot
GW-681	Black walnut	*Juglans nigra*	13	1	6.5	19.5	Poor	Heavy vines in crown, lean
GW-682*	Silver maple	*Acer saccharinum*	47	1	23.5	70.5	Good	
GW-683	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Good	Slight lean
GW-684	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Trunk damage
GW-685	Unknown		7	1	N/A	N/A	Standing Dead	
GW-686	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-687	Red maple	*Acer rubrum*	8	1	4	12	Poor	Dead leader, hollowed trunk
GW-688	Red maple	*Acer rubrum*	10	1	5	15	Good	Minor trunk rot
GW-689	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Fair	One sided, vines on trunk
GW-690	Red maple	*Acer rubrum*	7	1	3.5	10.5	Poor	Broken trunk, dying

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-691	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Good	
GW-692	Red maple	*Acer rubrum*	6	1	3	9	Fair	Broken branches, thin crown
GW-693	Chestnut oak	*Quercus montana*	24	1	12	36	Good	
GW-694	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-695	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
GW-696	Chestnut oak	*Quercus montana*	28	1	14	42	Good	
GW-697	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Fair	One sided, vines on trunk
GW-698	Chestnut oak	*Quercus montana*	24	1	12	36	Fair	With vines
GW-699	Red maple	*Acer rubrum*	11	1	5.5	16.5	Good	
GW-700	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-701	Northern red oak	*Quercus rubra*	7	1	3.5	10.5	Poor	Vines girdling trunk
GW-702	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
GW-703	American holly	*Ilex opaca*	5	1	2.5	7.5	Good	
GW-704	Chestnut oak	*Quercus montana*	18	1	9	27	Good	
GW-705	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-706	Red maple	*Acer rubrum*	12	1	6	18	Fair	Reduced crown
GW-707	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	Fused with GW-1879
GW-708	Chestnut oak	*Quercus montana*	10	1	N/A	N/A	Standing Dead	
GW-709	Blackgum	*Nyssa sylvatica*	8	1	4	12	Fair	Few dead branches
GW-710	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-711	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Stressed
GW-712	American basswood	*Tilia americana*	24, 14, 12	4	12	36	Fair	Dead leader ~28, multistem 28 x 24 x 14 x 12
GW-713*	Chestnut oak	*Quercus montana*	31	1	15.5	46.5	Good	
GW-714	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Good	
GW-715	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-716	American beech	*Fagus grandifolia*	16	1	8	24	Good	
GW-717	Blackgum	*Nyssa sylvatica*	8	1	N/A	N/A	Standing Dead	
GW-718	Chestnut oak	*Quercus montana*	13	1	6.5	19.5	Good	Fused with GW-1905
GW-719	Chestnut oak	*Quercus montana*	13	1	6.5	19.5	Good	Fused with GW-1915
GW-720	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Good	
GW-721	Red maple	*Acer rubrum*	8	1	N/A	N/A	Standing Dead	
GW-722	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-723	Red maple	*Acer rubrum*	14	1	7	21	Good	Fused with GW-1894
GW-724	Red maple	*Acer rubrum*	21	1	10.5	31.5	Good	
GW-725	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Good	
GW-726	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-727	Boxelder	*Acer negundo*	6	1	3	9	Fair	Vines into crown, leaning
GW-728	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Good	
GW-729	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Leaning
GW-730	American beech	*Fagus grandifolia*	25	1	12.5	37.5	Fair	Multistem above DBH, smaller two stems have lots of water sprouts
GW-731	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Good	
GW-732	Sugar maple	*Acer saccharum*	13	1	N/A	N/A	Standing Dead	
GW-733	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
GW-734	Northern red oak	*Quercus rubra*	7	1	3.5	10.5	Good	
GW-735	White oak	*Quercus alba*	21	1	10.5	31.5	Good	
GW-736	Red maple	*Acer rubrum*	10	1	5	15	Good	
GW-737	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Poor	Large broken branches, vines in crown
GW-738	Chestnut oak	*Quercus montana*	11	1	5.5	16.5	Good	
GW-739	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Poor	Heavy vines on trunk and in canopy, significant lean
GW-740	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Fair	Some vines on trunk
GW-741	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Fair	One sided, broken branches, thin crown
GW-742	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-743	American basswood	*Tilia americana*	13	1	6.5	19.5	Poor	Broken leaders, trunk rot
GW-744	American beech	*Fagus grandifolia*	11	1	5.5	16.5	Good	Large branch removed healing
GW-745	Chestnut oak	*Quercus montana*	21	1	10.5	31.5	Fair	Reduced canopy, vines
GW-746	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Broken crown
GW-747	Red maple	*Acer rubrum*	10	1	5	15	Good	
GW-748	Sugar maple	*Acer saccharum*	9	1	4.5	13.5	Poor	With vines and canopy die back
GW-749	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Fair	Leaning, bend in leader
GW-750	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Poor	Heavy vines on trunk and in canopy
GW-751	Oak sp.	*Quercus sp.*	33	1	N/A	N/A	Standing Dead	
GW-752	Blackgum	*Nyssa sylvatica*	15	1	7.5	22.5	Good	
GW-753	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Stressed
GW-754	Norway maple	*Acer platanoides*	7	1	3.5	10.5	Fair	Minor trunk rot
GW-755	Blackgum	*Nyssa sylvatica*	9	1	4.5	13.5	Good	
GW-756	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Poor	Heavy vines in canopy, lean
GW-757	Red maple	*Acer rubrum*	10	1	5	15	Poor	Trunk broken and fallen
GW-758	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Good	

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-759	Chestnut oak	*Quercus montana*	24	1	12	36	Good	
GW-760	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Good	
GW-761	Chestnut oak	*Quercus montana*	16	1	8	24	Good	
GW-762	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Good	Minor bend in leader, thin crown
GW-763	American beech	*Fagus grandifolia*	13	1	6.5	19.5	Good	Small cavities on trunk healing
GW-764	Chestnut oak	*Quercus montana*	20	1	10	30	Fair	Leaning and broken limb
GW-765	White oak	*Quercus alba*	20	1	10	30	Good	
GW-766	Red maple	*Acer rubrum*	6	1	3	9	Poor	Trunk broken, trunk damage
GW-767	Chestnut oak	*Quercus montana*	23	1	11.5	34.5	Good	
GW-768	Chestnut oak	*Quercus montana*	20	1	10	30	Fair	Leaning
GW-769	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Poor	Trunk wound, lean, broken branches
GW-770	Red maple	*Acer rubrum*	11	1	5.5	16.5	Good	
GW-771	Northern red oak	*Quercus rubra*	9	1	4.5	13.5	Good	
GW-772	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	
GW-773	Chestnut oak	*Quercus montana*	9	1	4.5	13.5	Good	
GW-774	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Good	
GW-775	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-776*	Chestnut oak	*Quercus montana*	32	1	16	48	Good	
GW-777	Sugar maple	*Acer saccharum*	6	1	3	9	Good	
GW-778	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-779	American beech	*Fagus grandifolia*	16	1	8	24	Good	Minor bend in leader
GW-780	White oak	*Quercus alba*	17	1	8.5	25.5	Good	
GW-781	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
GW-782	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-783	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	
GW-784	American beech	*Fagus grandifolia*	14	1	7	21	Good	
GW-785	Chestnut oak	*Quercus montana*	22	1	11	33	Good	
GW-786*	Southern red oak	*Quercus falcata*	36	1	18	54	Fair	Few dead limbs
GW-787	Red maple	*Acer rubrum*	6	1	3	9	Fair	Minor trunk rot
GW-788	Chestnut oak	*Quercus montana*	26	1	13	39	Good	
GW-789	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Few dead branches
GW-790	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Fair	Healed trunk wound
GW-791	Chestnut oak	*Quercus montana*	10	1	5	15	Good	
GW-792	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Vines in canopy, fused with GW-1888
GW-793	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Dead branches, fused with GW-1884
GW-794*	Chestnut oak	*Quercus montana*	32	1	16	48	Good	
GW-795	Unknown		32	1	N/A	N/A	Standing Dead	
GW-796	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Good	
GW-797	American beech	*Fagus grandifolia*	8	1	4	12	Good	Minor cracks on trunk
GW-798	Red maple	*Acer rubrum*	24	1	12	36	Poor	Severe lean, large dead branch in lower canopy, heavy branch dieback in crown
GW-799	Chestnut oak	*Quercus montana*	16	1	8	24	Good	
GW-800	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-801	Red maple	*Acer rubrum*	10	1	5	15	Good	
GW-802	White oak	*Quercus alba*	17	1	8.5	25.5	Fair	Vines in canopy, dead branches
GW-803	Red maple	*Acer rubrum*	6	1	3	9	Good	Broken branch
GW-804	Chestnut oak	*Quercus montana*	9	1	4.5	13.5	Good	
GW-805	Red maple	*Acer rubrum*	6	1	3	9	Fair	Dead branches
GW-806	Chestnut oak	*Quercus montana*	21	1	10.5	31.5	Good	
GW-807	American beech	*Fagus grandifolia*	6	1	3	9	Good	Minor deer rub at base
GW-808	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Poor	Trunk decay, heavy vines in canopy
GW-809*	American beech	*Fagus grandifolia*	53	1	26.5	79.5	Good	
GW-810	Red maple	*Acer rubrum*	7, 6	2	3.5	10.5	Good	Twin trunks 7 x 6
GW-811	Chestnut oak	*Quercus montana*	6	1	3	9	Good	
GW-812	Red maple	*Acer rubrum*	6	1	3	9	Fair	Trunk rot
GW-813	American beech	*Fagus grandifolia*	12	1	6	18	Good	Buttressed roots
GW-814	Green ash	*Fraxinus pennsylvanica*	6	1	3	9	Poor	Significant lean, dying crown
GW-815	Chestnut oak	*Quercus montana*	25	1	12.5	37.5	Good	
GW-816	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	
GW-817	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Dead leader
GW-818	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Many vines
GW-819	Chestnut oak	*Quercus montana*	27	1	13.5	40.5	Fair	Dead leader
GW-820	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Excellent	
GW-821	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Good	
GW-822	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	
GW-823	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	
GW-824	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
GW-825*	Chestnut oak	*Quercus montana*	32	1	16	48	Good	
GW-826	Chestnut oak	*Quercus montana*	22	1	11	33	Good	
GW-827	Red maple	*Acer rubrum*	12	1	6	18	Good	
GW-828	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Stressed

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-829	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Good	
GW-830	Red maple	*Acer rubrum*	8	1	4	12	Fair	Trunk damage and broken limbs
GW-831*	Tuliptree	*Liriodendron tulipifera*	33	1	16.5	49.5	Excellent	
GW-832	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-833*	Scarlet oak	*Quercus coccinea*	34	1	17	51	Good	Few dead/broken branches
GW-834	Red maple	*Acer rubrum*	10	1	5	15	Good	
GW-835	Pignut hickory	*Carya glabra*	19	1	9.5	28.5	Good	
GW-836	Red maple	*Acer rubrum*	15	1	7.5	22.5	Good	
GW-837	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
GW-838	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-839	Chestnut oak	*Quercus montana*	26	1	13	39	Good	
GW-840	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-841	Chestnut oak	*Quercus montana*	26	1	13	39	Fair	Trunk rot at base, reduced canopy
GW-842	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Vines in canopy, stressed
GW-843	Mockernut hickory	*Carya tomentosa*	14	1	7	21	Good	Slight lean
GW-844	White oak	*Quercus alba*	29	1	14.5	43.5	Fair	Water sprouts on trunk
GW-845	White oak	*Quercus alba*	29	1	14.5	43.5	Good	
GW-846	Chestnut oak	*Quercus montana*	27	1	13.5	40.5	Good	
GW-847	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-848	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Good	Slightly one sided
GW-849	Red maple	*Acer rubrum*	19	1	9.5	28.5	Good	Leaning
GW-850	Chestnut oak	*Quercus montana*	23	1	11.5	34.5	Good	
GW-851	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Poor	Heavy vines on trunk and in canopy
GW-852	Red maple	*Acer rubrum*	18	1	9	27	Good	
GW-853	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-854	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Stressed, reduced canopy
GW-855	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-856	Red maple	*Acer rubrum*	13	1	6.5	19.5	Good	
GW-857	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-858	Chestnut oak	*Quercus montana*	19	1	9.5	28.5	Good	
GW-859*	White oak	*Quercus alba*	35	1	17.5	52.5	Excellent	
GW-860	Chestnut oak	*Quercus montana*	22	1	11	33	Good	Dead branches
GW-861	Red maple	*Acer rubrum*	16	1	8	24	Good	
GW-862	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-863	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Poor	Heavy vines on trunk and in canopy
GW-864	American hornbeam	*Carpinus caroliniana*	5	1	2.5	7.5	Fair	Topped leader, small trunk wound healing, branch dieback in crown
GW-865*	Tuliptree	*Liriodendron tulipifera*	32, 8	2	16	48	Excellent	Twin trunks 32 x 8
GW-866	Red maple	*Acer rubrum*	15	1	7.5	22.5	Poor	Trunk rot
GW-867	Red maple	*Acer rubrum*	11	1	5.5	16.5	Good	
GW-868	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-869	Northern red oak	*Quercus rubra*	5	1	2.5	7.5	Good	
GW-870	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Fair	Vines in canopy
GW-871	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Good	
GW-872	Unknown		26	1	N/A	N/A	Standing Dead	
GW-873	Red maple	*Acer rubrum*	19	1	9.5	28.5	Good	
GW-874	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-875	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	Stressed
GW-876	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Poor	Large trunk wound, vines in canopy, dying crown
GW-877	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Stressed, broken branches
GW-878	Blackgum	*Nyssa sylvatica*	11	1	5.5	16.5	Good	
GW-879	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-880	Pignut hickory	*Carya glabra*	22	1	11	33	Good	
GW-881	Chestnut oak	*Quercus montana*	24	1	12	36	Good	Dead limb
GW-882*	Tuliptree	*Liriodendron tulipifera*	35	1	17.5	52.5	Fair	Some bark decay on trunk
GW-883	Red maple	*Acer rubrum*	11	1	5.5	16.5	Fair	Reduced canopy
GW-884	Northern red oak	*Quercus rubra*	12	1	6	18	Good	
GW-885	Chestnut oak	*Quercus montana*	24	1	12	36	Good	
GW-886	Mockernut hickory	*Carya tomentosa*	11	1	5.5	16.5	Good	
GW-887	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
GW-888	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-889	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Sparse crown
GW-890	Red maple	*Acer rubrum*	10	1	5	15	Fair	Few dead branches
GW-891	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Good	
GW-892	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-893	Red maple	*Acer rubrum*	16	1	8	24	Fair	Few dead branches
GW-894	Red maple	*Acer rubrum*	10	1	5	15	Fair	Twisted trunk, few dead branches
GW-895	White oak	*Quercus alba*	28	1	14	42	Good	
GW-896	American elm	*Ulmus americana*	11	1	5.5	16.5	Good	
GW-897	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-898	Red maple	*Acer rubrum*	27, 6	2	13.5	40.5	Poor	Twin trunks 27 x 6, dying, one dead trunk
GW-899	Chestnut oak	*Quercus montana*	15	1	7.5	22.5	Good	
GW-900	White oak	*Quercus alba*	28	1	14	42	Good	
GW-901	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Poor	No leader, cavities on trunk
GW-902	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Heavy vines into crown, leaning
GW-903	Blackgum	*Nyssa sylvatica*	10	1	5	15	Good	
GW-904	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Fair	Cavity on trunk, heavy English ivy vines into crown
GW-905	Red maple	*Acer rubrum*	16, 7, 6	3	8	24	Good	Multistem trunk 16 x 7 x 6
GW-906	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-907	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
GW-908	Black locust	*Robinia pseudoacacia*	6	1	3	9	Poor	Heavy vines on trunk and in canopy, crown nearly dead. Split above DBH
GW-909	Mockernut hickory	*Carya tomentosa*	14	1	7	21	Good	Low branch dieback
GW-910	Mockernut hickory	*Carya tomentosa*	6	1	3	9	Good	
GW-911	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Vines and broken leader
GW-912	American elm	*Ulmus americana*	5	1	2.5	7.5	Good	
GW-913	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Poor	Vine girdling trunk
GW-914	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-915	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-916	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Good	
GW-917	Blackgum	*Nyssa sylvatica*	15	1	7.5	22.5	Fair	Some dying branches
GW-918	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-919	Unknown		11	1	N/A	N/A	Standing Dead	
GW-920	Flowering dogwood	*Cornus florida*	5	1	2.5	7.5	Good	
GW-921	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-922	Pignut hickory	*Carya glabra*	13	1	6.5	19.5	Fair	Stressed with reduced canopy
GW-923	Red maple	*Acer rubrum*	6	1	3	9	Poor	Dying
GW-924	Red maple	*Acer rubrum*	6	1	3	9	Fair	Dead branches
GW-925	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Fair	Oriental bittersweet vine into canopy
GW-926	Tuliptree	*Liriodendron tulipifera*	26, 12	2	13	39	Poor	Twin trunks 26 x 12, second stem dead, large branch dieback in crown, rotting bark on trunk
GW-927	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Good	
GW-928	Flowering dogwood	*Cornus florida*	5	1	2.5	7.5	Good	
GW-929	Red maple	*Acer rubrum*	18	1	9	27	Fair	Exposed roots, small trunk wound. Splits above DBH
GW-930	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Fair	Vines on trunk
GW-931	Tuliptree	*Liriodendron tulipifera*	28	1	14	42	Good	
GW-932	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	
GW-933	Princesstree	*Paulownia tomentosa*	14	1	7	21	Fair	Leaning, dead branches
GW-934	Tuliptree	*Liriodendron tulipifera*	16	1	N/A	N/A	Standing Dead	
GW-935	White oak	*Quercus alba*	22	1	11	33	Good	
GW-936	Northern red oak	*Quercus rubra*	13	1	6.5	19.5	Good	
GW-937	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Dead leader
GW-938	American basswood	*Tilia americana*	12	1	6	18	Good	
GW-939	Princesstree	*Paulownia tomentosa*	17	1	8.5	25.5	Fair	Dead branches
GW-940	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-941	Red maple	*Acer rubrum*	19	1	9.5	28.5	Good	
GW-942	Chestnut oak	*Quercus montana*	16	1	8	24	Good	
GW-943	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Reduced canopy, dead branches
GW-944	Chestnut oak	*Quercus montana*	28	1	14	42	Good	
GW-945	Northern red oak	*Quercus rubra*	5	1	2.5	7.5	Good	
GW-946	Mockernut hickory	*Carya tomentosa*	19	1	9.5	28.5	Good	
GW-947	Unknown		30	1	N/A	N/A	Standing Dead	
GW-948	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Good	
GW-949	Chestnut oak	*Quercus montana*	20	1	10	30	Good	
GW-950	Chestnut oak	*Quercus montana*	26	1	13	39	Fair	Few dead branches
GW-951	Unknown		11	1	N/A	N/A	Standing Dead	
GW-952	Chestnut oak	*Quercus montana*	10	1	5	15	Good	
GW-953	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-954*	White oak	*Quercus alba*	40	1	20	60	Fair	Large branch dieback in crown
GW-955	Northern red oak	*Quercus rubra*	9, 8, 6	3	4.5	13.5	Fair	Multistem 9 x 8 x 6, poor branching structure, cavity at base healing
GW-956	Red maple	*Acer rubrum*	11	1	5.5	16.5	Good	
GW-957	Blackgum	*Nyssa sylvatica*	6	1	3	9	Good	
GW-958	White oak	*Quercus alba*	28	1	14	42	Good	
GW-959	Tuliptree	*Liriodendron tulipifera*	7	1	3.5	10.5	Fair	Trunk damage, stressed
GW-960	Blackgum	*Nyssa sylvatica*	7	1	3.5	10.5	Good	
GW-961	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Stressed with few dead branches
GW-962	Red maple	*Acer rubrum*	8	1	4	12	Good	

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-963	Blackgum	*Nyssa sylvatica*	8	1	4	12	Good	Vine into canopy
GW-964	Flowering dogwood	*Cornus florida*	6	1	3	9	Good	
GW-965	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Good	
GW-966	Mockernut hickory	*Carya tomentosa*	17	1	8.5	25.5	Fair	Poor branching structure
GW-967	Black cherry	*Prunus serotina*	22	1	11	33	Good	
GW-968	Tuliptree	*Liriodendron tulipifera*	22, 22, 14	3	11	33	Good	Multistem 22 x 22 x 14
GW-969*	Tuliptree	*Liriodendron tulipifera*	44	1	22	66	Good	
GW-970	Mockernut hickory	*Carya tomentosa*	10	1	5	15	Fair	Unbalanced crown, branch dieback in crown
GW-971	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Fair	Leaning, poor branching structure
GW-972	Mockernut hickory	*Carya tomentosa*	12	1	6	18	Good	
GW-973	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Fair	Leaning
GW-974	Mockernut hickory	*Carya tomentosa*	6	1	3	9	Good	Slightly unbalanced crown
GW-975	Mockernut hickory	*Carya tomentosa*	5	1	2.5	7.5	Good	
GW-976	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Good	
GW-977	Red maple	*Acer rubrum*	6	1	3	9	Fair	Many dead branches
GW-978	Tuliptree	*Liriodendron tulipifera*	7	1	3.5	10.5	Good	Lacks lower canopy
GW-979	Red maple	*Acer rubrum*	5	1	2.5	7.5	Poor	Dying
GW-980	Red maple	*Acer rubrum*	11	1	N/A	N/A	Standing Dead	
GW-981	Tuliptree	*Liriodendron tulipifera*	28	1	14	42	Good	
GW-982	Black cherry	*Prunus serotina*	8	1	4	12	Poor	Severe lean, oriental bittersweet vine taking over crown
GW-983	Unknown		11	1	N/A	N/A	Standing Dead	
GW-984	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-985	Chestnut oak	*Quercus montana*	29	1	14.5	43.5	Good	
GW-986	White ash	*Fraxinus americana*	8	1	4	12	Poor	Lean, very heavy vines in crown
GW-987	Red maple	*Acer rubrum*	10	1	5	15	Poor	Dying, vines in canopy
GW-988	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-989	Tree of heaven	*Ailanthus altissima*	5	1	2.5	7.5	Poor	Lean, very heavy vines in crown, vine girdling trunk
GW-990	Unknown		13	1	N/A	N/A	Standing Dead	
GW-991	Red maple	*Acer rubrum*	6	1	3	9	Fair	Stressed, reduced canopy
GW-992	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	
GW-993	Tuliptree	*Liriodendron tulipifera*	5	1	2.5	7.5	Fair	One sided, thin crown
GW-994*	White oak	*Quercus alba*	30	1	15	45	Good	
GW-995	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Cavity in trunk, poor branching structure
GW-996	Cherry sp.	*Prunus sp.*	6	1	3	9	Good	
GW-997	Tuliptree	*Liriodendron tulipifera*	7	1	3.5	10.5	Poor	Broken leader, trunk decay
GW-998	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Good	
GW-999	Tree of heaven	*Ailanthus altissima*	8	1	4	12	Good	One sided
GW-1000	Northern red oak	*Quercus rubra*	7	1	3.5	10.5	Fair	Lack of lower canopy
GW-1001	Blackgum	*Nyssa sylvatica*	8	1	4	12	Good	
GW-1002	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-1003	Chestnut oak	*Quercus montana*	17	1	8.5	25.5	Good	
GW-1004	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Fair	Vine in canopy
GW-1005	Northern red oak	*Quercus rubra*	25	1	12.5	37.5	Good	
GW-1006	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	
GW-1007	Tree of heaven	*Ailanthus altissima*	6, 4	2	3	9	Good	Vines on lower trunk. Twins 6 x 4
GW-1008	Tree of heaven	*Ailanthus altissima*	7, 5, 5	3	3.5	10.5	Fair	Vines on lower trunk. Multistem 7 x 5 x 5
GW-1009	Black locust	*Robinia pseudoacacia*	9	1	N/A	N/A	Standing Dead	
GW-1010	Northern red oak	*Quercus rubra*	7	1	3.5	10.5	Good	Thin crown
GW-1011	Chestnut oak	*Quercus montana*	19	1	9.5	28.5	Poor	Little canopy remains, slight lean
GW-1012	Black locust	*Robinia pseudoacacia*	12	1	N/A	N/A	Standing Dead	
GW-1013	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Poor	Severe lean, lots of water sprouts on trunk, branch dieback in crown
GW-1014	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Poor	Severe lean, water sprouts on trunk
GW-1015	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Poor	Heavy vines on trunk and in canopy, broken branches
GW-1016	Mockernut hickory	*Carya tomentosa*	22	1	11	33	Good	
GW-1017	Blackgum	*Nyssa sylvatica*	8	1	4	12	Good	
GW-1018	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Poor	Heavy vines on trunk and in canopy, broken branches
GW-1019	White oak	*Quercus alba*	22	1	11	33	Fair	Lack of lower canopy, some water
GW-1020	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Poor	Vine in canopy, lean, wound at base
GW-1021	Red maple	*Acer rubrum*	8	1	4	12	Fair	Lean, attached at base to tree GW-734
GW-1022	Unknown		21	1	N/A	N/A	Standing Dead	
GW-1023	Swamp chestnut oak	*Quercus michauxii*	21, 16	2	10.5	31.5	Poor	Vines on trunk into canopy, significant lean, exposed roots. Twins 21 x 16
GW-1024	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Poor	Significant lean, water sprouts
GW-1025	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Fair	Vines on trunk into canopy
GW-1026	American basswood	*Tilia americana*	8	1	4	12	Good	

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-1027	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Poor	Heavy lean, dead branches
GW-1028	Black cherry	*Prunus serotina*	6	1	N/A	N/A	Standing Dead	
GW-1029	Chestnut oak	*Quercus montana*	21	1	10.5	31.5	Good	Thin crown
GW-1030	White oak	*Quercus alba*	19	1	9.5	28.5	Fair	Dead branches
GW-1031	American hornbeam	*Carpinus caroliniana*	5	1	2.5	7.5	Poor	Bark decay, lean
GW-1032	Red maple	*Acer rubrum*	8	1	4	12	Fair	Water sprouts
GW-1033	White ash	*Fraxinus americana*	8	1	4	12	Poor	Broken branches, vines in canopy
GW-1034*	White oak	*Quercus alba*	39	1	19.5	58.5	Fair	Included bark, some large broken branches
GW-1035	Chestnut oak	*Quercus montana*	8	1	4	12	Good	
GW-1036	American basswood	*Tilia americana*	6	1	3	9	Fair	Lean, healed small wound at base
GW-1037	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Fair	Vines growing into canopy
GW-1038	Red maple	*Acer rubrum*	9	1	4.5	13.5	Poor	Decay at base and on trunk
GW-1039	Red maple	*Acer rubrum*	5	1	2.5	7.5	Poor	Decay at base
GW-1040*	White oak	*Quercus alba*	30	1	15	45	Good	
GW-1041	Red maple	*Acer rubrum*	11	1	5.5	16.5	Poor	Heavy vines in canopy, lean
GW-1042	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-1043	Mockernut hickory	*Carya tomentosa*	8	1	4	12	Good	One lower broken branch
GW-1044	Sweet cherry	*Prunus avium*	7	1	3.5	10.5	Fair	One sided, lean, trunk wound
GW-1045	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	One sided, spots on leaves
GW-1046	Unknown		13	1	N/A	N/A	Standing Dead	
GW-1047	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Fair	Wound on upper trunk
GW-1048	Sweet cherry	*Prunus avium*	5	1	2.5	7.5	Fair	Some cracks in bark
GW-1049	Red maple	*Acer rubrum*	19	1	9.5	28.5	Poor	Large basal cavity with decay
GW-1050	Red maple	*Acer rubrum*	17	1	8.5	25.5	Fair	Water sprouts, dead branches
GW-1051	Chestnut oak	*Quercus montana*	13	1	6.5	19.5	Fair	Lean, one sided
GW-1052	Red maple	*Acer rubrum*	16	1	8	24	Good	
GW-1053	Bitternut hickory	*Carya cordiformis*	8	1	4	12	Good	
GW-1054	Slippery elm	*Ulmus rubra*	13	1	6.5	19.5	Poor	Heavy vines on trunk in canopy
GW-1055	Mockernut hickory	*Carya tomentosa*	15	1	7.5	22.5	Good	
GW-1056	Mockernut hickory	*Carya tomentosa*	15	1	7.5	22.5	Good	
GW-1057*	Tuliptree	*Liriodendron tulipifera*	41, 18	2	20.5	61.5	Fair	Irregular trunk, broken branches. Twins 41 x 18
GW-1058	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-1059	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Fair	Vines on trunk into canopy
GW-1060	Tuliptree	*Liriodendron tulipifera*	7	1	3.5	10.5	Good	
GW-1061	Bitternut hickory	*Carya cordiformis*	9	1	4.5	13.5	Good	
GW-1062	Red maple	*Acer rubrum*	5	1	2.5	7.5	Poor	Girdled by vine
GW-1063	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Good	
GW-1064	Red maple	*Acer rubrum*	9	1	4.5	13.5	Poor	Heavy vines in crown, lean
GW-1065	Northern red oak	*Quercus rubra*	5	1	2.5	7.5	Good	
GW-1066	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Good	
GW-1067*	Tuliptree	*Liriodendron tulipifera*	43	1	21.5	64.5	Fair	Healed trunk cavity, included bark
GW-1068	Tuliptree	*Liriodendron tulipifera*	27	1	13.5	40.5	Fair	Vine in crown
GW-1069	Blackgum	*Nyssa sylvatica*	6	1	3	9	Fair	Lean, one sided
GW-1070*	Northern red oak	*Quercus rubra*	30	1	15	45	Poor	Vines on trunk into canopy, dying crown, dead branches
GW-1071	White ash	*Fraxinus americana*	8	1	4	12	Good	
GW-1072	White ash	*Fraxinus americana*	13	1	6.5	19.5	Poor	Vines on trunk into canopy, dying crown
GW-1073	Northern red oak	*Quercus rubra*	14	1	7	21	Fair	Vines on trunk into canopy
GW-1074	Northern red oak	*Quercus rubra*	6	1	3	9	Good	
GW-1075	Blackgum	*Nyssa sylvatica*	15	1	7.5	22.5	Good	One sided
GW-1076	Blackgum	*Nyssa sylvatica*	8	1	4	12	Fair	One sided, lean
GW-1077	Red maple	*Acer rubrum*	15, 12	2	7.5	22.5	Fair	Included bark, pruning, one sided. Twins 15 x 12
GW-1078*	Tuliptree	*Liriodendron tulipifera*	33	1	16.5	49.5	Good	
GW-1079	Chestnut oak	*Quercus montana*	8	1	4	12	Good	
GW-1080	White ash	*Fraxinus americana*	11	1	5.5	16.5	Fair	Lean, unbalanced crown
GW-1081	Tuliptree	*Liriodendron tulipifera*	7	1	3.5	10.5	Fair	Some dead branches
GW-1082	Red maple	*Acer rubrum*	11	1	5.5	16.5	Poor	Vines in crown, trunk decay
GW-1083	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Good	
GW-1084	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Fair	Some roots undercut by stream bank
GW-1085	American basswood	*Tilia americana*	6	1	3	9	Fair	Broken branch, lean
GW-1086	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Fair	Exposed roots over stream
GW-1087	Blackgum	*Nyssa sylvatica*	5	1	2.5	7.5	Poor	Dying crown, girdling vines on trunk
GW-1088	Red maple	*Acer rubrum*	8	1	4	12	Fair	Water sprouts, some trunk cankers
GW-1089*	White oak	*Quercus alba*	32	1	16	48	Good	
GW-1090	White oak	*Quercus alba*	28	1	N/A	N/A	Standing Dead	
GW-1091	Bitternut hickory	*Carya cordiformis*	15	1	7.5	22.5	Good	
GW-1092	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Fair	Irregular growth form
GW-1093	White oak	*Quercus alba*	15	1	7.5	22.5	Good	

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-1094	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Fair	Significant lean, irregular growth form
GW-1095	Blackgum	*Nyssa sylvatica*	6	1	3	9	Good	Thin crown
GW-1096	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Good	
GW-1097	Blackgum	*Nyssa sylvatica*	5	1	2.5	7.5	Good	
GW-1098	American beech	*Fagus grandifolia*	11	1	5.5	16.5	Poor	Vine girdling trunk
GW-1099	White oak	*Quercus alba*	23	1	11.5	34.5	Good	
GW-1100	Tuliptree	*Liriodendron tulipifera*	29, 8	2	14.5	43.5	Good	Broken branches. Twins 29 x 8
GW-1101	Unknown		18	1	N/A	N/A	Standing Dead	
GW-1102	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Fair	Vines on trunk
GW-1103	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Fair	Vines on trunk
GW-1104	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Fair	Vines on trunk, irregular trunk, trunk wound, crown looks good
GW-1105	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Good	Slight lean
GW-1106	Red maple	*Acer rubrum*	12, 7	2	6	18	Fair	Lean, water sprouts. Twins 12 x 7
GW-1107	White oak	*Quercus alba*	18	1	9	27	Good	
GW-1108	Tuliptree	*Liriodendron tulipifera*	7	1	3.5	10.5	Good	
GW-1109	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1110	Chestnut oak	*Quercus montana*	24	1	N/A	N/A	Standing Dead	
GW-1111	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Good	
GW-1112	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Fair	One sided, thin crown
GW-1113	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Fair	Significant lean
GW-1114	American beech	*Fagus grandifolia*	9	1	4.5	13.5	Good	Few broken branches
GW-1115	Unknown		5	1	N/A	N/A	Standing Dead	
GW-1116	Bitternut hickory	*Carya cordiformis*	5	1	2.5	7.5	Good	
GW-1117	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Good	Slight bend in trunk
GW-1118	Chestnut oak	*Quercus montana*	11	1	5.5	16.5	Fair	Lean, cavity at base
GW-1119	White oak	*Quercus alba*	24	1	N/A	N/A	Standing Dead	
GW-1120	Tuliptree	*Liriodendron tulipifera*	27	1	13.5	40.5	Good	Slight bend in upper trunk
GW-1121	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-1122	American beech	*Fagus grandifolia*	9	1	4.5	13.5	Good	
GW-1123	Unknown		6	1	N/A	N/A	Standing Dead	
GW-1124	Chestnut oak	*Quercus montana*	16	1	8	24	Good	
GW-1125	American elm	*Ulmus americana*	14	1	7	21	Fair	Lean, mile a minute vine on trunk
GW-1126	Red maple	*Acer rubrum*	8	1	4	12	Fair	Lean, sparse crown
GW-1127	Chestnut oak	*Quercus montana*	5	1	2.5	7.5	Fair	Significant lean
GW-1128	Chestnut oak	*Quercus montana*	18	1	9	27	Fair	Few recent trunk wounds, one sided
GW-1129	Unknown		12	1	N/A	N/A	Standing Dead	
GW-1130	Chestnut oak	*Quercus montana*	17	1	8.5	25.5	Good	
GW-1131	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Fair	Lean, unbalanced crown
GW-1132	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1133	Chestnut oak	*Quercus montana*	8	1	4	12	Good	
GW-1134	Chestnut oak	*Quercus montana*	11	1	5.5	16.5	Fair	Lean, one sided
GW-1135	Chestnut oak	*Quercus montana*	12	1	6	18	Poor	Large trunk wound with decay
GW-1136	Chestnut oak	*Quercus montana*	9	1	4.5	13.5	Good	Few broken branches
GW-1137	Chestnut oak	*Quercus montana*	12	1	6	18	Good	
GW-1138	Blackgum	*Nyssa sylvatica*	8	1	4	12	Fair	One sided, lean, broken branches
GW-1139	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Fair	Thin crown, bend in trunk
GW-1140	Chestnut oak	*Quercus montana*	16	1	8	24	Fair	Dead branches, healed trunk wound, large broken branch
GW-1141	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	Thin crown
GW-1142	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1143	Swamp chestnut oak	*Quercus michauxii*	14, 13	2	7	21	Good	Twins 14 x 13
GW-1144	Blackgum	*Nyssa sylvatica*	12	1	6	18	Good	
GW-1145	Unknown		5	1	N/A	N/A	Standing Dead	
GW-1146	Bitternut hickory	*Carya cordiformis*	16	1	8	24	Good	
GW-1147	Chestnut oak	*Quercus montana*	16	1	8	24	Fair	One sided, lean
GW-1148	Swamp chestnut oak	*Quercus michauxii*	16	1	8	24	Good	
GW-1149	White oak	*Quercus alba*	28	1	14	42	Fair	Large poison ivy vine growing into crown
GW-1150	Chestnut oak	*Quercus montana*	12	1	6	18	Poor	Nearly dead crown, dead branches
GW-1151	White oak	*Quercus alba*	29	1	14.5	43.5	Good	Some dead branches
GW-1152	Swamp chestnut oak	*Quercus michauxii*	14	1	7	21	Poor	Nearly dead crown
GW-1153	Swamp chestnut oak	*Quercus michauxii*	12, 7	2	6	18	Good	Twins 12 x 7
GW-1154	White oak	*Quercus alba*	14	1	N/A	N/A	Standing Dead	
GW-1155	Unknown		6	1	N/A	N/A	Standing Dead	
GW-1156	Chestnut oak	*Quercus montana*	18	1	9	27	Fair	Lean, dead lower branches
GW-1157	Eastern redbud	*Cercis canadensis*	10	1	5	15	Poor	Tree nearly dead, trunk decay
GW-1158	Northern red oak	*Quercus rubra*	5	1	2.5	7.5	Poor	Dead leader, dead branches
GW-1159	White oak	*Quercus alba*	18	1	9	27	Good	Lots of small dead branches
GW-1160	Blackgum	*Nyssa sylvatica*	10	1	5	15	Good	
GW-1161	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Lots of small dead branches
GW-1162	Blackgum	*Nyssa sylvatica*	5	1	2.5	7.5	Good	
GW-1163	Chestnut oak	*Quercus montana*	17, 12	2	8.5	25.5	Fair	One sided, dead large branch. Twins 17 x 12
GW-1164	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	Slightly one sided
GW-1165	Unknown		7	1	N/A	N/A	Standing Dead	
GW-1166	Unknown		6	1	N/A	N/A	Standing Dead	
GW-1167	Swamp chestnut oak	*Quercus michauxii*	10	1	5	15	Good	Thin crown
GW-1168	White oak	*Quercus alba*	24	1	12	36	Poor	Multiple long trunk wounds, possible lightning damage, crown looks good
GW-1169	Swamp chestnut oak	*Quercus michauxii*	15	1	7.5	22.5	Good	One sided
GW-1170	Swamp chestnut oak	*Quercus michauxii*	17	1	8.5	25.5	Fair	Water sprouts, one sided
GW-1171	Unknown		17, 14	2	N/A	N/A	Standing Dead	Twins 17 x 14
GW-1172	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Fair	Some healed bark damage, thin crown
GW-1173	Chestnut oak	*Quercus montana*	18	1	9	27	Fair	Thin crown, large broken branch
GW-1174	Unknown		13	1	N/A	N/A	Standing Dead	
GW-1175	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Lean, one sided, broken leader
GW-1176	Swamp chestnut oak	*Quercus michauxii*	7	1	3.5	10.5	Good	
GW-1177	Northern red oak	*Quercus rubra*	20	1	10	30	Good	
GW-1178	Blackgum	*Nyssa sylvatica*	6	1	3	9	Fair	Lean, one sided, broken leader
GW-1179	Chestnut oak	*Quercus montana*	18	1	9	27	Fair	Broken branches
GW-1180	Chestnut oak	*Quercus montana*	6	1	3	9	Fair	Thin crown, dead branches
GW-1181	White oak	*Quercus alba*	28	1	N/A	N/A	Standing Dead	
GW-1182	Blackgum	*Nyssa sylvatica*	12	1	6	18	Good	Lean
GW-1183	Mockernut hickory	*Carya tomentosa*	11	1	5.5	16.5	Good	Thin crown
GW-1184	Unknown		7	1	N/A	N/A	Standing Dead	
GW-1185	Chestnut oak	*Quercus montana*	7, 6	2	3.5	10.5	Fair	Dead 6" twin trunk
GW-1186	Chestnut oak	*Quercus montana*	22	1	11	33	Good	
GW-1187	Red maple	*Acer rubrum*	11	1	5.5	16.5	Good	Broken lower branch
GW-1188	Red maple	*Acer rubrum*	6	1	3	9	Fair	Dead branches, thin crown
GW-1189	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Good	Broken lower branches
GW-1190	Blackgum	*Nyssa sylvatica*	9	1	4.5	13.5	Fair	One sided, dead branches
GW-1191	Blackgum	*Nyssa sylvatica*	7	1	3.5	10.5	Fair	One sided, thin crown
GW-1192	Red maple	*Acer rubrum*	7, 3	2	3.5	10.5	Good	Included bark, some dead branches. Twin trunks 7 x 3
GW-1193	Blackgum	*Nyssa sylvatica*	5	1	2.5	7.5	Fair	Thin crown, one sided
GW-1194	Green ash	*Fraxinus pennsylvanica*	6	1	3	9	Fair	Lean, vines in canopy
GW-1195	Blackgum	*Nyssa sylvatica*	10	1	5	15	Fair	Water sprouts
GW-1196	Mockernut hickory	*Carya tomentosa*	14	1	7	21	Good	
GW-1197	White oak	*Quercus alba*	21	1	10.5	31.5	Good	
GW-1198	Blackgum	*Nyssa sylvatica*	11	1	5.5	16.5	Fair	Irregular growth form, water sprouts
GW-1199	Mockernut hickory	*Carya tomentosa*	7	1	3.5	10.5	Good	
GW-1200	Northern red oak	*Quercus rubra*	6	1	3	9	Fair	Dead branches
GW-1201	White oak	*Quercus alba*	22	1	11	33	Good	
GW-1202	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Good	
GW-1203	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Fair	One dead leader high in canopy
GW-1204	Chestnut oak	*Quercus montana*	25	1	12.5	37.5	Fair	Some dead branches
GW-1205	Swamp chestnut oak	*Quercus michauxii*	9	1	4.5	13.5	Fair	Some dead branches
GW-1206	Red maple	*Acer rubrum*	12, 9	2	6	18	Fair	Vines on trunk and canopy. Twin trunks 12 x 9
GW-1207	Red maple	*Acer rubrum*	7, 5, 3	3	3.5	10.5	Fair	Interfering branches, dead branches. Multistem 7 x 5 x 3
GW-1208	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Good	Interfering branches, dead branches
GW-1209	Sugar maple	*Acer saccharum*	6	1	3	9	Good	
GW-1210	Chestnut oak	*Quercus montana*	20	1	10	30	Good	
GW-1211	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-1212	Chestnut oak	*Quercus montana*	22	1	11	33	Fair	Some decaying branches
GW-1213*	Chestnut oak	*Quercus montana*	31	1	15.5	46.5	Fair	Some large dead branches
GW-1214	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Good	Thin crown
GW-1215	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Good	
GW-1216	Eastern redbud	*Cercis canadensis*	5	1	2.5	7.5	Poor	Damaged trunk, lean
GW-1217	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Good	
GW-1218	Unknown		6	1	N/A	N/A	Standing Dead	
GW-1219	Black cherry	*Prunus serotina*	14	1	7	21	Fair	Vines on trunk into crown
GW-1220	Unknown		5	1	N/A	N/A	Standing Dead	
GW-1221	Blackgum	*Nyssa sylvatica*	18	1	9	27	Fair	Vines into crown
GW-1222	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Poor	Half of trunk decayed, one live branch
GW-1223	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Good	Thin crown
GW-1224	Bitternut hickory	*Carya cordiformis*	22	1	11	33	Good	Thin crown
GW-1225	Bitternut hickory	*Carya cordiformis*	15	1	7.5	22.5	Good	
GW-1226	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	Thin crown
GW-1227	Bitternut hickory	*Carya cordiformis*	15	1	7.5	22.5	Good	
GW-1228	Northern red oak	*Quercus rubra*	16	1	8	24	Fair	Vines in trunk into canopy

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-1229	Northern red oak	*Quercus rubra*	24, 7	2	12	36	Fair	Some bittersweet in crown. Twins 24 x 7
GW-1230	Red maple	*Acer rubrum*	6	1	3	9	Fair	Dead lower branches
GW-1231	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	
GW-1232	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Good	Unbalanced crown
GW-1233	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Fair	Many broken branches, thin crown
GW-1234	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Good	One sided
GW-1235	Red maple	*Acer rubrum*	8	1	4	12	Fair	Lean, dead upper branch
GW-1236	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	One sided
GW-1237	Northern red oak	*Quercus rubra*	7	1	3.5	10.5	Good	One sided
GW-1238	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Poor	Significant lean, very thin crown
GW-1239	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	
GW-1240	Princesstree	*Paulownia tomentosa*	6	1	3	9	Poor	Heavy vines in canopy
GW-1241	Tuliptree	*Liriodendron tulipifera*	5	1	2.5	7.5	Fair	Irregular growth form, some dead branches
GW-1242	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Fair	Large broken branch, irregular growth form
GW-1243	Mockernut hickory	*Carya tomentosa*	21	1	10.5	31.5	Fair	Large poison ivy vine on trunk going into crown
GW-1244	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Good	Bend in trunk
GW-1245	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Good	
GW-1246	Princesstree	*Paulownia tomentosa*	6	1	3	9	Fair	Lean
GW-1247	Northern red oak	*Quercus rubra*	12	1	6	18	Fair	Vines on trunk
GW-1248*	Pignut hickory	*Carya glabra*	31	1	15.5	46.5	Good	
GW-1249	Northern red oak	*Quercus rubra*	28	1	14	42	Good	Some broken lower branches
GW-1250	Green ash	*Fraxinus pennsylvanica*	9	1	4.5	13.5	Fair	Dead lower branches
GW-1251	Unknown		7	1	N/A	N/A	Standing Dead	
GW-1252	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Good	Lean
GW-1253	American elm	*Ulmus americana*	6	1	3	9	Fair	Dead branches, irregular crown
GW-1254	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	
GW-1255	American elm	*Ulmus americana*	10	1	5	15	Fair	Dead branches, irregular crown
GW-1256	Red maple	*Acer rubrum*	5	1	2.5	7.5	Poor	Tree mostly dead, one live branch
GW-1257	American basswood	*Tilia americana*	6	1	3	9	Fair	Dead lower branches
GW-1258	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Fair	Very thin crown, no lower branches
GW-1259	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Poor	Very heavy lean, roots coming out of ground
GW-1260	Northern red oak	*Quercus rubra*	9	1	4.5	13.5	Fair	One sided, large broken branches
GW-1261	Red maple	*Acer rubrum*	6, 5, 4	3	3	9	Fair	Interfering branches, trunk wound. Multistem 6 x 5 x 4
GW-1262	White oak	*Quercus alba*	28	1	14	42	Good	
GW-1263	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Fair	One sided, some trunk wounds, heavy storm debris against trunk
GW-1264	Blackgum	*Nyssa sylvatica*	9	1	4.5	13.5	Good	Some storm debris at base
GW-1265	Red maple	*Acer rubrum*	16	1	8	24	Fair	Large broken branches, thin crown
GW-1266	Northern red oak	*Quercus rubra*	7	1	3.5	10.5	Good	
GW-1267	Red maple	*Acer rubrum*	5	1	N/A	N/A	Standing Dead	
GW-1268	Swamp chestnut oak	*Quercus michauxii*	23	1	11.5	34.5	Good	
GW-1269	Swamp chestnut oak	*Quercus michauxii*	29	1	14.5	43.5	Good	Lean
GW-1270	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Dead branches, thin crown
GW-1271*	Chestnut oak	*Quercus montana*	31	1	15.5	46.5	Good	
GW-1272	Red maple	*Acer rubrum*	7, 2, 1	3	3.5	10.5	Good	Multistem 7 x 2 x 1
GW-1273	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1274	Swamp chestnut oak	*Quercus michauxii*	5	1	2.5	7.5	Fair	One sided, dead branches thin crown.
GW-1275	Unknown		5	1	N/A	N/A	Standing Dead	
GW-1276	Chestnut oak	*Quercus montana*	24	1	12	36	Good	Lean
GW-1277	Swamp chestnut oak	*Quercus michauxii*	6	1	3	9	Fair	One sided, dead branches
GW-1278	Blackgum	*Nyssa sylvatica*	7	1	3.5	10.5	Good	
GW-1279	Red maple	*Acer rubrum*	8, 8	2	4	12	Good	Twins 8 x 8
GW-1280	Swamp chestnut oak	*Quercus michauxii*	18	1	9	27	Fair	Large dead upper branches
GW-1281	Northern red oak	*Quercus rubra*	11	1	5.5	16.5	Fair	Large dead upper branch
GW-1282	Chestnut oak	*Quercus montana*	16	1	8	24	Good	Broken lower branch, lean
GW-1283	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Irregular growth form
GW-1284	Northern red oak	*Quercus rubra*	20	1	10	30	Good	
GW-1285	Northern red oak	*Quercus rubra*	23	1	11.5	34.5	Good	
GW-1286	Northern red oak	*Quercus rubra*	23, 12	2	11.5	34.5	Good	Dead lower branch. Twins 23 x 12
GW-1287	Chestnut oak	*Quercus montana*	17	1	8.5	25.5	Good	
GW-1288	Blackgum	*Nyssa sylvatica*	26	1	13	39	Good	
GW-1289	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Many dead branches
GW-1290	Red maple	*Acer rubrum*	22	1	11	33	Good	
GW-1291	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Thin crown, premature leaf loss
GW-1292	Northern red oak	*Quercus rubra*	11	1	5.5	16.5	Fair	One sided, dead lower branches
GW-1293	Chestnut oak	*Quercus montana*	22	1	11	33	Good	Dead lower branch

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-1294	Northern red oak	*Quercus rubra*	19	1	9.5	28.5	Good	
GW-1295	Red maple	*Acer rubrum*	6	1	3	9	Fair	Dead branches, thin crown
GW-1296	Blackgum	*Nyssa sylvatica*	5	1	2.5	7.5	Good	One sided
GW-1297	Chestnut oak	*Quercus montana*	19, 18, 16	3	9.5	28.5	Good	Multistem 19 x 18 x 16, broad leaves
GW-1298	Northern red oak	*Quercus rubra*	7	1	3.5	10.5	Good	Thin crown
GW-1299	Blackgum	*Nyssa sylvatica*	16	1	8	24	Good	Some dead lower branches
GW-1300	Northern red oak	*Quercus rubra*	17	1	8.5	25.5	Fair	Some bark decay
GW-1301	Red maple	*Acer rubrum*	5, 3	2	2.5	7.5	Good	One sided, thin crown. Twins 5 x 3
GW-1302	Red maple	*Acer rubrum*	6	1	3	9	Poor	Crown nearly dead
GW-1303	Northern red oak	*Quercus rubra*	18	1	9	27	Good	Few dead branches
GW-1304	Northern red oak	*Quercus rubra*	19	1	9.5	28.5	Good	Some dead branches, lean
GW-1305	Swamp chestnut oak	*Quercus michauxii*	21	1	10.5	31.5	Fair	Thin crown, some large dead branches
GW-1306	Blackgum	*Nyssa sylvatica*	9	1	4.5	13.5	Good	Slightly one sided
GW-1307*	Swamp chestnut oak	*Quercus michauxii*	54	1	27	81	Fair	Some bark decay at base, some large dead branches
GW-1308	Blackgum	*Nyssa sylvatica*	6	1	3	9	Fair	Dead leader replaced by new leader, some healed bark wounds
GW-1309	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Irregular growth form
GW-1310	Swamp chestnut oak	*Quercus michauxii*	8	1	N/A	N/A	Standing Dead	
GW-1311	Swamp chestnut oak	*Quercus michauxii*	7	1	N/A	N/A	Standing Dead	
GW-1312	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-1313	Swamp chestnut oak	*Quercus michauxii*	11	1	5.5	16.5	Fair	One sided, lean
GW-1314	Eastern redbud	*Cercis canadensis*	8, 6	2	4	12	Fair	Significant lean, one sided. Twins 8 x 6
GW-1315	Northern red oak	*Quercus rubra*	20	1	10	30	Fair	Unbalanced crown, dead branches
GW-1316	Red maple	*Acer rubrum*	8	1	4	12	Fair	Thin crown, premature leaf loss
GW-1317	Blackgum	*Nyssa sylvatica*	7	1	3.5	10.5	Fair	Lean, irregular growth form
GW-1318	Blackgum	*Nyssa sylvatica*	6	1	3	9	Good	Lean, slightly one sided
GW-1319	Blackgum	*Nyssa sylvatica*	7	1	3.5	10.5	Fair	Dead lower branches, one sided, unbalanced crown
GW-1320	Red maple	*Acer rubrum*	11	1	5.5	16.5	Good	Lean
GW-1321	Red maple	*Acer rubrum*	8	1	4	12	Fair	Thin crown, one sided, only top branches remaining
GW-1322	White oak	*Quercus alba*	8	1	4	12	Fair	One sided, lean
GW-1323	Red maple	*Acer rubrum*	8	1	4	12	Fair	Lean, irregular growth form
GW-1324	Red maple	*Acer rubrum*	7	1	3.5	10.5	Poor	Dead crown
GW-1325	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Irregular growth form
GW-1326	White oak	*Quercus alba*	10	1	5	15	Fair	Dead branches, thin crown
GW-1327	Northern red oak	*Quercus rubra*	19	1	9.5	28.5	Good	
GW-1328	White oak	*Quercus alba*	19	1	9.5	28.5	Good	
GW-1329	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-1330	Red maple	*Acer rubrum*	9, 4, 3	3	4.5	13.5	Fair	Interfering branches, thin crown. Multistem 9 x 4 x 3
GW-1331	White oak	*Quercus alba*	26	1	13	39	Fair	Vines into crown
GW-1332	Swamp chestnut oak	*Quercus michauxii*	9, 8	2	4.5	13.5	Good	Twins 9 x 8
GW-1333	Blackgum	*Nyssa sylvatica*	6	1	3	9	Fair	Dead lower branches, thin crown
GW-1334	Red maple	*Acer rubrum*	5	1	N/A	N/A	Standing Dead	
GW-1335	Swamp chestnut oak	*Quercus michauxii*	16	1	8	24	Good	Thin crown
GW-1336	Swamp chestnut oak	*Quercus michauxii*	22	1	11	33	Good	
GW-1337	Red maple	*Acer rubrum*	13, 8, 6	3	6.5	19.5	Good	Multistem 13 x 8 x 6
GW-1338	Unknown		25	1	N/A	N/A	Standing Dead	
GW-1339	Northern red oak	*Quercus rubra*	6	1	3	9	Fair	One sided, significant lean
GW-1340	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-1341	Blackgum	*Nyssa sylvatica*	6	1	3	9	Good	
GW-1342	Swamp chestnut oak	*Quercus michauxii*	27	1	13.5	40.5	Fair	One of split trunks is dead, other appears healthy. Splits above DBH
GW-1343	Blackgum	*Nyssa sylvatica*	6	1	3	9	Fair	Large broken branch, one sided
GW-1344	Blackgum	*Nyssa sylvatica*	6	1	3	9	Good	Some dead lower branches
GW-1345	Tuliptree	*Liriodendron tulipifera*	32	1	N/A	N/A	Standing Dead	
GW-1346	Blackgum	*Nyssa sylvatica*	6	1	3	9	Good	Some dead lower branches
GW-1347	Chestnut oak	*Quercus montana*	15, 13	2	7.5	22.5	Good	Twins 15 x 13
GW-1348	Blackgum	*Nyssa sylvatica*	6	1	3	9	Fair	One sided, unbalanced crown
GW-1349	Blackgum	*Nyssa sylvatica*	6	1	3	9	Good	
GW-1350	Blackgum	*Nyssa sylvatica*	6	1	3	9	Good	
GW-1351	Chestnut oak	*Quercus montana*	34	1	N/A	N/A	Standing Dead	
GW-1352	Sassafras	*Sassafras albidum*	7	1	3.5	10.5	Good	Slight lean
GW-1353	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Good	Lean
GW-1354	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-1355	Northern red oak	*Quercus rubra*	13	1	6.5	19.5	Good	Some dead lower branches
GW-1356	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	Broken lower branches
GW-1357	Blackgum	*Nyssa sylvatica*	7	1	3.5	10.5	Good	
GW-1358	Blackgum	*Nyssa sylvatica*	6	1	3	9	Good	

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-1359	Blackgum	*Nyssa sylvatica*	8	1	4	12	Poor	Broken leader
GW-1360	Red maple	*Acer rubrum*	12, 3	2	6	18	Good	Twin trunks 12 x 3
GW-1361	Northern red oak	*Quercus rubra*	18	1	9	27	Fair	One dead leader, rest of crown is full
GW-1362	Blackgum	*Nyssa sylvatica*	23	1	11.5	34.5	Good	Lean
GW-1363	Blackgum	*Nyssa sylvatica*	6	1	3	9	Good	
GW-1364	Blackgum	*Nyssa sylvatica*	7	1	3.5	10.5	Good	
GW-1365	Blackgum	*Nyssa sylvatica*	10	1	5	15	Fair	Dead lower branches
GW-1366	Blackgum	*Nyssa sylvatica*	9	1	4.5	13.5	Good	Some small dead lower branches
GW-1367	Chestnut oak	*Quercus montana*	9	1	4.5	13.5	Fair	Some broken branches, lean
GW-1368	Bitternut hickory	*Carya cordiformis*	7	1	3.5	10.5	Good	
GW-1369	Blackgum	*Nyssa sylvatica*	7	1	3.5	10.5	Fair	Large area of healed over missing bark, one sided
GW-1370	Blackgum	*Nyssa sylvatica*	8	1	4	12	Good	Some small dead lower branches
GW-1371	Blackgum	*Nyssa sylvatica*	8	1	4	12	Good	
GW-1372	Northern red oak	*Quercus rubra*	11	1	5.5	16.5	Fair	Significant lean, some dead branches
GW-1373	Blackgum	*Nyssa sylvatica*	5	1	2.5	7.5	Good	
GW-1374	Blackgum	*Nyssa sylvatica*	8	1	4	12	Good	Some lower broken branches
GW-1375*	Southern red oak	*Quercus falcata*	30	1	15	45	Good	
GW-1376	Blackgum	*Nyssa sylvatica*	6	1	3	9	Good	
GW-1377	Blackgum	*Nyssa sylvatica*	8	1	4	12	Fair	Bend in top of trunk, one sided
GW-1378	Chestnut oak	*Quercus montana*	19	1	9.5	28.5	Good	
GW-1379	Tuliptree	*Liriodendron tulipifera*	7	1	3.5	10.5	Good	
GW-1380	Blackgum	*Nyssa sylvatica*	5	1	2.5	7.5	Good	
GW-1381	Chestnut oak	*Quercus montana*	9	1	4.5	13.5	Fair	Large dead branch, thin crown
GW-1382	White oak	*Quercus alba*	19	1	9.5	28.5	Good	
GW-1383	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Good	
GW-1384	Red maple	*Acer rubrum*	6, 6	2	3	9	Poor	Dead crown, second trunk with heavy decay. Twins 6 x 6
GW-1385	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-1386	Mockernut hickory	*Carya tomentosa*	5	1	2.5	7.5	Good	One sided
GW-1387	Mockernut hickory	*Carya tomentosa*	11	1	5.5	16.5	Good	Bend in upper trunk
GW-1388	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	
GW-1389	Blackgum	*Nyssa sylvatica*	6	1	3	9	Good	Thin crown
GW-1390	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-1391*	Northern red oak	*Quercus rubra*	33	1	16.5	49.5	Good	One sided
GW-1392	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Irregular growth form
GW-1393	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Very thin crown, dead small branches
GW-1394	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Very thin crown, lean, small dead branches
GW-1395	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-1396	American beech	*Fagus grandifolia*	14	1	7	21	Good	
GW-1397	Bitternut hickory	*Carya cordiformis*	10	1	5	15	Good	
GW-1398	Red maple	*Acer rubrum*	8, 7	2	4	12	Fair	Large dead branch, included bark, small basal wound. Twins 8 x 7
GW-1399	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1400	Unknown		11	1	N/A	N/A	Standing Dead	
GW-1401	Red maple	*Acer rubrum*	8	1	4	12	Fair	Bend in trunk, thin crown
GW-1402	Unknown		11	1	N/A	N/A	Standing Dead	
GW-1403	American beech	*Fagus grandifolia*	20	1	10	30	Good	
GW-1404	Bitternut hickory	*Carya cordiformis*	8	1	4	12	Fair	Very thin crown and growth form
GW-1405	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	Some dead lower branches
GW-1406	Unknown		7	1	N/A	N/A	Standing Dead	
GW-1407	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Fair	Significant lean, thin crown
GW-1408	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	Unbalanced crown
GW-1409	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Fair	Large trunk wound
GW-1410	American beech	*Fagus grandifolia*	5, 3	2	2.5	7.5	Good	Twins 5 x 3
GW-1411	Northern red oak	*Quercus rubra*	29, 10	2	14.5	43.5	Fair	10" twin has lean, thin crown, insect damage to foliage. Twins 29 x 10
GW-1412	American beech	*Fagus grandifolia*	9	1	4.5	13.5	Good	
GW-1413	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Thin crown, one sided
GW-1414	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	Thin crown
GW-1415	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-1416	White oak	*Quercus alba*	8	1	4	12	Fair	Irregular growth form, one sided
GW-1417	Bitternut hickory	*Carya cordiformis*	18	1	9	27	Good	
GW-1418	Tuliptree	*Liriodendron tulipifera*	27	1	13.5	40.5	Good	
GW-1419	Bitternut hickory	*Carya cordiformis*	6	1	3	9	Good	
GW-1420	Red maple	*Acer rubrum*	11	1	5.5	16.5	Good	Slight lean
GW-1421	Pin oak	*Quercus palustris*	25	1	12.5	37.5	Fair	Poison ivy on lower trunk
GW-1422	Red maple	*Acer rubrum*	10	1	5	15	Good	Splits above DBH
GW-1423	American beech	*Fagus grandifolia*	15	1	7.5	22.5	Good	
GW-1424	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Good	

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-1425	American beech	*Fagus grandifolia*	12	1	6	18	Fair	Exposed roots
GW-1426	White oak	*Quercus alba*	14	1	7	21	Good	
GW-1427	American beech	*Fagus grandifolia*	9	1	4.5	13.5	Good	One sided
GW-1428*	Red maple	*Acer rubrum*	30	1	15	45	Fair	Included bark, some small trunk wounds, water sprouts
GW-1429	American beech	*Fagus grandifolia*	19	1	9.5	28.5	Good	
GW-1430	American beech	*Fagus grandifolia*	10	1	5	15	Good	
GW-1431	Tree of heaven	*Ailanthus altissima*	11	1	5.5	16.5	Poor	Significant lean, broken leader
GW-1432	Tree of heaven	*Ailanthus altissima*	11	1	5.5	16.5	Poor	Dying crown, decaying wound at base
GW-1433	Black oak	*Quercus velutina*	13	1	6.5	19.5	Fair	One sided, lean
GW-1434	Black cherry	*Prunus serotina*	16	1	8	24	Poor	Dead leader
GW-1435	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Good	
GW-1436	Mockernut hickory	*Carya tomentosa*	5	1	2.5	7.5	Good	
GW-1437	Mockernut hickory	*Carya tomentosa*	8	1	4	12	Good	
GW-1438	Unknown		6	1	N/A	N/A	Standing Dead	
GW-1439	Northern red oak	*Quercus rubra*	24	1	12	36	Good	One sided
GW-1440	Unknown		8	1	N/A	N/A	Standing Dead	
GW-1441	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	
GW-1442	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Good	
GW-1443	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Good	One sided
GW-1444	American beech	*Fagus grandifolia*	10	1	5	15	Good	One sided
GW-1445	Black oak	*Quercus velutina*	11	1	5.5	16.5	Fair	One sided, significant lean
GW-1446	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	
GW-1447	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1448	American beech	*Fagus grandifolia*	6	1	3	9	Good	Slightly one sided
GW-1449*	White oak	*Quercus alba*	34	1	17	51	Good	
GW-1450	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1451	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	
GW-1452	Tuliptree	*Liriodendron tulipifera*	28	1	14	42	Good	
GW-1453	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1454	Red maple	*Acer rubrum*	7, 3, 1	3	3.5	10.5	Good	One sided. Multistem 7 x 3 x 1
GW-1455	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1456	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	Thin crown
GW-1457	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	One sided, unbalanced crown
GW-1458	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	One dead branch in canopy
GW-1459	Red maple	*Acer rubrum*	6, 3	2	3	9	Fair	Some small dead branches, thin crown. Twins 6 x 3
GW-1460	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Good	
GW-1461*	Tuliptree	*Liriodendron tulipifera*	32	1	16	48	Good	Slight lean. Splits above DBH
GW-1462	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	Slight lean
GW-1463	Northern red oak	*Quercus rubra*	19	1	9.5	28.5	Fair	Slight lean at top
GW-1464	Unknown		7	1	N/A	N/A	Standing Dead	
GW-1465	Chestnut oak	*Quercus montana*	27	1	13.5	40.5	Fair	One sided, lean
GW-1466	American beech	*Fagus grandifolia*	13	1	6.5	19.5	Good	
GW-1467	Unknown		9	1	N/A	N/A	Standing Dead	
GW-1468	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Fair	Significant lean, one sided
GW-1469	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1470	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Fair	Irregular trunk, dead lower branches, thin canopy
GW-1471	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-1472	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1473	Unknown		6	1	N/A	N/A	Standing Dead	
GW-1474	Red maple	*Acer rubrum*	7, 6	2	3.5	10.5	Fair	One sided, basal sprouts off of old decayed stump. Twins 7 x 6
GW-1475	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-1476	Unknown		7	1	N/A	N/A	Standing Dead	
GW-1477	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	One sided
GW-1478	American beech	*Fagus grandifolia*	8	1	4	12	Good	A little one sided
GW-1479	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	Slight lean, one sided
GW-1480	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Fair	Trunk cavity with some decay at base
GW-1481	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Good	
GW-1482	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	Slight lean
GW-1483	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Good	
GW-1484	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Thin crown, lean, some dead branches
GW-1485	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	Splits above DBH
GW-1486	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Fair	One dead branch in canopy
GW-1487	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Good	
GW-1488	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Good	
GW-1489	Red maple	*Acer rubrum*	7	1	3.5	10.5	Poor	Large trunk wound with bark decay, thin crown, some dead upper branches
GW-1490	Tree of heaven	*Ailanthus altissima*	16	1	8	24	Good	Thin crown

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-1491	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Good	Bend in upper canopy
GW-1492	Bitternut hickory	*Carya cordiformis*	15	1	7.5	22.5	Good	Few broken branches
GW-1493	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Good	Slight lean
GW-1494	Pin oak	*Quercus palustris*	9	1	4.5	13.5	Fair	Thin crown, one sided, dead lower branches, lean
GW-1495	Unknown		21	1	N/A	N/A	Standing Dead	
GW-1496	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1497	Scarlet oak	*Quercus coccinea*	17	1	8.5	25.5	Good	Irregular growth form, one sided
GW-1498	Northern red oak	*Quercus rubra*	8	1	4	12	Good	Some dead lower branches
GW-1499	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Good	
GW-1500	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Fair	Vines in crown
GW-1501	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Poor	Bark decaying up length of trunk
GW-1502	Unknown		11	1	N/A	N/A	Standing Dead	
GW-1503	Unknown		16	1	N/A	N/A	Standing Dead	
GW-1504	Unknown		6	1	N/A	N/A	Standing Dead	
GW-1505	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	One sided
GW-1506	Eastern redbud	*Cercis canadensis*	6	1	3	9	Fair	Irregular growth form, one sided
GW-1507	Scarlet oak	*Quercus coccinea*	25	1	12.5	37.5	Fair	Trumpet vine climbing up trunk
GW-1508	American beech	*Fagus grandifolia*	14	1	7	21	Good	
GW-1509	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	One sided
GW-1510	Mockernut hickory	*Carya tomentosa*	5	1	2.5	7.5	Good	One sided
GW-1511	Red maple	*Acer rubrum*	6	1	3	9	Poor	Decaying bark, broken leader
GW-1512	White ash	*Fraxinus americana*	5	1	2.5	7.5	Poor	Tree nearly dead, very few live branches
GW-1513	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Fair	Vines growing into crown
GW-1514	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Good	
GW-1515	Tuliptree	*Liriodendron tulipifera*	28	1	14	42	Good	
GW-1516	Sugar maple	*Acer saccharum*	5	1	2.5	7.5	Good	One sided
GW-1517	White ash	*Fraxinus americana*	7	1	3.5	10.5	Fair	Dying leader
GW-1518	Bitternut hickory	*Carya cordiformis*	6	1	3	9	Good	
GW-1519	Bitternut hickory	*Carya cordiformis*	13	1	6.5	19.5	Fair	Trunk wound with some decay, some dead branches
GW-1520	Northern red oak	*Quercus rubra*	6	1	3	9	Good	Thin crown, one sided
GW-1521	Bitternut hickory	*Carya cordiformis*	28	1	14	42	Good	
GW-1522	American beech	*Fagus grandifolia*	10	1	5	15	Good	
GW-1523	Bitternut hickory	*Carya cordiformis*	13	1	6.5	19.5	Good	
GW-1524	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Good	Irregular trunk
GW-1525	American hornbeam	*Carpinus caroliniana*	6	1	3	9	Poor	Decaying bark, significant lean
GW-1526	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	
GW-1527	American beech	*Fagus grandifolia*	9	1	4.5	13.5	Good	
GW-1528	Northern red oak	*Quercus rubra*	8	1	4	12	Poor	Dying crown
GW-1529	Sugar maple	*Acer saccharum*	9	1	4.5	13.5	Good	Split above DBH
GW-1530	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	Split above DBH
GW-1531	American beech	*Fagus grandifolia*	8	1	4	12	Good	
GW-1532	Mockernut hickory	*Carya tomentosa*	20	1	10	30	Good	
GW-1533	American elm	*Ulmus americana*	5	1	2.5	7.5	Good	
GW-1534*	Tuliptree	*Liriodendron tulipifera*	31	1	15.5	46.5	Good	
GW-1535	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Good	
GW-1536	Northern red oak	*Quercus rubra*	14	1	7	21	Fair	One sided, broken branches
GW-1537	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-1538	Mockernut hickory	*Carya tomentosa*	13	1	6.5	19.5	Good	One sided
GW-1539	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Fair	Split leader at top, unbalanced crown
GW-1540	Northern red oak	*Quercus rubra*	7	1	3.5	10.5	Fair	Significant lean, dead lower branches
GW-1541	Mockernut hickory	*Carya tomentosa*	19	1	9.5	28.5	Good	One sided
GW-1542	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-1543	Mockernut hickory	*Carya tomentosa*	29	1	14.5	43.5	Good	Some dead small branches
GW-1544	American beech	*Fagus grandifolia*	19	1	9.5	28.5	Good	
GW-1545	Mockernut hickory	*Carya tomentosa*	8	1	4	12	Fair	Thin crown
GW-1546	White ash	*Fraxinus americana*	16	1	N/A	N/A	Standing Dead	
GW-1547	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1548	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-1549	Mockernut hickory	*Carya tomentosa*	18	1	9	27	Good	
GW-1550	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-1551	Mockernut hickory	*Carya tomentosa*	21	1	10.5	31.5	Good	Bend in upper trunk, leader splits in
GW-1552	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1553	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	Some dead wood, split leader above
GW-1554	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	Some dead wood
GW-1555	Red maple	*Acer rubrum*	13	1	6.5	19.5	Good	
GW-1556	Red maple	*Acer rubrum*	7	1	3.5	10.5	Poor	Trunk wounds, water sprouts, significant lean
GW-1557*	Southern red oak	*Quercus falcata*	40	1	20	60	Good	Slightly irregular crown
GW-1558*	Tuliptree	*Liriodendron tulipifera*	34	1	17	51	Good	

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-1559	American beech	*Fagus grandifolia*	10	1	5	15	Good	
GW-1560	American beech	*Fagus grandifolia*	9	1	4.5	13.5	Good	
GW-1561	American beech	*Fagus grandifolia*	27	1	13.5	40.5	Good	Slightly one sided
GW-1562	Mockernut hickory	*Carya tomentosa*	18	1	9	27	Good	Healed basal cavity
GW-1563	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-1564	Red maple	*Acer rubrum*	12	1	6	18	Fair	Basal cavity, lean in top of crown
GW-1565	Black walnut	*Juglans nigra*	13	1	6.5	19.5	Fair	One sided, large dead branch, lean
GW-1566	Unknown		14	1	N/A	N/A	Standing Dead	
GW-1567	Red maple	*Acer rubrum*	13	1	6.5	19.5	Fair	Basal cavity, lean in top of crown
GW-1568	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1569	Northern red oak	*Quercus rubra*	25	1	12.5	37.5	Good	
GW-1570	Northern red oak	*Quercus rubra*	12	1	6	18	Good	
GW-1571	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-1572	Red maple	*Acer rubrum*	29	1	14.5	43.5	Good	
GW-1573	American beech	*Fagus grandifolia*	29	1	14.5	43.5	Good	
GW-1574	Sugar maple	*Acer saccharum*	5	1	2.5	7.5	Fair	Scorched foliage, premature leaf loss
GW-1575	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1576	Tuliptree	*Liriodendron tulipifera*	27	1	13.5	40.5	Fair	Scorched foliage, premature leaf loss
GW-1577	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Fair	Scorched foliage, premature leaf loss
GW-1578	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-1579	Boxelder	*Acer negundo*	13	1	6.5	19.5	Fair	Many water sprouts, mostly healed trunk wound
GW-1580	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Good	
GW-1581	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Good	
GW-1582	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Water sprouts, trunk damage
GW-1583	Boxelder	*Acer negundo*	21	1	10.5	31.5	Good	Healed over basal wound
GW-1584	Sugar maple	*Acer saccharum*	10	1	5	15	Good	
GW-1585	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Water sprouts, thin crown
GW-1586	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Good	
GW-1587	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Healed over cavity at base, irregular crown
GW-1588	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Good	
GW-1589	Boxelder	*Acer negundo*	12	1	6	18	Poor	Trunk wound with decay, dead leader
GW-1590	American elm	*Ulmus americana*	6	1	3	9	Poor	Dead branches, dead crown
GW-1591	Tuliptree	*Liriodendron tulipifera*	28	1	14	42	Good	
GW-1592	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	
GW-1593	Boxelder	*Acer negundo*	12	1	6	18	Fair	Trunk wounds. Vines into crown. Lean. Unbalanced crown. Exposed roots
GW-1594	Sugar maple	*Acer saccharum*	13	1	6.5	19.5	Good	
GW-1595	Red maple	*Acer rubrum*	6	1	3	9	Fair	Thin crown, on slope with large fallen tree resting against trunk
GW-1596	Boxelder	*Acer negundo*	15, 4	2	7.5	22.5	Fair	Twin trunk 15 x 4. Exposed roots. Furrowed bark. Minor vines
GW-1597	Boxelder	*Acer negundo*	8	1	4	12	Poor	Significant lean, bark decay
GW-1598	Red maple	*Acer rubrum*	7	1	3.5	10.5	Good	
GW-1599	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Fair	Large trunk wound at base
GW-1600	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Small area of bark decay, thin crown
GW-1601	Boxelder	*Acer negundo*	11, 6	2	5.5	16.5	Poor	Twin trunk 11 x 6. Large stem removed. Remaining stems in poor condition. Dead branches. Severely exposes roots. Lean. Water sprouting.
GW-1602	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Vines in canopy, lean
GW-1603	Black locust	*Robinia pseudoacacia*	10	1	N/A	N/A	Standing Dead	
GW-1604	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Good	
GW-1605	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Good	
GW-1606	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Good	
GW-1607	Sugar maple	*Acer saccharum*	6	1	3	9	Fair	Vines in lower canopy
GW-1608	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	
GW-1609	White ash	*Fraxinus americana*	13	1	6.5	19.5	Poor	Dead crown
GW-1610	White ash	*Fraxinus americana*	12	1	6	18	Good	
GW-1611	Red maple	*Acer rubrum*	22	1	11	33	Fair	Vines on lower trunk
GW-1612	Unknown		12	1	N/A	N/A	Standing Dead	
GW-1613	American elm	*Ulmus americana*	5	1	2.5	7.5	Good	
GW-1614	Red maple	*Acer rubrum*	9	1	4.5	13.5	Poor	Heavy vines in canopy, overtopped
GW-1615	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Good	
GW-1616	White ash	*Fraxinus americana*	7	1	3.5	10.5	Poor	Heavy vines in canopy, overtopped
GW-1617	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
GW-1618	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Good	
GW-1619	Slippery elm	*Ulmus rubra*	20	1	10	30	Fair	Vines in lower trunk, lean
GW-1620	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Good	Slight bend in upper trunk
GW-1621	American beech	*Fagus grandifolia*	10	1	5	15	Good	

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-1622	Bitternut hickory	*Carya cordiformis*	17	1	8.5	25.5	Good	Thin crown
GW-1623	American beech	*Fagus grandifolia*	13	1	6.5	19.5	Fair	Fungus on trunk, buttress roots
GW-1624	American beech	*Fagus grandifolia*	22	1	11	33	Fair	Trunk decay at base
GW-1625	American beech	*Fagus grandifolia*	8	1	4	12	Good	
GW-1626	Mockernut hickory	*Carya tomentosa*	14	1	7	21	Fair	Vines in lower canopy
GW-1627	American beech	*Fagus grandifolia*	16	1	8	24	Good	One sided
GW-1628	White oak	*Quercus alba*	23	1	11.5	34.5	Good	Burl on lower trunk, thin crown
GW-1629	Red maple	*Acer rubrum*	9	1	4.5	13.5	Fair	Thin crown, irregular trunk
GW-1630*	White oak	*Quercus alba*	37	1	18.5	55.5	Poor	Leaves brown in canopy, many water sprouts, dead branches
GW-1631	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-1632	Bitternut hickory	*Carya cordiformis*	8	1	4	12	Good	
GW-1633	White oak	*Quercus alba*	28	1	14	42	Good	
GW-1634	Northern red oak	*Quercus rubra*	26	1	13	39	Good	Twin trunks fused until above DBH, slight lean
GW-1635	American beech	*Fagus grandifolia*	11	1	5.5	16.5	Good	
GW-1636	American beech	*Fagus grandifolia*	11	1	5.5	16.5	Fair	Dead second leader with some decay, crown looks good
GW-1637	Pin oak	*Quercus palustris*	17	1	8.5	25.5	Fair	Lean, dead branches, one sided
GW-1638	American beech	*Fagus grandifolia*	9	1	4.5	13.5	Good	
GW-1639	White oak	*Quercus alba*	27	1	13.5	40.5	Good	Vine on lower trunk
GW-1640	American beech	*Fagus grandifolia*	11	1	5.5	16.5	Good	
GW-1641	Red maple	*Acer rubrum*	14	1	7	21	Good	
GW-1642	Mockernut hickory	*Carya tomentosa*	28	1	14	42	Good	
GW-1643	American beech	*Fagus grandifolia*	8	1	4	12	Good	Healed over vine damage
GW-1644	Bitternut hickory	*Carya cordiformis*	8	1	4	12	Good	Thin crown
GW-1645	Mockernut hickory	*Carya tomentosa*	11	1	5.5	16.5	Good	
GW-1646	Mockernut hickory	*Carya tomentosa*	7	1	3.5	10.5	Fair	Very thin canopy, insect damage to
GW-1647	American basswood	*Tilia americana*	20, 18	2	10	30	Good	Lean. Twins 20 x 18
GW-1648	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Good	Thin crown
GW-1649	American beech	*Fagus grandifolia*	25	1	12.5	37.5	Good	
GW-1650	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Fair	Trunk wounds at base
GW-1651	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Good	Significant lean
GW-1652	American beech	*Fagus grandifolia*	6	1	3	9	Fair	Significant lean
GW-1653*	White oak	*Quercus alba*	32	1	16	48	Good	
GW-1654	Mockernut hickory	*Carya tomentosa*	26	1	13	39	Good	
GW-1655	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-1656	American basswood	*Tilia americana*	12	1	6	18	Good	
GW-1657	Northern red oak	*Quercus rubra*	9	1	4.5	13.5	Good	Slight lean
GW-1658	Red maple	*Acer rubrum*	11	1	5.5	16.5	Fair	Lean, broken branches, irregular crown
GW-1659	American beech	*Fagus grandifolia*	22	1	11	33	Good	
GW-1660	Unknown		11	1	N/A	N/A	Standing Dead	
GW-1661	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Very thin canopy, broken leader
GW-1662	Unknown		13	1	N/A	N/A	Standing Dead	
GW-1663	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Fair	Vines in lower branches, bend in trunk
GW-1664	Northern red oak	*Quercus rubra*	24	1	12	36	Fair	One sided, broken branches
GW-1665	American beech	*Fagus grandifolia*	22	1	11	33	Good	
GW-1666	American beech	*Fagus grandifolia*	9	1	4.5	13.5	Good	Healed over trunk wound
GW-1667	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	Healed trunk wound at base
GW-1668	American basswood	*Tilia americana*	7	1	3.5	10.5	Good	
GW-1669	Tree of heaven	*Ailanthus altissima*	7	1	3.5	10.5	Fair	Significant lean, thin crown
GW-1670	American beech	*Fagus grandifolia*	8	1	4	12	Good	
GW-1671	American elm	*Ulmus americana*	18	1	9	27	Fair	Vines in crown, lean, one sided
GW-1672	American basswood	*Tilia americana*	6	1	3	9	Fair	Irregular growth form, lean
GW-1673	Green ash	*Fraxinus pennsylvanica*	13	1	N/A	N/A	Standing Dead	
GW-1674	Bitternut hickory	*Carya cordiformis*	24	1	12	36	Good	
GW-1675*	Northern red oak	*Quercus rubra*	37	1	18.5	55.5	Good	Few large broken branches
GW-1676	Blackgum	*Nyssa sylvatica*	7	1	3.5	10.5	Good	Thin crown
GW-1677	Red maple	*Acer rubrum*	8	1	4	12	Good	Unbalanced crown
GW-1678	Red maple	*Acer rubrum*	6	1	3	9	Poor	Vines in crown, broken leader
GW-1679	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Vines in crown
GW-1680	Sugar maple	*Acer saccharum*	10, 4	2	5	15	Fair	Included bark, smaller trunk with lean. Twin trunks 10 x 4
GW-1681	Tuliptree	*Liriodendron tulipifera*	9	1	N/A	N/A	Standing Dead	
GW-1682	American basswood	*Tilia americana*	17	1	8.5	25.5	Fair	Split above DBH, slight lean
GW-1683	Tuliptree	*Liriodendron tulipifera*	9	1	N/A	N/A	Standing Dead	
GW-1684	White oak	*Quercus alba*	11, 3	2	5.5	16.5	Good	Twins 11 x 3
GW-1685	Hophornbeam	*Ostrya virginiana*	6	1	3	9	Fair	Significant lean, vines in crown
GW-1686	Red maple	*Acer rubrum*	24	1	12	36	Fair	Water sprouting. Trunk cavity. Trunk rot. Furrowed bark. Exposed roots
GW-1687	White oak	*Quercus alba*	25	1	12.5	37.5	Good	

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-1688	Red maple	*Acer rubrum*	8	1	4	12	Fair	Some vines in crown
GW-1689	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Trunk wound, crown overtopped by vines
GW-1690	American beech	*Fagus grandifolia*	10	1	5	15	Good	
GW-1691	Sugar maple	*Acer saccharum*	13	1	6.5	19.5	Good	
GW-1692	Bitternut hickory	*Carya cordiformis*	10	1	5	15	Good	Thin canopy
GW-1693	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Fair	One sided, lean
GW-1694	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Good	
GW-1695	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Fair	Bend in trunk, one sided, some broken branches
GW-1696	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Good	Slight lean
GW-1697	Red maple	*Acer rubrum*	6	1	3	9	Good	
GW-1698	American elm	*Ulmus americana*	6	1	3	9	Poor	Split leader, crown overtopped by vines
GW-1699	American beech	*Fagus grandifolia*	6	1	3	9	Fair	Vines on trunk into canopy
GW-1700	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Early loss of leaves, irregular crown
GW-1701	Unknown		28	1	N/A	N/A	Standing Dead	
GW-1702	Bitternut hickory	*Carya cordiformis*	10	1	5	15	Good	
GW-1703	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Fair	Bent trunk, vines into canopy, some water sprouts
GW-1704	White oak	*Quercus alba*	22	1	11	33	Fair	Lower canopy dieback. Dead lower limbs. Exposed roots
GW-1705	American beech	*Fagus grandifolia*	19	1	9.5	28.5	Good	Slightly one sided
GW-1706*	Tuliptree	*Liriodendron tulipifera*	41	1	20.5	61.5	Fair	Burl knots observed on trunk, moderate bend in leader, poor branching structure
GW-1707	Red maple	*Acer rubrum*	10	1	5	15	Fair	Vines in canopy
GW-1708	American holly	*Ilex opaca*	5	1	2.5	7.5	Fair	Vines in lower branches
GW-1709	American beech	*Fagus grandifolia*	23	1	11.5	34.5	Good	
GW-1710	Boxelder	*Acer negundo*	9	1	4.5	13.5	Poor	Canopy overtopped by vines
GW-1711	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Good	
GW-1712	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Leaning, poor branching structure
GW-1713	White oak	*Quercus alba*	26	1	13	39	Fair	Lower canopy dieback. Dead lower limbs. Exposed roots
GW-1714	White oak	*Quercus alba*	6	1	3	9	Fair	Oriental bittersweet vine entering crown, thin crown
GW-1715	Boxelder	*Acer negundo*	6	1	3	9	Fair	Oriental bittersweet into crown
GW-1716	Boxelder	*Acer negundo*	18	1	9	27	Good	Lots of water sprouts at base, exposed roots on slope
GW-1717	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Fair	Vines into crown
GW-1718*	Tuliptree	*Liriodendron tulipifera*	41	1	20.5	61.5	Poor	Large branch dieback in crown, piece of remaining large branch is rotting, moderate bend in leader, sapsucker holes observed at base of trunk
GW-1719	Boxelder	*Acer negundo*	14	1	7	21	Fair	Wound with some decay
GW-1720	Northern red oak	*Quercus rubra*	8	1	4	12	Good	Thin crown
GW-1721	American sycamore	*Platanus occidentalis*	15	1	7.5	22.5	Good	
GW-1722	Boxelder	*Acer negundo*	6	1	3	9	Poor	Overtopped by vines, water sprouts
GW-1723	Red maple	*Acer rubrum*	, 15, 13, 9	4	9	27	Fair	Multistem 18 x 15 x 13 x 9. Furrowed bark. Exposed roots. Dead lower limbs. Printed branches.
GW-1724	American beech	*Fagus grandifolia*	9	1	4.5	13.5	Good	
GW-1725	Northern red oak	*Quercus rubra*	19	1	9.5	28.5	Good	
GW-1726	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Fair	Fair/poor, heavy vines into crown
GW-1727	Tuliptree	*Liriodendron tulipifera*	28	1	N/A	N/A	Standing Dead	
GW-1728	Green ash	*Fraxinus pennsylvanica*	5	1	2.5	7.5	Poor	Lean, heavy vines in canopy
GW-1729*	Tuliptree	*Liriodendron tulipifera*	30	1	15	45	Good	
GW-1730	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Good	
GW-1731	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Fair	Vines on trunk and in canopy
GW-1732	Tuliptree	*Liriodendron tulipifera*	8	1	N/A	N/A	Standing Dead	
GW-1733	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Fair	Minor cavity on trunk starting to rot , branch dieback in crown
GW-1734	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Poor	Overtopped by vines
GW-1735	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Good	
GW-1736	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Good	
GW-1737	Unknown		9	1	N/A	N/A	Standing Dead	
GW-1738	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Poor	Heavy vines into crown, thin crown
GW-1739	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Fair	Vines on trunk going into canopy
GW-1740	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Fair	Large vine on trunk into canopy
GW-1741	Red maple	*Acer rubrum*	23	1	N/A	N/A	Standing Dead	Dead
GW-1742	Tuliptree	*Liriodendron tulipifera*	27	1	13.5	40.5	Fair	Trunk wound, small cavity at base, vine on trunk
GW-1743	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-1744	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Fair	Heavy vines into crown

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-1745	Red maple	*Acer rubrum*	6	1	3	9	Good	Poor branching structure
GW-1746	Red maple	*Acer rubrum*	8	1	4	12	Good	
GW-1747	American holly	*Ilex opaca*	9	1	4.5	13.5	Poor	Significant lean, many water sprouts
GW-1748	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Good	Oriental bittersweet vines at base, not yet in crown
GW-1749	Red maple	*Acer rubrum*	14	1	7	21	Fair	Water sprouting. Unbalance crown. Branch dieback in canopy. Exposed
GW-1750	Black walnut	*Juglans nigra*	18	1	9	27	Fair	Thin crown, adjacent tree growing into canopy, exposed roots on slope
GW-1751	White oak	*Quercus alba*	21	1	10.5	31.5	Fair	Vines in crown
GW-1752	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Moderate bend in leader, vines into
GW-1753	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	Slight lean
GW-1754	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Fair	Trunk wounds, slight lean
GW-1755	White oak	*Quercus alba*	21	1	10.5	31.5	Good	Minor lower branch dieback
GW-1756	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Fair	Vines in canopy, bend in trunk
GW-1757	Tuliptree	*Liriodendron tulipifera*	22	1	N/A	N/A	Standing Dead	
GW-1758	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Leaning, poor branching structure
GW-1759	Mockernut hickory	*Carya tomentosa*	13	1	6.5	19.5	Good	Thin crown
GW-1760	American sycamore	*Platanus occidentalis*	13	1	6.5	19.5	Fair	Heavy vines into crown, thin crown
GW-1761	Boxelder	*Acer negundo*	8	1	4	12	Poor	Lean, heavy vines, water sprouts
GW-1762	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-1763	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Fair	Heavy vines in crown, leaning
GW-1764	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Good	
GW-1765	Tuliptree	*Liriodendron tulipifera*	6	1	3	9	Good	
GW-1766	American beech	*Fagus grandifolia*	9	1	4.5	13.5	Fair	Twin trunks in crown, oriental bittersweet vines into crown
GW-1767	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Fair	Lean, trunk wound, split leader
GW-1768	Boxelder	*Acer negundo*	19	1	9.5	28.5	Fair	Water sprouts, vines in canopy
GW-1769	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Fair	Some vines going into crown
GW-1770	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Fair	Vines on trunk into crown
GW-1771	Mockernut hickory	*Carya tomentosa*	25	1	12.5	37.5	Good	
GW-1772	American sycamore	*Platanus occidentalis*	29	1	14.5	43.5	Good	Slight lean
GW-1773	American beech	*Fagus grandifolia*	11	1	5.5	16.5	Poor	Lean, heavy vines, thin crown
GW-1774	American sycamore	*Platanus occidentalis*	11	1	5.5	16.5	Fair	Thin crown, adjacent trees growing into crown, vines into crown
GW-1775	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Good	Minor branch dieback in crown, exposed roots on slope
GW-1776	American sycamore	*Platanus occidentalis*	12	1	6	18	Fair	Thin crown, adjacent tree growing into canopy, vines into crown
GW-1777	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-1778	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	
GW-1779	American beech	*Fagus grandifolia*	9	1	4.5	13.5	Good	
GW-1780	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-1781	Tuliptree	*Liriodendron tulipifera*	24, 9	2	12	36	Fair	Poor branching structure, twins 24 x 9
GW-1782*	Tuliptree	*Liriodendron tulipifera*	35	1	17.5	52.5	Fair	Insect holes/damage, lean in canopy
GW-1783	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Good	Bend in trunk
GW-1784	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Fair	Moderate bend in leader
GW-1785	American sycamore	*Platanus occidentalis*	10	1	5	15	Good	
GW-1786	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Fair	Moderate bend in leader
GW-1787	American sycamore	*Platanus occidentalis*	12	1	6	18	Good	
GW-1788	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-1789	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	Thin crown
GW-1790	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Good	
GW-1791	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	Thin crown
GW-1792	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Fair	Thin crown, large vine into crown
GW-1793	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Good	
GW-1794	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	Exposed roots on slope
GW-1795	Boxelder	*Acer negundo*	17	1	8.5	25.5	Fair	Leaning, low branch dieback, poor branching structure
GW-1796	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1797	Tree of heaven	*Ailanthus altissima*	18	1	9	27	Fair	Thin crown, exposed roots on slope, adjacent tree growing into canopy
GW-1798	American sycamore	*Platanus occidentalis*	11	1	5.5	16.5	Fair	Vines into crown, thin, unbalanced crown
GW-1799	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Good	
GW-1800	Red maple	*Acer rubrum*	6	1	3	9	Poor	Large cavity on trunk is rotting, unbalanced crown
GW-1801	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Good	
GW-1802	Red maple	*Acer rubrum*	5	1	2.5	7.5	Good	
GW-1803	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	
GW-1804	Boxelder	*Acer negundo*	14	1	7	21	Fair	Leaning, poor branching structure in crown
GW-1805	American sycamore	*Platanus occidentalis*	17	1	8.5	25.5	Fair	Poison ivy and oriental bittersweet vines into crown, severe lean
GW-1806	Boxelder	*Acer negundo*	8	1	4	12	Poor	Many water sprouts, lean
GW-1807	Boxelder	*Acer negundo*	8	1	4	12	Fair	Leaning, lots of water sprouts along trunk
GW-1808	White oak	*Quercus alba*	8	1	4	12	Fair	Dead branches, overtopped by neighboring trees
GW-1809	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Good	Thin crown, on slope
GW-1810	Boxelder	*Acer negundo*	10	1	5	15	Fair	Low branch dieback in crown
GW-1811	American sycamore	*Platanus occidentalis*	28	1	14	42	Fair	Minor Virginia creeper vine into crown, unbalanced crown
GW-1812	Boxelder	*Acer negundo*	12	1	6	18	Good	Thin crown
GW-1813	Boxelder	*Acer negundo*	14	1	7	21	Fair	Trunk wound, water sprouts
GW-1814	American beech	*Fagus grandifolia*	11	1	5.5	16.5	Good	
GW-1815	Black walnut	*Juglans nigra*	7	1	3.5	10.5	Good	Thin crown
GW-1816	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Good	
GW-1817	Blackgum	*Nyssa sylvatica*	21	1	10.5	31.5	Good	Minor vines not into canopy, few rotten branches in lower canopy
GW-1818	American beech	*Fagus grandifolia*	24	1	12	36	Fair	Moderate vibes into crown
GW-1819	Unknown		28	1	N/A	N/A	Standing Dead	
GW-1820	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Good	
GW-1821	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1822	American beech	*Fagus grandifolia*	12	1	6	18	Good	
GW-1823	Norway maple	*Acer platanoides*	6	1	3	9	Good	
GW-1824	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Fair	Moderate bend in leader
GW-1825	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Fair	Bend in leader, leaning
GW-1826	American sycamore	*Platanus occidentalis*	23	1	11.5	34.5	Fair	Thin crown, grape vine entering crown, on roadway embankment
GW-1827	American elm	*Ulmus americana*	6	1	3	9	Fair	Broken leader
GW-1828	Boxelder	*Acer negundo*	19	1	9.5	28.5	Fair	Healed trunk wounds, slight lean, water sprouts
GW-1829	American beech	*Fagus grandifolia*	29	1	14.5	43.5	Good	Minor vines on trunk not into canopy, slight bend in leader
GW-1830	American beech	*Fagus grandifolia*	24	1	12	36	Good	
GW-1831	Northern red oak	*Quercus rubra*	14	1	7	21	Good	Slight lean, lacks lower canopy
GW-1832	Boxelder	*Acer negundo*	13	1	6.5	19.5	Fair	Water sprouts, one sided
GW-1833	American beech	*Fagus grandifolia*	13	1	6.5	19.5	Good	
GW-1834	American basswood	*Tilia americana*	29, 5	2	14.5	43.5	Poor	Twin trunks 29 x 5, main stem in very poor condition topped leader, hollow trunk, second stem leaning in fair condition
GW-1835	Mockernut hickory	*Carya tomentosa*	5	1	2.5	7.5	Fair	Vines into crown, 2' cavity on trunk healing
GW-1836	Boxelder	*Acer negundo*	13	1	6.5	19.5	Fair	Water sprouts, dead branch, some small trunk wounds
GW-1837	Slippery elm	*Ulmus rubra*	8	1	4	12	Fair	Severe lean, thin crown
GW-1838	Northern red oak	*Quercus rubra*	24	1	12	36	Fair	Leaning towards road, exposed roots on slope, twin trunks in crown
GW-1839	Black locust	*Robinia pseudoacacia*	22	1	11	33	Poor	Bark decay, very thin crown
GW-1840	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Fair	Poor branching structure in crown
GW-1841	Northern red oak	*Quercus rubra*	9	1	4.5	13.5	Fair	Branch and leaf dieback in crown
GW-1842	American beech	*Fagus grandifolia*	26	1	13	39	Good	Cracks and cavities on trunk healing
GW-1843	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-1844	Mockernut hickory	*Carya tomentosa*	23	1	11.5	34.5	Fair	Vines into crown, thin canopy
GW-1845*	American beech	*Fagus grandifolia*	32	1	16	48	Good	
GW-1846	American beech	*Fagus grandifolia*	15	1	7.5	22.5	Good	Thin crown
GW-1847	Eastern redbud	*Cercis canadensis*	6, 5, 3	3	3	9	Fair	Multistem 6 x 5 x 3. Slight lean, low branch dieback, furrowed bark, cavities on trunk healing.
GW-1848*	American beech	*Fagus grandifolia*	31	1	15.5	46.5	Fair	Thin, unbalanced crown, exposed roots on slope
GW-1849	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	
GW-1850	Red maple	*Acer rubrum*	28	1	14	42	Fair	Trunk wound, large dead branches
GW-1851*	American beech	*Fagus grandifolia*	34	1	17	51	Good	
GW-1852	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-1853	Tuliptree	*Liriodendron tulipifera*	7	1	3.5	10.5	Fair	Lean, thin canopy, one sided
GW-1854	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-1855	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Good	Slight bend in trunk
GW-1856	American beech	*Fagus grandifolia*	17	1	8.5	25.5	Fair	3.5' long crack on trunk healing, exposed roots on slope
GW-1857*	American beech	*Fagus grandifolia*	31, 7	2	15.5	46.5	Fair	Twin trunks 31 x 7, minor cavity at base healing, poor branching structure

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-1858	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	Exposed roots on slope
GW-1859	American beech	*Fagus grandifolia*	24	1	12	36	Fair	Exposed roots on slope, cavity on trunk healing, low branch dieback
GW-1860	Slippery elm	*Ulmus rubra*	13	1	6.5	19.5	Fair	Leaning towards road
GW-1861	Red maple	*Acer rubrum*	, 10, 10, 5	4	6.5	19.5	Fair	Multistem 13 x 10 x 10 x 5, broken lower branch, bark rot on trunk, exposed roots, furrowed bark,
GW-1862	Boxelder	*Acer negundo*	8	1	4	12	Fair	Water sprouts, dead wood, bend in trunk
GW-1863	Boxelder	*Acer negundo*	20, 5	2	10	30	Fair	Significant lean, water sprouts. Twins 20 x 5
GW-1864	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	Thin crown
GW-1865*	American sycamore	*Platanus occidentalis*	35	1	17.5	52.5	Poor	Many water sprouts, significant lean, thin crown, vines in crown
GW-1866	Red maple	*Acer rubrum*	29	1	14.5	43.5	Good	Cavity at base of trunk healing, twin trunks above DBH, minor branch dieback in lower canopy
GW-1867	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Poor	Large trunk wound, lean
GW-1868	Boxelder	*Acer negundo*	20	1	10	30	Fair	Lean, many water sprouts
GW-1869	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Good	Slightly one sided
GW-1870	Mockernut hickory	*Carya tomentosa*	13	1	6.5	19.5	Good	
GW-1871	Slippery elm	*Ulmus rubra*	21	1	10.5	31.5	Good	Some exposed roots
GW-1872	White ash	*Fraxinus americana*	10	1	5	15	Good	
GW-1873	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	
GW-1874	Tuliptree	*Liriodendron tulipifera*	10	1	5	15	Fair	Water sprouts, thin crown
GW-1875	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Thin crown, overtopped by canopy, small trunk wound
GW-1876	Sugar maple	*Acer saccharum*	16	1	8	24	Good	Slight lean
GW-1877	American elm	*Ulmus americana*	5	1	2.5	7.5	Poor	Dead wood in crown, heavy branch dieback in crown
GW-1878	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Good	
GW-1879	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	
GW-1880	Red maple	*Acer rubrum*	17	1	8.5	25.5	Good	Some water sprouts
GW-1881	White ash	*Fraxinus americana*	12	1	6	18	Good	
GW-1882	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	Healed over trunk wound
GW-1883	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	Healed over trunk wound, thin canopy
GW-1884	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Good	
GW-1885	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	Thin crown
GW-1886	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	Thin crown
GW-1887	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Good	
GW-1888	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Many water sprouts, significant lean
GW-1889	Tuliptree	*Liriodendron tulipifera*	12	1	6	18	Good	
GW-1890	Tuliptree	*Liriodendron tulipifera*	7	1	3.5	10.5	Good	Thin crown, slight bend in leader
GW-1891	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Good	
GW-1892	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Fair	Thin crown, minor cavity on trunk healing
GW-1893	Sugar maple	*Acer saccharum*	5	1	2.5	7.5	Good	Slight bend in trunk
GW-1894	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Bend in crown
GW-1895	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Good	
GW-1896	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Good	
GW-1897	Tuliptree	*Liriodendron tulipifera*	7	1	3.5	10.5	Fair	Thin canopy
GW-1898	Black walnut	*Juglans nigra*	12	1	6	18	Good	Thin crown
GW-1899	Tuliptree	*Liriodendron tulipifera*	14	1	7	21	Good	
GW-1900	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Bend in leader, small cavities in crown and wounds on trunk are healing
GW-1901	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Fair	Bend in leader, exposed roots on slope
GW-1902	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Good	Leaning, on slope
GW-1903	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Good	Thin crown
GW-1904	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Good	
GW-1905	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Water sprouts, few trunk wounds
GW-1906	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	
GW-1907	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Fair	Thin crown, exposed roots on slope
GW-1908	Tuliptree	*Liriodendron tulipifera*	22, 19	2	11	33	Good	Twins 22 x 19
GW-1909	Red maple	*Acer rubrum*	6	1	3	9	Good	On slope
GW-1910	Tuliptree	*Liriodendron tulipifera*	8	1	4	12	Fair	Bend in leader, thin crown
GW-1911	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
GW-1912*	Northern red oak	*Quercus rubra*	43	1	21.5	64.5	Good	Minor low branch dieback, observed mushrooms around roots
GW-1913	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Good	
GW-1914	White oak	*Quercus alba*	8	1	4	12	Good	Low branch dieback
GW-1915	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Good	Thin crown, exposed roots on slope
GW-1916	Red maple	*Acer rubrum*	9	1	4.5	13.5	Good	
GW-1917	Red maple	*Acer rubrum*	6	1	3	9	Fair	Poor branching structure in crown

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-1918	White oak	*Quercus alba*	13	1	6.5	19.5	Good	Low branch dieback
GW-1919	Slippery elm	*Ulmus rubra*	19	1	9.5	28.5	Good	
GW-1920	Boxelder	*Acer negundo*	6	1	3	9	Fair	Many water sprouts, thin crown, irregular growth form
GW-1921	Slippery elm	*Ulmus rubra*	7	1	3.5	10.5	Fair	Some dead branches, one sided
GW-1922	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	
GW-1923	Red maple	*Acer rubrum*	16	1	8	24	Good	Some branch damage
GW-1924	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	Slightly unbalanced crown
GW-1925	American beech	*Fagus grandifolia*	28	1	14	42	Fair	Branches rotting in crown, mushrooms observed around roots, girdling roots, cavities on trunk healing
GW-1926	Boxelder	*Acer negundo*	10	1	5	15	Fair	Many water sprouts, one sided
GW-1927	Sugar maple	*Acer saccharum*	6	1	3	9	Good	
GW-1928	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	Thin, slightly unbalanced crown
GW-1929*	American beech	*Fagus grandifolia*	32	1	16	48	Fair	Twin trunks above DBH, large trunk wound at base due to car collision wound is rotting, rotting branches in crown
GW-1930	American elm	*Ulmus americana*	5	1	2.5	7.5	Fair	Thin crown, one sided
GW-1931	American elm	*Ulmus americana*	5	1	2.5	7.5	Good	
GW-1932	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Good	Thin crown
GW-1933	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Good	
GW-1934	American elm	*Ulmus americana*	5	1	2.5	7.5	Poor	Significant lean, many water sprouts
GW-1935	Northern red oak	*Quercus rubra*	29	1	14.5	43.5	Fair	Pruning and branch dieback in lower canopy, large trunk wound at base rotting
GW-1935	Black locust	*Robinia pseudoacacia*	8	1	N/A	N/A	Standing Dead	
GW-1936	Slippery elm	*Ulmus rubra*	10	1	5	15	Good	
GW-1937	Tuliptree	*Liriodendron tulipifera*	11	1	5.5	16.5	Fair	Bend in leader, thin crown, on slope
GW-1938	American elm	*Ulmus americana*	9	1	4.5	13.5	Fair	Large branch dieback in crown
GW-1939	Tuliptree	*Liriodendron tulipifera*	29	1	14.5	43.5	Fair	Moderate bend in leader, thin crown
GW-1940	Tuliptree	*Liriodendron tulipifera*	9	1	4.5	13.5	Fair	Thin, unbalanced crown
GW-1941	Northern red oak	*Quercus rubra*	29	1	14.5	43.5	Good	Minor branch dieback in lower canopy
GW-1942*	Tuliptree	*Liriodendron tulipifera*	34	1	17	51	Good	Thin crown, adjacent tree branches entering crown
GW-1943	Boxelder	*Acer negundo*	5	1	2.5	7.5	Poor	Trunk wounds, many water sprouts
GW-1944*	Tuliptree	*Liriodendron tulipifera*	31	1	15.5	46.5	Good	Thin crown
GW-1945	Boxelder	*Acer negundo*	14	1	7	21	Good	Slight bend in trunk, few water sprouts
GW-1946	Boxelder	*Acer negundo*	13	1	6.5	19.5	Fair	Water sprouts, lean , broken branches
GW-1947*	American beech	*Fagus grandifolia*	30	1	15	45	Fair	Galls on trunk, branch dieback in lower canopy, 2' long wound on trunk healing
GW-1948	Boxelder	*Acer negundo*	13	1	6.5	19.5	Fair	Water sprouts, thin crown
GW-1949	Slippery elm	*Ulmus rubra*	7	1	3.5	10.5	Fair	Lean, small trunk wound, one sided
GW-1950	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Good	
GW-1951	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Fair	Bark damage, foliage appears drought stressed
GW-1952	Sugar maple	*Acer saccharum*	6	1	3	9	Fair	Thin crown, dead wood
GW-1953	American beech	*Fagus grandifolia*	19	1	9.5	28.5	Good	Exposed roots on slope
GW-1954	Slippery elm	*Ulmus rubra*	12	1	6	18	Fair	Lean, thin crown, dying leaves, broken leader
GW-1955*	Northern red oak	*Quercus rubra*	31	1	15.5	46.5	Fair	Low branch dieback, large cavity at base of trunk starting to rot, rotting bark on large branches in crown, little canopy remains
GW-1956	Slippery elm	*Ulmus rubra*	8	1	4	12	Fair	Lean, thin crown
GW-1957	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Good	
GW-1958	Slippery elm	*Ulmus rubra*	8	1	4	12	Fair	Lean
GW-1959	American beech	*Fagus grandifolia*	17	1	8.5	25.5	Good	
GW-1960	American beech	*Fagus grandifolia*	20	1	10	30	Fair	Rotting branches in lower canopy, 4' long crack on trunk healing
GW-1961	Boxelder	*Acer negundo*	12	1	6	18	Fair	Dead branches, water sprouts
GW-1962	American beech	*Fagus grandifolia*	16	1	8	24	Good	Buttress roots on slope
GW-1963	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1964	American beech	*Fagus grandifolia*	24	1	12	36	Good	Minor bend in leader
GW-1965	Red maple	*Acer rubrum*	24	1	12	36	Fair	Leaning towards road, minor trunk wound at base
GW-1966	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-1967*	Northern red oak	*Quercus rubra*	37	1	18.5	55.5	Fair	Minor low branch dieback, large trunk wound due to car collision wound is starting to rot
GW-1968	Pignut hickory	*Carya glabra*	25	1	12.5	37.5	Fair	Thin crown, buttressed roots on slope
GW-1969	Mockernut hickory	*Carya tomentosa*	18	1	9	27	Fair	Large broken branch
GW-1970	American beech	*Fagus grandifolia*	18	1	9	27	Good	Buttressed roots on slope

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-1971	Unknown		22	1	N/A	N/A	Standing Dead	
GW-1972	Bitternut hickory	*Carya cordiformis*	21	1	10.5	31.5	Good	Some buttress roots
GW-1973	American beech	*Fagus grandifolia*	8	1	4	12	Good	
GW-1974	Bitternut hickory	*Carya cordiformis*	8	1	4	12	Good	
GW-1975	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1976	Sugar maple	*Acer saccharum*	5	1	2.5	7.5	Good	
GW-1977	American beech	*Fagus grandifolia*	21	1	10.5	31.5	Good	Buttressed roots on slope
GW-1978	Unknown		13	1	N/A	N/A	Standing Dead	
GW-1979	Bitternut hickory	*Carya cordiformis*	23	1	11.5	34.5	Good	Small wound at base
GW-1980	American beech	*Fagus grandifolia*	24	1	12	36	Fair	Leaning towards road on embankment, cavity on trunk is healing, large branch dieback in crown
GW-1981	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-1982*	White oak	*Quercus alba*	43	1	21.5	64.5	Fair	Leaning, large branch dieback in crown
GW-1983*	Northern red oak	*Quercus rubra*	33	1	16.5	49.5	Good	Unbalanced crown
GW-1984	Sugar maple	*Acer saccharum*	9	1	4.5	13.5	Good	Twin trunks above DBH, slight lean, water sprouts on trunk
GW-1985	American beech	*Fagus grandifolia*	22	1	11	33	Good	Slightly exposed roots
GW-1986	American holly	*Ilex opaca*	8	1	4	12	Good	
GW-1987	Black walnut	*Juglans nigra*	16	1	8	24	Fair	Moderate bend in leader, thin crown
GW-1988	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	Small wound at base
GW-1989	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	Irregular trunk
GW-1990	Blackgum	*Nyssa sylvatica*	17	1	8.5	25.5	Good	Irregular trunk
GW-1991	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-1992	Tuliptree	*Liriodendron tulipifera*	16	1	8	24	Fair	Thin crown, adjacent tree branches entering canopy
GW-1993	American beech	*Fagus grandifolia*	25, 11	2	12.5	37.5	Fair	Twin trunks 25 x 11. Both stems are leaning in opposite directions towards road, exposed roots, minor branch dieback in crown, minor areas with furrowed bark.
GW-1994	American beech	*Fagus grandifolia*	6	1	3	9	Fair	Slight lean, dead second leader
GW-1995	Sugar maple	*Acer saccharum*	6	1	3	9	Fair	Thin crown, minor branch dieback in crown
GW-1996	Sassafras	*Sassafras albidum*	10	1	5	15	Fair	Very thin crown
GW-1997	Sugar maple	*Acer saccharum*	9	1	4.5	13.5	Fair	Bend in leader, exposed roots on roadway embankment
GW-1998	Red maple	*Acer rubrum*	23	1	11.5	34.5	Good	
GW-1999	American elm	*Ulmus americana*	9	1	4.5	13.5	Good	Slight bend in leader
GW-2000	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-2001	Sugar maple	*Acer saccharum*	16	1	8	24	Good	Unbalanced crown
GW-2002	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Good	
GW-2003*	American beech	*Fagus grandifolia*	30	1	15	45	Good	Minor cavities on trunk healing
GW-2004	Slippery elm	*Ulmus rubra*	9	1	4.5	13.5	Fair	Leaning, bend in leader, exposed roots on slope
GW-2005	Sugar maple	*Acer saccharum*	12	1	6	18	Fair	Unbalanced crown, exposed roots on roadway embankment
GW-2006	Red maple	*Acer rubrum*	17	1	8.5	25.5	Good	
GW-2007	Red maple	*Acer rubrum*	6	1	3	9	Good	Split leader
GW-2008	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-2009	Mockernut hickory	*Carya tomentosa*	13	1	6.5	19.5	Poor	Broken leader, dead branches
GW-2010	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Fair	One sided, interfering crowns
GW-2011	Tree of heaven	*Ailanthus altissima*	20	1	10	30	Good	
GW-2012	Red maple	*Acer rubrum*	8, 3	2	4	12	Fair	Twin trunks 8 x 3, bend in leader, thin crown
GW-2013	Tree of heaven	*Ailanthus altissima*	8	1	4	12	Poor	Dead crown, bark coming off
GW-2014	Norway maple	*Acer platanoides*	17	1	8.5	25.5	Fair	Fused at base with adjacent trees, lean. Splits above DBH
GW-2015	Black locust	*Robinia pseudoacacia*	9	1	4.5	13.5	Poor	Fused at base with adjacent trees, bark decaying
GW-2016	Tree of heaven	*Ailanthus altissima*	7	1	3.5	10.5	Fair	Irregular trunk
GW-2017	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Thin crown, overtopped canopy
GW-2018	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-2019	Mockernut hickory	*Carya tomentosa*	6	1	3	9	Good	There may be a duplicate of this elsewhere, this is the correct point
GW-2020	Unknown		24	1	N/A	N/A	Standing Dead	
GW-2021	Black locust	*Robinia pseudoacacia*	6	1	3	9	Poor	Severe lean, rotting branches in crown
GW-2022	American beech	*Fagus grandifolia*	6	1	3	9	Fair	Irregular growth form, large tree leaning on it
GW-2023	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Water sprouts, irregular growth form, thin crown

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-2024	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-2025	Mockernut hickory	*Carya tomentosa*	8	1	4	12	Fair	Drought stressed, damaged leader
GW-2026	Mockernut hickory	*Carya tomentosa*	21	1	10.5	31.5	Good	
GW-2027	Tree of heaven	*Ailanthus altissima*	5	1	2.5	7.5	Good	
GW-2028	Slippery elm	*Ulmus rubra*	13	1	6.5	19.5	Good	Vine on trunk
GW-2029	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Water sprouts, irregular growth form
GW-2030	Common hackberry	*Celtis occidentalis*	10	1	5	15	Good	Leaning towards road
GW-2031	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Fair	Minor branch dieback in crown, poor branching structure, exposed roots on slope
GW-2032	Boxelder	*Acer negundo*	6	1	3	9	Poor	Broken leader, water sprouts
GW-2033	Black locust	*Robinia pseudoacacia*	12	1	6	18	Fair	Thin crown
GW-2034	Black walnut	*Juglans nigra*	7	1	3.5	10.5	Good	
GW-2035	Sugar maple	*Acer saccharum*	11	1	5.5	16.5	Fair	On roadway embankment, exposed roots on slope, minor cavities and bark damage observed on large branches
GW-2036	Sugar maple	*Acer saccharum*	8	1	4	12	Good	Unbalanced crown
GW-2037	Sugar maple	*Acer saccharum*	8	1	4	12	Good	
GW-2038	Black walnut	*Juglans nigra*	6	1	3	9	Good	Bend in trunk
GW-2039	Sugar maple	*Acer saccharum*	6	1	3	9	Good	
GW-2040	Hickory sp.	*Carya sp.*	21	1	N/A	N/A	Standing Dead	
GW-2041	Tree of heaven	*Ailanthus altissima*	5	1	2.5	7.5	Good	
GW-2042	Sugar maple	*Acer saccharum*	13	1	6.5	19.5	Fair	One sided, growing into adjacent tree
GW-2043	Tree of heaven	*Ailanthus altissima*	16	1	8	24	Good	
GW-2044	American beech	*Fagus grandifolia*	8	1	4	12	Good	
GW-2045	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-2046	White ash	*Fraxinus americana*	11	1	5.5	16.5	Good	
GW-2047	Sugar maple	*Acer saccharum*	10	1	5	15	Good	
GW-2048	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Heavy lean, irregular growth form
GW-2049	Slippery elm	*Ulmus rubra*	12	1	6	18	Good	Slight bend in trunk
GW-2050	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Fair	Poor branching structure, bend in leader
GW-2051	Unknown		12	1	N/A	N/A	Standing Dead	
GW-2052	Common hackberry	*Celtis occidentalis*	11	1	5.5	16.5	Fair	Severe bend in leader, leaning towards road
GW-2053	Slippery elm	*Ulmus rubra*	10	1	5	15	Fair	Thin crown, leaning towards road, on roadway embankment
GW-2054	Sugar maple	*Acer saccharum*	10	1	5	15	Good	One sided
GW-2055	American beech	*Fagus grandifolia*	26	1	13	39	Good	Exposed roots on roadway embankment
GW-2056	American beech	*Fagus grandifolia*	23	1	11.5	34.5	Good	Large grape vine on trunk
GW-2057	Sugar maple	*Acer saccharum*	6	1	3	9	Good	
GW-2058	Slippery elm	*Ulmus rubra*	15	1	7.5	22.5	Poor	Leaning, thin crown, heavy poison ivy vines into crown
GW-2059	Sugar maple	*Acer saccharum*	6	1	3	9	Fair	Large visit vine into crown
GW-2060	Slippery elm	*Ulmus rubra*	15	1	7.5	22.5	Fair	Poor branching structure, exposed roots on slope
GW-2061	Slippery elm	*Ulmus rubra*	7	1	3.5	10.5	Fair	Large poison ivy vines into crown
GW-2062	American beech	*Fagus grandifolia*	13	1	6.5	19.5	Good	
GW-2063	American beech	*Fagus grandifolia*	19	1	9.5	28.5	Good	
GW-2064	Boxelder	*Acer negundo*	16	1	8	24	Fair	Leaning, bend in leader, dead water sprouts
GW-2065	Red maple	*Acer rubrum*	14	1	7	21	Fair	Leaning, poor branching structure, exposed roots on slope, branch dieback in crown, visit sp vine into crown
GW-2066*	American beech	*Fagus grandifolia*	37	1	18.5	55.5	Fair	Slight lean, cracks on trunk, cavity at base of trunk healing, bulging and exposed roots showing signs of decay (mushrooms growing around roots)
GW-2067	Boxelder	*Acer negundo*	10	1	5	15	Fair	Leaning, poor branching structure
GW-2068	Slippery elm	*Ulmus rubra*	20	1	10	30	Good	
GW-2069	Norway maple	*Acer platanoides*	12	1	6	18	Good	Trunk splits above DBH
GW-2070	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	One sided, water sprouts
GW-2071	Tuliptree	*Liriodendron tulipifera*	20	1	10	30	Good	
GW-2072	American elm	*Ulmus americana*	17	1	8.5	25.5	Good	Some dead wood
GW-2073	Boxelder	*Acer negundo*	5	1	2.5	7.5	Fair	Thin crown, water sprouts
GW-2074	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Good	Slight lean, exposed roots on slope
GW-2075	Slippery elm	*Ulmus rubra*	13	1	6.5	19.5	Fair	Lean, one sided
GW-2076	Black locust	*Robinia pseudoacacia*	13	1	6.5	19.5	Fair	Heavy vines into crown, large trunk wound at base 3.5' long rotting
GW-2077	Boxelder	*Acer negundo*	22	1	11	33	Good	
GW-2078	Tuliptree	*Liriodendron tulipifera*	21	1	10.5	31.5	Fair	Bend in leader, poor branching structure, exposed roots on slope

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-2079	Northern red oak	*Quercus rubra*	11	1	5.5	16.5	Good	Slight lean
GW-2080	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Bend in leader, exposed roots on slope, thin crown
GW-2081	Sugar maple	*Acer saccharum*	11	1	5.5	16.5	Good	Some water sprouts on trunk
GW-2082	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Fair	Premature leaf drop, lean
GW-2083	Boxelder	*Acer negundo*	16	1	N/A	N/A	Standing Dead	
GW-2084	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Good	A little one sided
GW-2085	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-2086	Unknown		6	1	N/A	N/A	Standing Dead	
GW-2087	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	One sided, water sprouts
GW-2088	Boxelder	*Acer negundo*	6	1	3	9	Fair	Many water sprouts, thin canopy
GW-2089	Tuliptree	*Liriodendron tulipifera*	13	1	6.5	19.5	Fair	Thin crown, branch dieback in crown, poor branching structure
GW-2090	Sugar maple	*Acer saccharum*	12	1	6	18	Good	
GW-2091	Tuliptree	*Liriodendron tulipifera*	27	1	13.5	40.5	Good	Bend in leader, minor sapsucker holes at base
GW-2092	Sugar maple	*Acer saccharum*	7	1	N/A	N/A	Standing Dead	
GW-2093	Black locust	*Robinia pseudoacacia*	24, 18, 12	3	12	36	Fair	Multistem 24 x 18 x 12, heavy branch dieback in crown, heavy pruning and dieback in lower canopy
GW-2094*	Tuliptree	*Liriodendron tulipifera*	42	1	21	63	Good	Minor sapsucker holes observed at base, exposed roots on slope
GW-2095	American beech	*Fagus grandifolia*	25	1	12.5	37.5	Fair	Large cavity in crown healing, poor branching structure, exposed roots on slope
GW-2096	Red maple	*Acer rubrum*	14	1	7	21	Fair	Irregular bark, exposed roots on slope
GW-2097	Boxelder	*Acer negundo*	19, 8, 3	3	9.5	28.5	Fair	Multistem 19 x 8 x 3, furrowed bark, irregular branching structure
GW-2098	American beech	*Fagus grandifolia*	26	1	13	39	Good	Small, healed over trunk wound at base
GW-2099	American beech	*Fagus grandifolia*	23	1	11.5	34.5	Good	
GW-2100	American beech	*Fagus grandifolia*	22	1	11	33	Good	Slight bend in trunk
GW-2101	American beech	*Fagus grandifolia*	15	1	7.5	22.5	Fair	Wound in trunk, irregular growth form
GW-2102	American beech	*Fagus grandifolia*	18	1	9	27	Good	
GW-2103*	Tuliptree	*Liriodendron tulipifera*	38	1	19	57	Good	
GW-2104	American beech	*Fagus grandifolia*	24	1	12	36	Good	One sided
GW-2105	American beech	*Fagus grandifolia*	28	1	14	42	Good	
GW-2106*	Tuliptree	*Liriodendron tulipifera*	32	1	16	48	Fair	Thin crown, poor branching structure in crown, minor sapsucker holes observed in trunk
GW-2107	American beech	*Fagus grandifolia*	19	1	9.5	28.5	Fair	Minor cavity in crown, poor branching structure, exposed roots on slope
GW-2108	American beech	*Fagus grandifolia*	15	1	7.5	22.5	Fair	Black spots on trunk, exposed roots on slope
GW-2109*	Tuliptree	*Liriodendron tulipifera*	35	1	17.5	52.5	Good	
GW-2110	American beech	*Fagus grandifolia*	19	1	9.5	28.5	Fair	Severe bend in leader, exposed roots on slope
GW-2111	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Good	
GW-2112	American beech	*Fagus grandifolia*	18	1	9	27	Good	Slightly unbalanced crown, exposed roots on slope
GW-2113	American beech	*Fagus grandifolia*	8	1	4	12	Good	Slightly one sided
GW-2114*	Tuliptree	*Liriodendron tulipifera*	44	1	22	66	Fair	Poor branching structure in crown, some decaying bark on trunk
GW-2115	American beech	*Fagus grandifolia*	22	1	11	33	Good	
GW-2116	Slippery elm	*Ulmus rubra*	12	1	N/A	N/A	Standing Dead	
GW-2117	American beech	*Fagus grandifolia*	23	1	11.5	34.5	Good	
GW-2118	Ash sp.	*Fraxinus sp.*	13	1	N/A	N/A	Standing Dead	
GW-2119	American beech	*Fagus grandifolia*	10	1	5	15	Good	
GW-2120	Mockernut hickory	*Carya tomentosa*	24	1	12	36	Good	
GW-2121	American beech	*Fagus grandifolia*	24	1	12	36	Good	Minor branch dieback in crown
GW-2122	American beech	*Fagus grandifolia*	8	1	4	12	Good	
GW-2123	American elm	*Ulmus americana*	11	1	5.5	16.5	Fair	One sided, thin crown
GW-2124	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Good	Thin crown, broken branches
GW-2125	Red maple	*Acer rubrum*	7	1	3.5	10.5	Fair	Thin crown, dead branches
GW-2126	Red maple	*Acer rubrum*	11	1	5.5	16.5	Poor	Many water sprouts, dead branches, dying crown
GW-2127	Norway maple	*Acer platanoides*	21	1	10.5	31.5	Poor	Significant bark damage, one sided
GW-2128	Northern red oak	*Quercus rubra*	15	1	7.5	22.5	Good	Thin crown
GW-2129	American beech	*Fagus grandifolia*	16	1	8	24	Good	
GW-2130	American basswood	*Tilia americana*	11	1	5.5	16.5	Fair	Bend in trunk, lean
GW-2131*	Tuliptree	*Liriodendron tulipifera*	38	1	19	57	Good	
GW-2132	American basswood	*Tilia americana*	8	1	4	12	Good	Slight lean

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-2133	American basswood	*Tilia americana*	25	1	12.5	37.5	Good	
GW-2134	Sugar maple	*Acer saccharum*	11	1	5.5	16.5	Good	Slightly one sided
GW-2135	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-2136	Red maple	*Acer rubrum*	14	1	7	21	Fair	Leaning into adjacent tree
GW-2138	American beech	*Fagus grandifolia*	10	1	5	15	Good	Bend in trunk
GW-2139	Red maple	*Acer rubrum*	16	1	8	24	Fair	Large broken branches
GW-2140	Red maple	*Acer rubrum*	20, 10	2	10	30	Poor	Hole in trunk, premature leaf drop, many water sprouts. Twins 20 x 10
GW-2141*	Tuliptree	*Liriodendron tulipifera*	34	1	17	51	Good	Thin canopy
GW-2142	Boxelder	*Acer negundo*	9, 3	2	4.5	13.5	Poor	Bend in leader, heavy vines taking over crown. Twins 9 x 3
GW-2143	American elm	*Ulmus americana*	7	1	3.5	10.5	Poor	Significant lean, thin crown, overtopped canopy
GW-2144	Boxelder	*Acer negundo*	6	1	3	9	Poor	Leaning, heavy vines taking over crown
GW-2145	Boxelder	*Acer negundo*	9	1	4.5	13.5	Poor	Bend in leader, heavy vines taking over crown
GW-2146	Sugar maple	*Acer saccharum*	11	1	5.5	16.5	Good	One sided
GW-2147	Tuliptree	*Liriodendron tulipifera*	23, 22	2	11.5	34.5	Fair	Twin trunks 23 x 22, Large cavity between trunks appears to be healing,
GW-2148	Slippery elm	*Ulmus rubra*	9	1	4.5	13.5	Poor	Significant lean, on slope, broken branches
GW-2149	Mockernut hickory	*Carya tomentosa*	11	1	5.5	16.5	Good	Thin crown
GW-2150	American beech	*Fagus grandifolia*	8	1	4	12	Good	Slightly one sided
GW-2151	American beech	*Fagus grandifolia*	9	1	4.5	13.5	Good	Minor branch dieback in crown
GW-2152	American beech	*Fagus grandifolia*	14	1	7	21	Good	Minor bend in leader in crown
GW-2153	Sugar maple	*Acer saccharum*	10	1	5	15	Good	Slightly one sided
GW-2154	Sugar maple	*Acer saccharum*	6	1	3	9	Fair	One sided, overtopped crown
GW-2155	Sugar maple	*Acer saccharum*	11	1	5.5	16.5	Good	
GW-2156	Boxelder	*Acer negundo*	9	1	4.5	13.5	Poor	Vines taking over canopy, little canopy remains
GW-2157*	Tuliptree	*Liriodendron tulipifera*	35	1	17.5	52.5	Fair	Large branch dieback in crown, large cavity on leader in crown healing, poor branching structure
GW-2158	White ash	*Fraxinus americana*	6	1	3	9	Fair	Leaning, unbalanced crown
GW-2159	American basswood	*Tilia americana*	16, 6	2	8	24	Fair	Twin trunks 16 x 6, poor branching structure in crown
GW-2160	Common hackberry	*Celtis occidentalis*	5	1	2.5	7.5	Fair	Dead branches, lean
GW-2161	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Slight lean, low branch dieback, vines into crown
GW-2162	Northern red oak	*Quercus rubra*	8	1	4	12	Fair	Dead wood
GW-2163	Boxelder	*Acer negundo*	6	1	3	9	Fair	Heavy branch dieback in crown, slight lean
GW-2164	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Slight lean, thin crown, minor vines on trunk not yet in canopy
GW-2165	American beech	*Fagus grandifolia*	11	1	5.5	16.5	Good	
GW-2166	Sugar maple	*Acer saccharum*	6	1	3	9	Fair	Bend in trunk
GW-2167	Boxelder	*Acer negundo*	11	1	5.5	16.5	Fair	Vines into crown, poor branching
GW-2168	Tree of heaven	*Ailanthus altissima*	9	1	4.5	13.5	Good	Slight lean
GW-2169	Slippery elm	*Ulmus rubra*	13	1	6.5	19.5	Fair	Leaning, thin crown
GW-2170	White ash	*Fraxinus americana*	22	1	11	33	Good	Slight lean
GW-2171	Sugar maple	*Acer saccharum*	6	1	3	9	Fair	Scorched leaves
GW-2172	Sugar maple	*Acer saccharum*	6	1	3	9	Fair	Burl in trunk, lean, vines on trunk
GW-2173	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Good	Thin canopy
GW-2174	Sugar maple	*Acer saccharum*	8	1	4	12	Fair	Unbalanced crown
GW-2175	Sugar maple	*Acer saccharum*	11	1	5.5	16.5	Fair	Unbalanced crown, poor branching structure
GW-2176	Sugar maple	*Acer saccharum*	10	1	5	15	Good	Thin canopy
GW-2177	Sugar maple	*Acer saccharum*	13	1	6.5	19.5	Fair	Irregular growth form, interfering branches, lean
GW-2178	Tuliptree	*Liriodendron tulipifera*	25	1	12.5	37.5	Fair	Wound on trunk, thin canopy, broken branches
GW-2179	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Good	Slightly one sided
GW-2180	American beech	*Fagus grandifolia*	9	1	4.5	13.5	Good	
GW-2181	Black locust	*Robinia pseudoacacia*	17	1	8.5	25.5	Poor	Heavy vines taking over crown, little canopy remains, lower branch dieback
GW-2182	Slippery elm	*Ulmus rubra*	20	1	10	30	Fair	Heavy vines on lower trunk, lean
GW-2183	Boxelder	*Acer negundo*	19	1	9.5	28.5	Poor	Growing at base of adjacent tree trunk, severely lean
GW-2184*	Tuliptree	*Liriodendron tulipifera*	34, 14	2	17	51	Fair	Twin trunks 14", adjacent tree growing into base of this trunk, poor branching structure

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-2185	Black locust	*Robinia pseudoacacia*	8	1	4	12	Fair	Heavy vines into crown, severe bend in leader, leaning
GW-2186	Black locust	*Robinia pseudoacacia*	11	1	5.5	16.5	Poor	Leaning, heavy vines into crown, little canopy remains
GW-2187	Tuliptree	*Liriodendron tulipifera*	24	1	12	36	Fair	Severe bend in leader
GW-2188	American beech	*Fagus grandifolia*	6	1	3	9	Fair	Slightly one sided
GW-2189	American beech	*Fagus grandifolia*	12	1	6	18	Good	
GW-2190	Slippery elm	*Ulmus rubra*	6	1	3	9	Fair	Leaning, vines into crown
GW-2191	Boxelder	*Acer negundo*	8	1	4	12	Fair	Lean, one sided, water sprouts
GW-2192	Tuliptree	*Liriodendron tulipifera*	27, 22	2	13.5	40.5	Fair	Twin trunks 27 x 22, thin crown, some dead wood in crown
GW-2193	Bitternut hickory	*Carya cordiformis*	24	1	12	36	Good	A little one sided
GW-2194	Hophornbeam	*Ostrya virginiana*	7	1	3.5	10.5	Good	A little one sided
GW-2195	Sugar maple	*Acer saccharum*	13, 8	2	6.5	19.5	Fair	Twin trunks 13 x 8, grape vines entering crown, minor branch dieback
GW-2197	Boxelder	*Acer negundo*	12	1	6	18	Fair	Lean, vines on trunk
GW-2198*	Tuliptree	*Liriodendron tulipifera*	35	1	17.5	52.5	Fair	Thin crown, some dead wood in crown
GW-2199	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Water sprouts, lean, some vines
GW-2200	Boxelder	*Acer negundo*	19	1	9.5	28.5	Fair	Poor branching structure, lower branch dieback, exposed roots
GW-2201	American beech	*Fagus grandifolia*	11, 3	2	5.5	16.5	Fair	Twin trunks 11 x 3, some dead wood in crown
GW-2202	Tuliptree	*Liriodendron tulipifera*	26	1	N/A	N/A	Standing Dead	
GW-2203	American beech	*Fagus grandifolia*	8	1	4	12	Good	
GW-2204	Slippery elm	*Ulmus rubra*	5	1	2.5	7.5	Fair	Slight lean, leaf scorch
GW-2205	Bitternut hickory	*Carya cordiformis*	16	1	8	24	Good	Thin crown
GW-2206	Boxelder	*Acer negundo*	18	1	9	27	Fair	Poor branching structure
GW-2207	American holly	*Ilex opaca*	9	1	4.5	13.5	Good	
GW-2208	Slippery elm	*Ulmus rubra*	5	1	2.5	7.5	Fair	Bend in leader
GW-2209	Boxelder	*Acer negundo*	8	1	4	12	Fair	Leaning, poor branching structure, on road embankment
GW-2210	Pawpaw	*Asimina triloba*	5	1	2.5	7.5	Fair	Leaning
GW-2211	Boxelder	*Acer negundo*	8	1	4	12	Fair	Vines into crown
GW-2212	Unknown		5	1	N/A	N/A	Standing Dead	
GW-2213	Bitternut hickory	*Carya cordiformis*	24	1	12	36	Fair	Branch dieback in crown, poor branching structure
GW-2214	Boxelder	*Acer negundo*	9	1	4.5	13.5	Fair	Twin trunks in crown, poor branching structure, water sprouts
GW-2215	American basswood	*Tilia americana*	8, 7, 5	3	4	12	Fair	Multistem 8 x 7 x 5, cavity at base of trunks
GW-2216	Unknown		6	1	N/A	N/A	Standing Dead	
GW-2217	Unknown		5	1	N/A	N/A	Standing Dead	
GW-2218	American beech	*Fagus grandifolia*	8	1	4	12	Good	Bend in leader
GW-2219	American beech	*Fagus grandifolia*	19	1	9.5	28.5	Fair	Bend in leader
GW-2220	American beech	*Fagus grandifolia*	12	1	6	18	Good	Water sprouts
GW-2221	Tuliptree	*Liriodendron tulipifera*	7	1	3.5	10.5	Good	
GW-2222	Sugar maple	*Acer saccharum*	6	1	3	9	Fair	Branch dieback in crown
GW-2223	Bitternut hickory	*Carya cordiformis*	24	1	12	36	Fair	Very thin crown
GW-2224	Sugar maple	*Acer saccharum*	7	1	3.5	10.5	Good	
GW-2225	Slippery elm	*Ulmus rubra*	5	1	2.5	7.5	Good	Slight lean
GW-2226	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Good	
GW-2227	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Good	
GW-2228	American beech	*Fagus grandifolia*	28	1	14	42	Fair	Large branch dieback
GW-2229	Mockernut hickory	*Carya tomentosa*	23	1	11.5	34.5	Good	Thin crown
GW-2230	Slippery elm	*Ulmus rubra*	5	1	2.5	7.5	Fair	Exposed roots, roots intertwined with adjacent tree, leaning,
GW-2231	Tuliptree	*Liriodendron tulipifera*	15	1	7.5	22.5	Fair	Exposed roots, roots intertwined with adjacent tree
GW-2232	Tuliptree	*Liriodendron tulipifera*	23	1	11.5	34.5	Good	
GW-2233	Unknown		6	1	N/A	N/A	Standing Dead	
GW-2234	Sugar maple	*Acer saccharum*	6	1	3	9	Good	Slight lean
GW-2235	White oak	*Quercus alba*	25	1	12.5	37.5	Fair	Thin crown, branch dieback in crown
GW-2236	Black walnut	*Juglans nigra*	9	1	4.5	13.5	Fair	Severe lean
GW-2237	American beech	*Fagus grandifolia*	13	1	6.5	19.5	Fair	Leaning, fungus observed in crown
GW-2238	Slippery elm	*Ulmus rubra*	6	1	3	9	Fair	Leaning into adjacent tree
GW-2239	Tree of heaven	*Ailanthus altissima*	12	1	6	18	Good	Minor bends in leader
GW-2240	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Fair	Leaning towards road, on road embankment
GW-2241	Tree of heaven	*Ailanthus altissima*	12	1	6	18	Fair	Thin crown
GW-2242	Slippery elm	*Ulmus rubra*	8	1	4	12	Fair	Leaning, bend in leader
GW-2243	American beech	*Fagus grandifolia*	10	1	5	15	Good	

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-2244	Unknown		31	1	N/A	N/A	Standing Dead	
GW-2245	Black walnut	*Juglans nigra*	14	1	7	21	Fair	Thin crown
GW-2246	Boxelder	*Acer negundo*	5	1	2.5	7.5	Good	
GW-2247	American beech	*Fagus grandifolia*	10, 8	2	5	15	Fair	Twin trunks 10 x 8, twin trunks twisting in crown
GW-2248	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-2249	American beech	*Fagus grandifolia*	19	1	9.5	28.5	Good	Long crack in trunk healing,
GW-2250	Tuliptree	*Liriodendron tulipifera*	19	1	9.5	28.5	Good	
GW-2251	Boxelder	*Acer negundo*	6	1	3	9	Fair	Bend in leader
GW-2252	American holly	*Ilex opaca*	6	1	3	9	Good	
GW-2253*	Tuliptree	*Liriodendron tulipifera*	49	1	24.5	73.5	Good	Thin crown for DBH
GW-2254	Boxelder	*Acer negundo*	7	1	3.5	10.5	Fair	Leaning, on ephemeral stream bank
GW-2255	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Fair	Twin trunks above DBH, included bark at Union
GW-2256	Tuliptree	*Liriodendron tulipifera*	26	1	13	39	Good	
GW-2257	Tuliptree	*Liriodendron tulipifera*	11	1	N/A	N/A	Standing Dead	
GW-2258	Northern red oak	*Quercus rubra*	7	1	3.5	10.5	Fair	Leaning, unbalanced crown
GW-2259	White ash	*Fraxinus americana*	10	1	5	15	Fair	Leaning, bend in leader
GW-2260	Norway maple	*Acer platanoides*	13	1	6.5	19.5	Fair	Trunk wound at base mostly healing with some decay, on roadway embankment
GW-2261	American beech	*Fagus grandifolia*	17	1	8.5	25.5	Good	Bend in leader
GW-2262*	White oak	*Quercus alba*	31	1	15.5	46.5	Good	Slight bend in leader
GW-2263*	Tuliptree	*Liriodendron tulipifera*	31	1	15.5	46.5	Fair	Thin crown, irregular bark twisting and exposed in some areas
GW-2264	American basswood	*Tilia americana*	17, 14, 7	3	8.5	25.5	Fair	Multistem 14 x 7, minor cavity at base, slight lean
GW-2265	Mockernut hickory	*Carya tomentosa*	13	1	6.5	19.5	Fair	Leaning poor branching structure
GW-2266	Mockernut hickory	*Carya tomentosa*	7	1	3.5	10.5	Good	Slightly unbalanced crown
GW-2267	Slippery elm	*Ulmus rubra*	12	1	6	18	Good	Slightly unbalanced crown, slight lean
GW-2268	Tuliptree	*Liriodendron tulipifera*	18	1	9	27	Poor	Crown is dead, decaying bark, observed sapsucker holes
GW-2269	Tuliptree	*Liriodendron tulipifera*	17	1	8.5	25.5	Good	Thin crown
GW-2270	American beech	*Fagus grandifolia*	6	1	3	9	Fair	Leaning, large branch removed, on roadway embankment
GW-2271	American basswood	*Tilia americana*	17	1	8.5	25.5	Fair	Twin trunks in the crown, smaller trunk is leaning
GW-2272	Tuliptree	*Liriodendron tulipifera*	22	1	11	33	Good	Thin crown
GW-2273	American beech	*Fagus grandifolia*	6	1	3	9	Good	Minor lean
GW-2274	American beech	*Fagus grandifolia*	7	1	3.5	10.5	Fair	Poor branching structure, water sprouts
GW-2275	American basswood	*Tilia americana*	10	1	5	15	Fair	Leaning, minor bark damage
GW-2276*	Bitternut hickory	*Carya cordiformis*	31	1	15.5	46.5	Good	
GW-2277	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-2278	American basswood	*Tilia americana*	12, 3	2	6	18	Fair	Leaning, dead 3" stem
GW-2279*	White oak	*Quercus alba*	36	1	18	54	Good	
GW-2280	Tuliptree	*Liriodendron tulipifera*	7	1	3.5	10.5	Fair	Minor bend in leader
GW-2281	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	On road embankment, leaning, poor branching structure
GW-2282	Sugar maple	*Acer saccharum*	10	1	5	15	Good	Slightly unbalanced crown
GW-2283	Slippery elm	*Ulmus rubra*	7	1	3.5	10.5	Fair	Branch dieback in crown, leaning, thin crown
GW-2284	American beech	*Fagus grandifolia*	8	1	N/A	N/A	Standing Dead	
GW-2285	American beech	*Fagus grandifolia*	5	1	2.5	7.5	Good	
GW-2286	American basswood	*Tilia americana*	9	1	4.5	13.5	Fair	Leaning, on roadway embankment
GW-2287	Bitternut hickory	*Carya cordiformis*	23	1	11.5	34.5	Fair	Leaning, thin crown
GW-2288	Green ash	*Fraxinus pennsylvanica*	15	1	7.5	22.5	Fair	Leaning, thin crown
GW-2289	American beech	*Fagus grandifolia*	11	1	5.5	16.5	Good	
GW-2290	Slippery elm	*Ulmus rubra*	10	1	5	15	Poor	Heavy vines into crown, leaning
GW-2291	Red maple	*Acer rubrum*	5	1	2.5	7.5	Fair	Leaning, poor branching structure, minor wounds on trunk healing
GW-2292*	Tuliptree	*Liriodendron tulipifera*	40	1	20	60	Good	Minor cavity at base, healing
GW-2293	American beech	*Fagus grandifolia*	12	1	6	18	Good	Leaf scorch and spots observed
GW-2294	Slippery elm	*Ulmus rubra*	11	1	5.5	16.5	Fair	Bend in leader, minor dieback in crown
GW-2295	Black cherry	*Prunus serotina*	12	1	6	18	Fair	Leaning, bend in leader, vines into crown
GW-2296	Bitternut hickory	*Carya cordiformis*	6	1	3	9	Good	Slight bend in leader
GW-2297*	Tuliptree	*Liriodendron tulipifera*	36	1	18	54	Good	Minor cavity at base, minor insect/wood pecked holes
GW-2298	Unknown		33	1	N/A	N/A	Standing Dead	
GW-2299	Slippery elm	*Ulmus rubra*	10	1	5	15	Fair	Bend in leader, wound at base of trunk is mostly healing, minor vines into crown
GW-2300	Black walnut	*Juglans nigra*	6	1	3	9	Good	
GW-2301	Slippery elm	*Ulmus rubra*	8	1	N/A	N/A	Standing Dead	

* INDICATES SPECIMEN TREE

Tree ID	Common Name	Scientific Name	DBH	Number of Stems	SCRZ (ft)	CRZ (ft)	Condition	Condition Notes
GW-2302	Slippery elm	*Ulmus rubra*	6	1	3	9	Good	Bend in leader
GW-2303	Slippery elm	*Ulmus rubra*	11	1	5.5	16.5	Good	Bend in leader, vines into crown
GW-2304	Slippery elm	*Ulmus rubra*	6	1	3	9	Fair	Leaning, vines into crown
GW-2305	Black walnut	*Juglans nigra*	15	1	7.5	22.5	Good	Thin crown
GW-2306	Unknown		27	1	N/A	N/A	Standing Dead	
GW-2307	Unknown		29	1	N/A	N/A	Standing Dead	
GW-2308	Norway maple	*Acer platanoides*	16	1	8	24	Fair	Poor branching structure, unbalanced crown
GW-2309	Norway maple	*Acer platanoides*	6	1	3	9	Good	Unbalanced crown
GW-2310	American beech	*Fagus grandifolia*	17	1	8.5	25.5	Fair	Bend in leader, leaning into adjacent tree
GW-2311	American beech	*Fagus grandifolia*	18	1	9	27	Fair	Bend in leader, leaning into adjacent tree
GW-2312	Tuliptree	*Liriodendron tulipifera*	28	1	14	42	Fair	Leaning, insect/woodpecker holes observed
GW-2313	Slippery elm	*Ulmus rubra*	5	1	2.5	7.5	Fair	Leaning, bend in leader
GW-2314	American beech	*Fagus grandifolia*	8	1	4	12	Fair	Bend in leader, large branch dead/removed
GW-2315	Slippery elm	*Ulmus rubra*	14	1	7	21	Fair	Bend in leader
GW-2316	Northern red oak	*Quercus rubra*	13	1	6.5	19.5	Fair	Leaning, bend in leader
GW-2317	American beech	*Fagus grandifolia*	17	1	8.5	25.5	Good	
GW-2318	Princesstree	*Paulownia tomentosa*	6	1	3	9	Poor	Leaning, heavy vines into crown, poor branching structure, exposed roots
GW-2319	American beech	*Fagus grandifolia*	14	1	7	21	Good	
GW-2320	American beech	*Fagus grandifolia*	16	1	8	24	Good	Minor bend in leader
GW-2321	Norway maple	*Acer platanoides*	8	1	4	12	Fair	Minor cavities on trunk
GW-2322	American beech	*Fagus grandifolia*	23	1	11.5	34.5	Good	
GW-2323	Bitternut hickory	*Carya cordiformis*	24	1	12	36	Fair	Bend in leader, thin crown
GW-2324	White oak	*Quercus alba*	17	1	8.5	25.5	Fair	Bend in leader
GW-2325	White oak	*Quercus alba*	25	1	12.5	37.5	Fair	Unbalanced crown, dead wood in crown
GW-2326	American beech	*Fagus grandifolia*	14	1	7	21	Good	
GW-2327	American beech	*Fagus grandifolia*	6	1	3	9	Good	
GW-2328	Black walnut	*Juglans nigra*	19, 19	2	9.5	28.5	Fair	Twin leaders, slight lean
GW-2329	American beech	*Fagus grandifolia*	17	1	8.5	25.5	Fair	Large dead branches in crown, sap ooze observed from cavity on trunk
GW-2330	Unknown		14	1	N/A	N/A	Standing Dead	

* INDICATES SPECIMEN TREE